ARROYO AVE.

GLEN AVE.

ORANGE GROVE AVE.

DUDLEY ST.

TRACT No 4188

M.B. 54-12

TRACT 1

TRACT 2

TRACT 3

TRACT 4

ORANGE GROVE M.R. 25-84

J. E. PACKARDS

HOLT

UNION AVE.

ERIE ST.

TRACT

lot 33

lot 32

lot 31

lot 30

lot 29

36

37

38

39

40

41

42

43

44

MAP OF TEMPLE AVENUE FROM ~~BELLEVUE AVENUE~~ VALLEY TO BOULEVARD HUDSON AVENUE

COUNTY SURVEYORS MAP Nº B-505

SHEET NO. 1 OF 4 SHEETS

SCALE:- 1 INCH = 100 FT.

WORK ORDER Nº 788

J.E. ROCKHOLD - COUNTY SURVEYOR

SURVEYED APRIL 1929 - AUGUST 1930

SURVEYED UNDER INSTRUCTIONS OF THE BOARD OF SUPERVISORS PER ORDER DATED NOVEMBER 28 1927

BEARINGS ARE BASED ON THE BEARING OF ARROYO AVE. PER C.S. B-428

F.B. 387-76-78, 81 ; F.B. 398-49, 81, 111-113, 119

FIELD WORK BY..... L.D. MOORE
C.E. BRUNTY

OFFICE WORK BY.. JUL BRADSTREET
H. H. REYNOLDS

CHECKED BY..... R. W. STEWART

Sht. 48

Revised March, 1946, D.A. White.

CSB-505-1
A1 OF A4

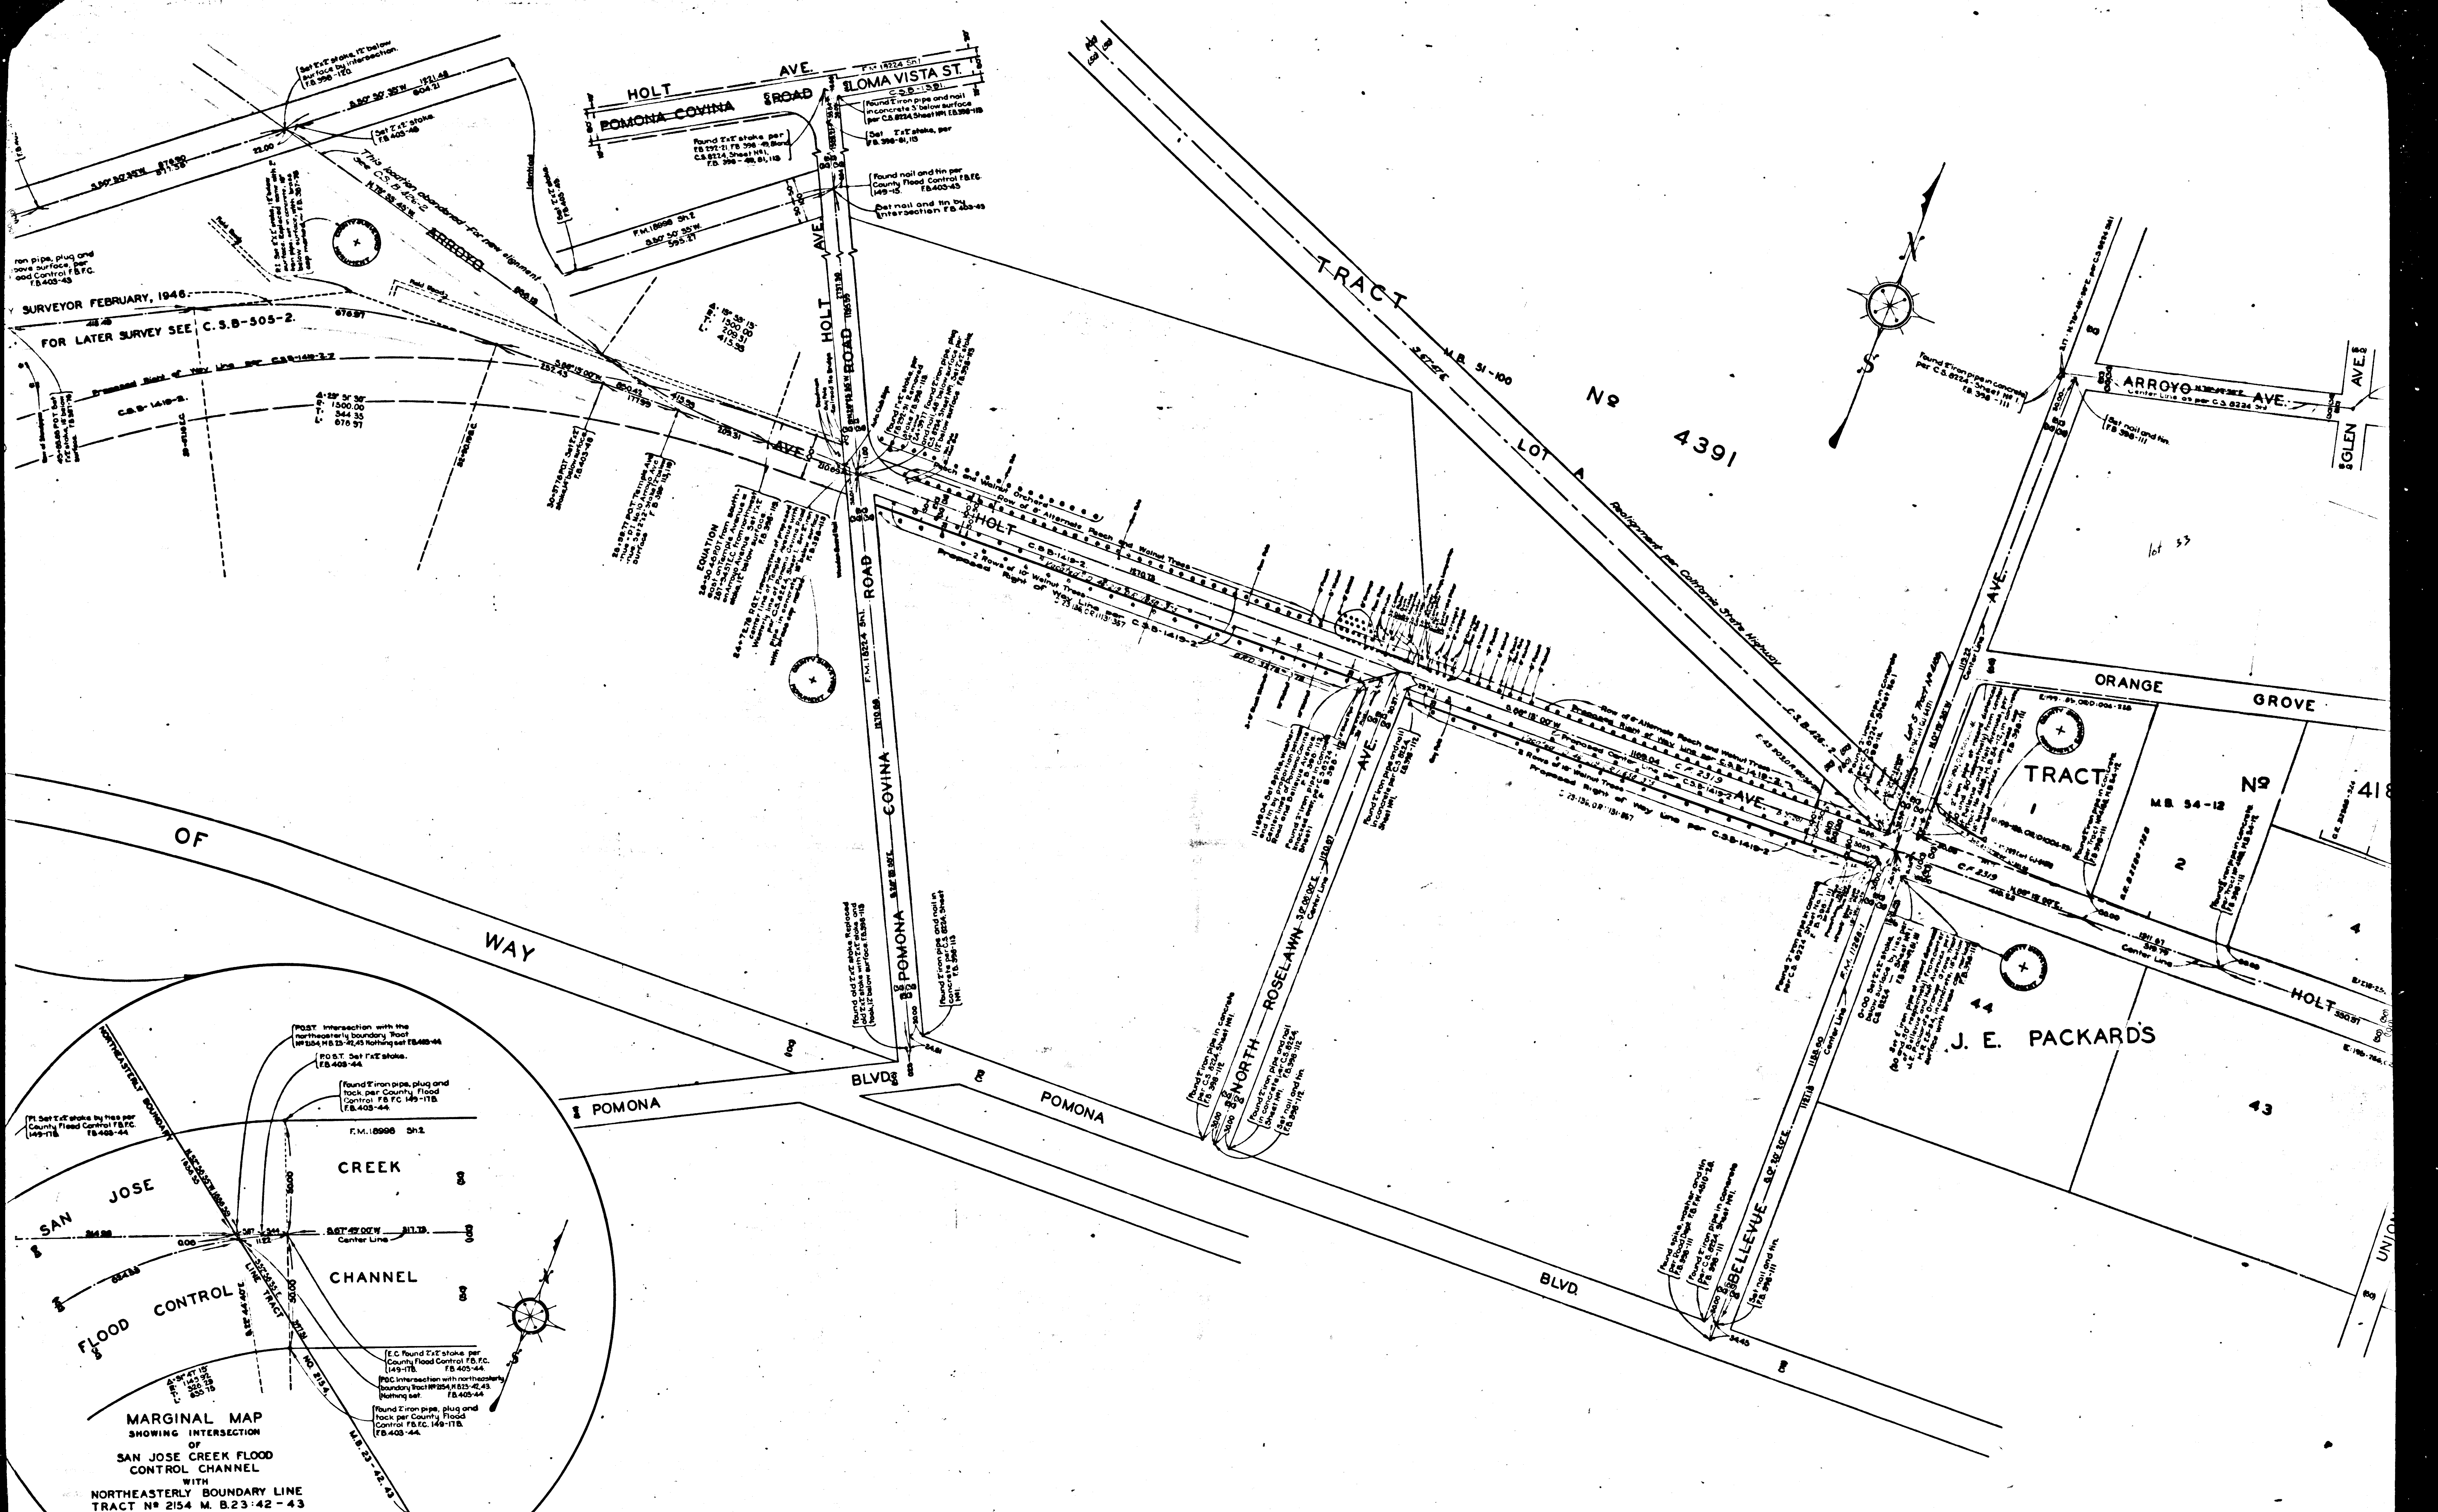

CSB-505-1
A2 OF A4

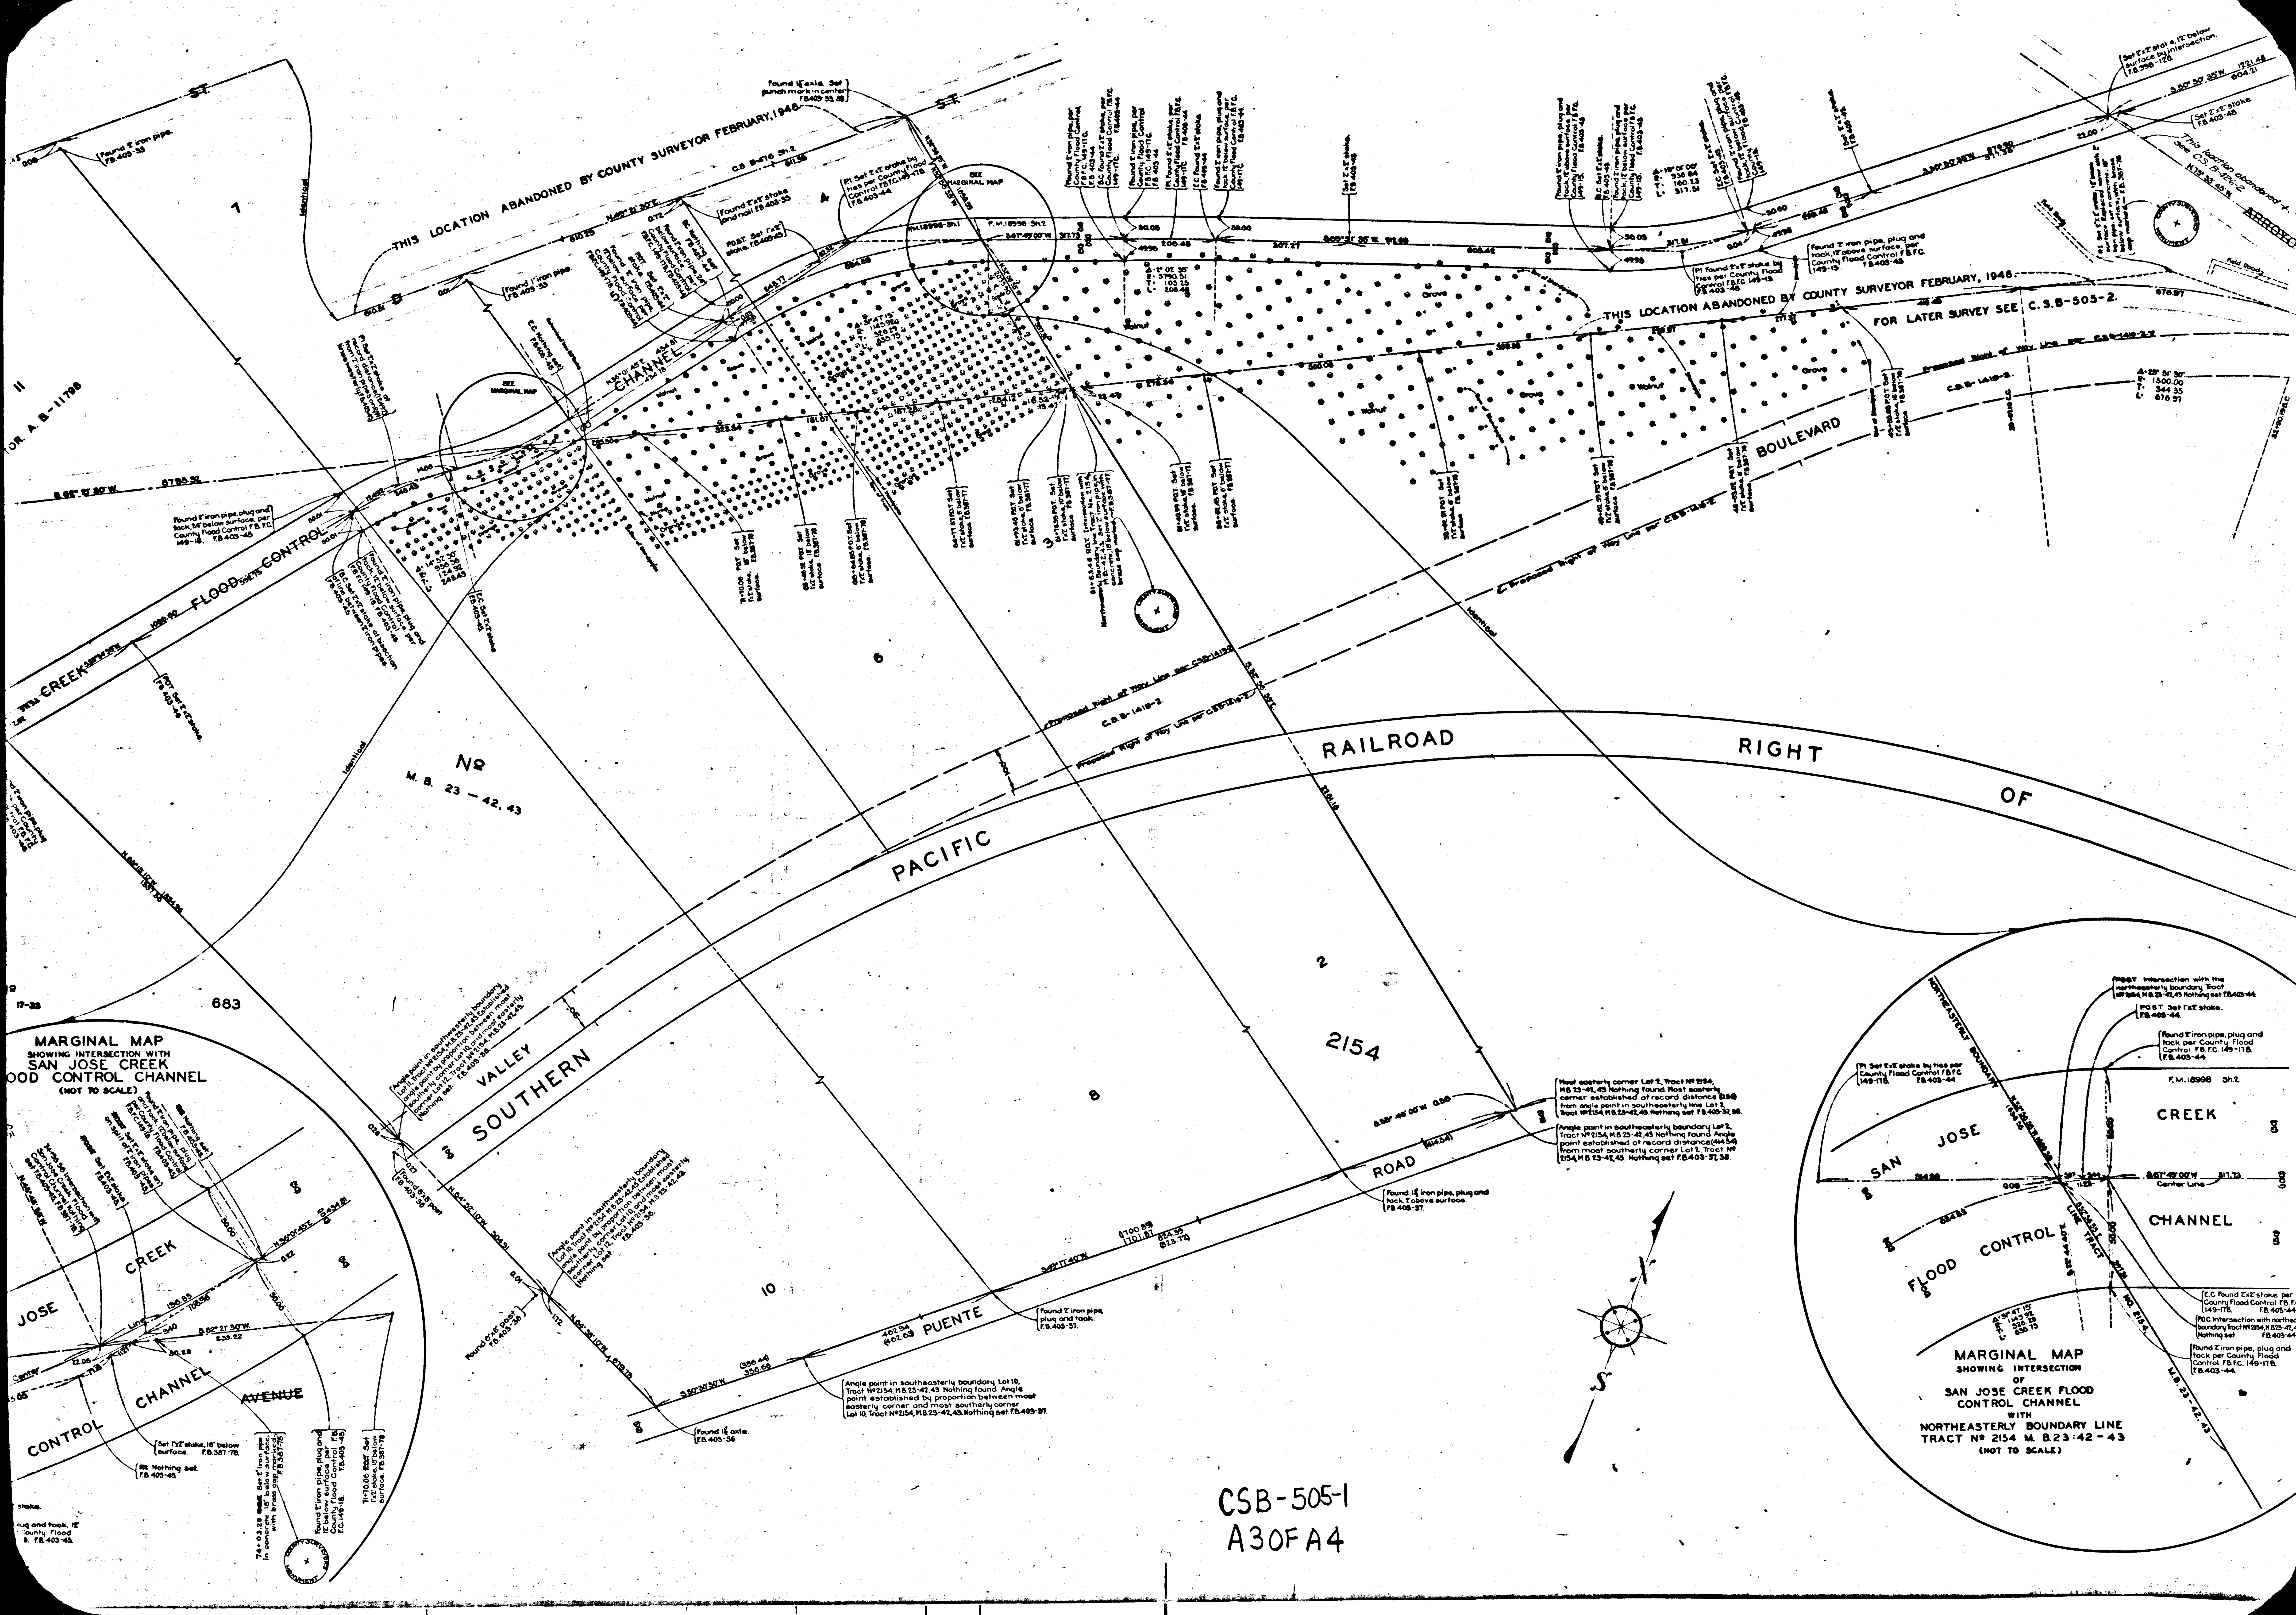
THIS LOCATION ABANDONED BY COUNTY SURVEYOR FEBRUARY, 1946
THIS LOCATION ABANDONED BY COUNTY SURVEYOR FEBRUARY, 1946.
FOR LATER SURVEY SEE C.S.B-505-2.
This location abandoned + see C.S. B-426-2
ST.
C.B. B-476 Sh.2
F.M.18998-Sh.1
F.M.18998-Sh.2
SEE MARGINAL MAP
CREEK FLOOD CONTROL CHANNEL
BOULEVARD
C.B. B-1419-2.
Proposed Right of Way Line per C.S.B-1419-2
SOUTHERN PACIFIC RAILROAD RIGHT OF WAY
VALLEY
PUENTE ROAD
AVENUE
ARROYO
Nº M. B. 23 - 42, 43
2154
683
Walnut
Grove
Orange
Identical
Found 2" iron pipe. F.B. 403-33
Found 1" iron pipe. F.B. 403-33
Found 1½" axle. Set punch mark in center. F.B.403-33, 38
Found 2"x2" stake and nail. F.B. 403-33
Found 2" iron pipe, plug and tack, 24" below surface, per County Flood Control F.B. F.C. 149-18. F.B. 403-45
Found 1½" iron pipe, plug and tack, 1" above surface. F.B. 403-37.
Found 2" iron pipe, plug and tack. F.B. 403-37.
Found 1½" axle. F.B. 403-36
Found 6"x8" post F.B. 403-36
Angle point in southeasterly boundary Lot 10, Tract Nº 2154, M.B. 23-42, 43. Nothing found. Angle point established by proportion between most easterly corner and most southerly corner Lot 10, Tract Nº 2154, M.B. 23-42, 43. Nothing set. F.B. 403-37.
Most easterly corner Lot 2, Tract Nº 2154, M.B. 23-42, 43. Nothing found. Most easterly corner established at record distance (0.56) from angle point in southeasterly line Lot 2, Tract Nº 2154, M.B. 23-42, 43. Nothing set. F.B. 403-37, 38.
Angle point in southeasterly boundary Lot 2, Tract Nº 2154, M.B. 23-42, 43. Nothing found. Angle point established at record distance (414.54) from most southerly corner Lot 2, Tract Nº 2154, M.B. 23-42, 43. Nothing set. F.B. 403-37, 38.
Set 2"x2" stake, 12" below surface by intersection. F.B. 398-126.
Set 2"x2" stake. F.B. 403-43
MARGINAL MAP
SHOWING INTERSECTION WITH
SAN JOSE CREEK
FLOOD CONTROL CHANNEL
(NOT TO SCALE)
MARGINAL MAP
SHOWING INTERSECTION
OF
SAN JOSE CREEK FLOOD
CONTROL CHANNEL
WITH
NORTHEASTERLY BOUNDARY LINE
TRACT Nº 2154 M. B. 23-42-43
(NOT TO SCALE)
NORTHEASTERLY BOUNDARY
Center Line
CSB-505-1
A3OFA4

THIS LOCATION ABANDONED BY COUNTY SURVEYOR FEBRUARY, 1946.

THIS LOCATION ABANDONED BY COUNTY SURVEYOR FEBRUARY, 1946.
FOR LATER SURVEY SEE C.S.B-505-2.

TRACT 13

TRACT 12

TRACT II
TOR. A.B-11798

TRACT

TRACT

TEMPLE AVENUE

WRIGHT
M.B. 5-75

C. M.

SOUTHEASTERLY BOUNDARY RANCHO LA PUENTE

WESTERLY BOUNDARY LINE RANCHO SAN JOSE

COLLINS ST.

SOUTHERN PACIFIC R.R. Co.

VALLEY BLVD.

SAN JOSE CREEK FLOOD CONTROL CHANNEL

MARGINAL MAP
SHOWING
INTERSECTION OF TEMPLE AVENUE WITH EASTERLY BOUNDARY LINE OF RANCHO LA PUENTE-PI:43-44. (NOT TO SCALE)

MARGINAL MAP
SHOWING INTERSECTION WITH
SAN JOSE CREEK
FLOOD CONTROL CHANNEL
(NOT TO SCALE)

CSB-505-1
A4 OF A4