COUNTY OF LOS ANGELES

MAP OF

SECTION LINES AND CORNERS

ESTABLISHED BY THE COUNTY SURVEYOR

IN

T.5N. R.14 & 15W. S.B.M.

COUNTY SURVEYORS MAP NO. B-900

SHEET NO. 1 OF 2 SHEETS

SCALE: 1 INCH = 600 FT.

JOB NUMBER 4000

C. E. ARNOLD - COUNTY SURVEYOR

THIS MAP COMPILED FROM SURVEYS MADE BETWEEN 1921 AND 1940.

BEARINGS ARE BASED ON THE BEARING OF THE SOUTH LINE OF SECTION 31 T.6N. R13W. AS SHOWN C.S. B-745-8.

FIELD BOOKS AS SHOWN IN EACH NOTE.

FIELD WORK	BY	H. WAITE, C.E. BRUNTY, E.T. MANKEY, A. BRACKETT, C.A. BENSON, T.J. STEVENSON, E.A. ROSECRANS.
OFFICE WORK	BY	R. R. McPHERSON C.E. DROWN
CHECKED	BY	R. R. McPHERSON

THIS MAP FILED MARCH 1963

WILLIAM J. FOX - COUNTY SURVEYOR

INDEX 77 & 78 & 64

Monument chosen at N. ¼ corner of section 35, T.5N., R.15W. by S.K. 11/15/62

C.S.B- 900-1

A1 OF A3

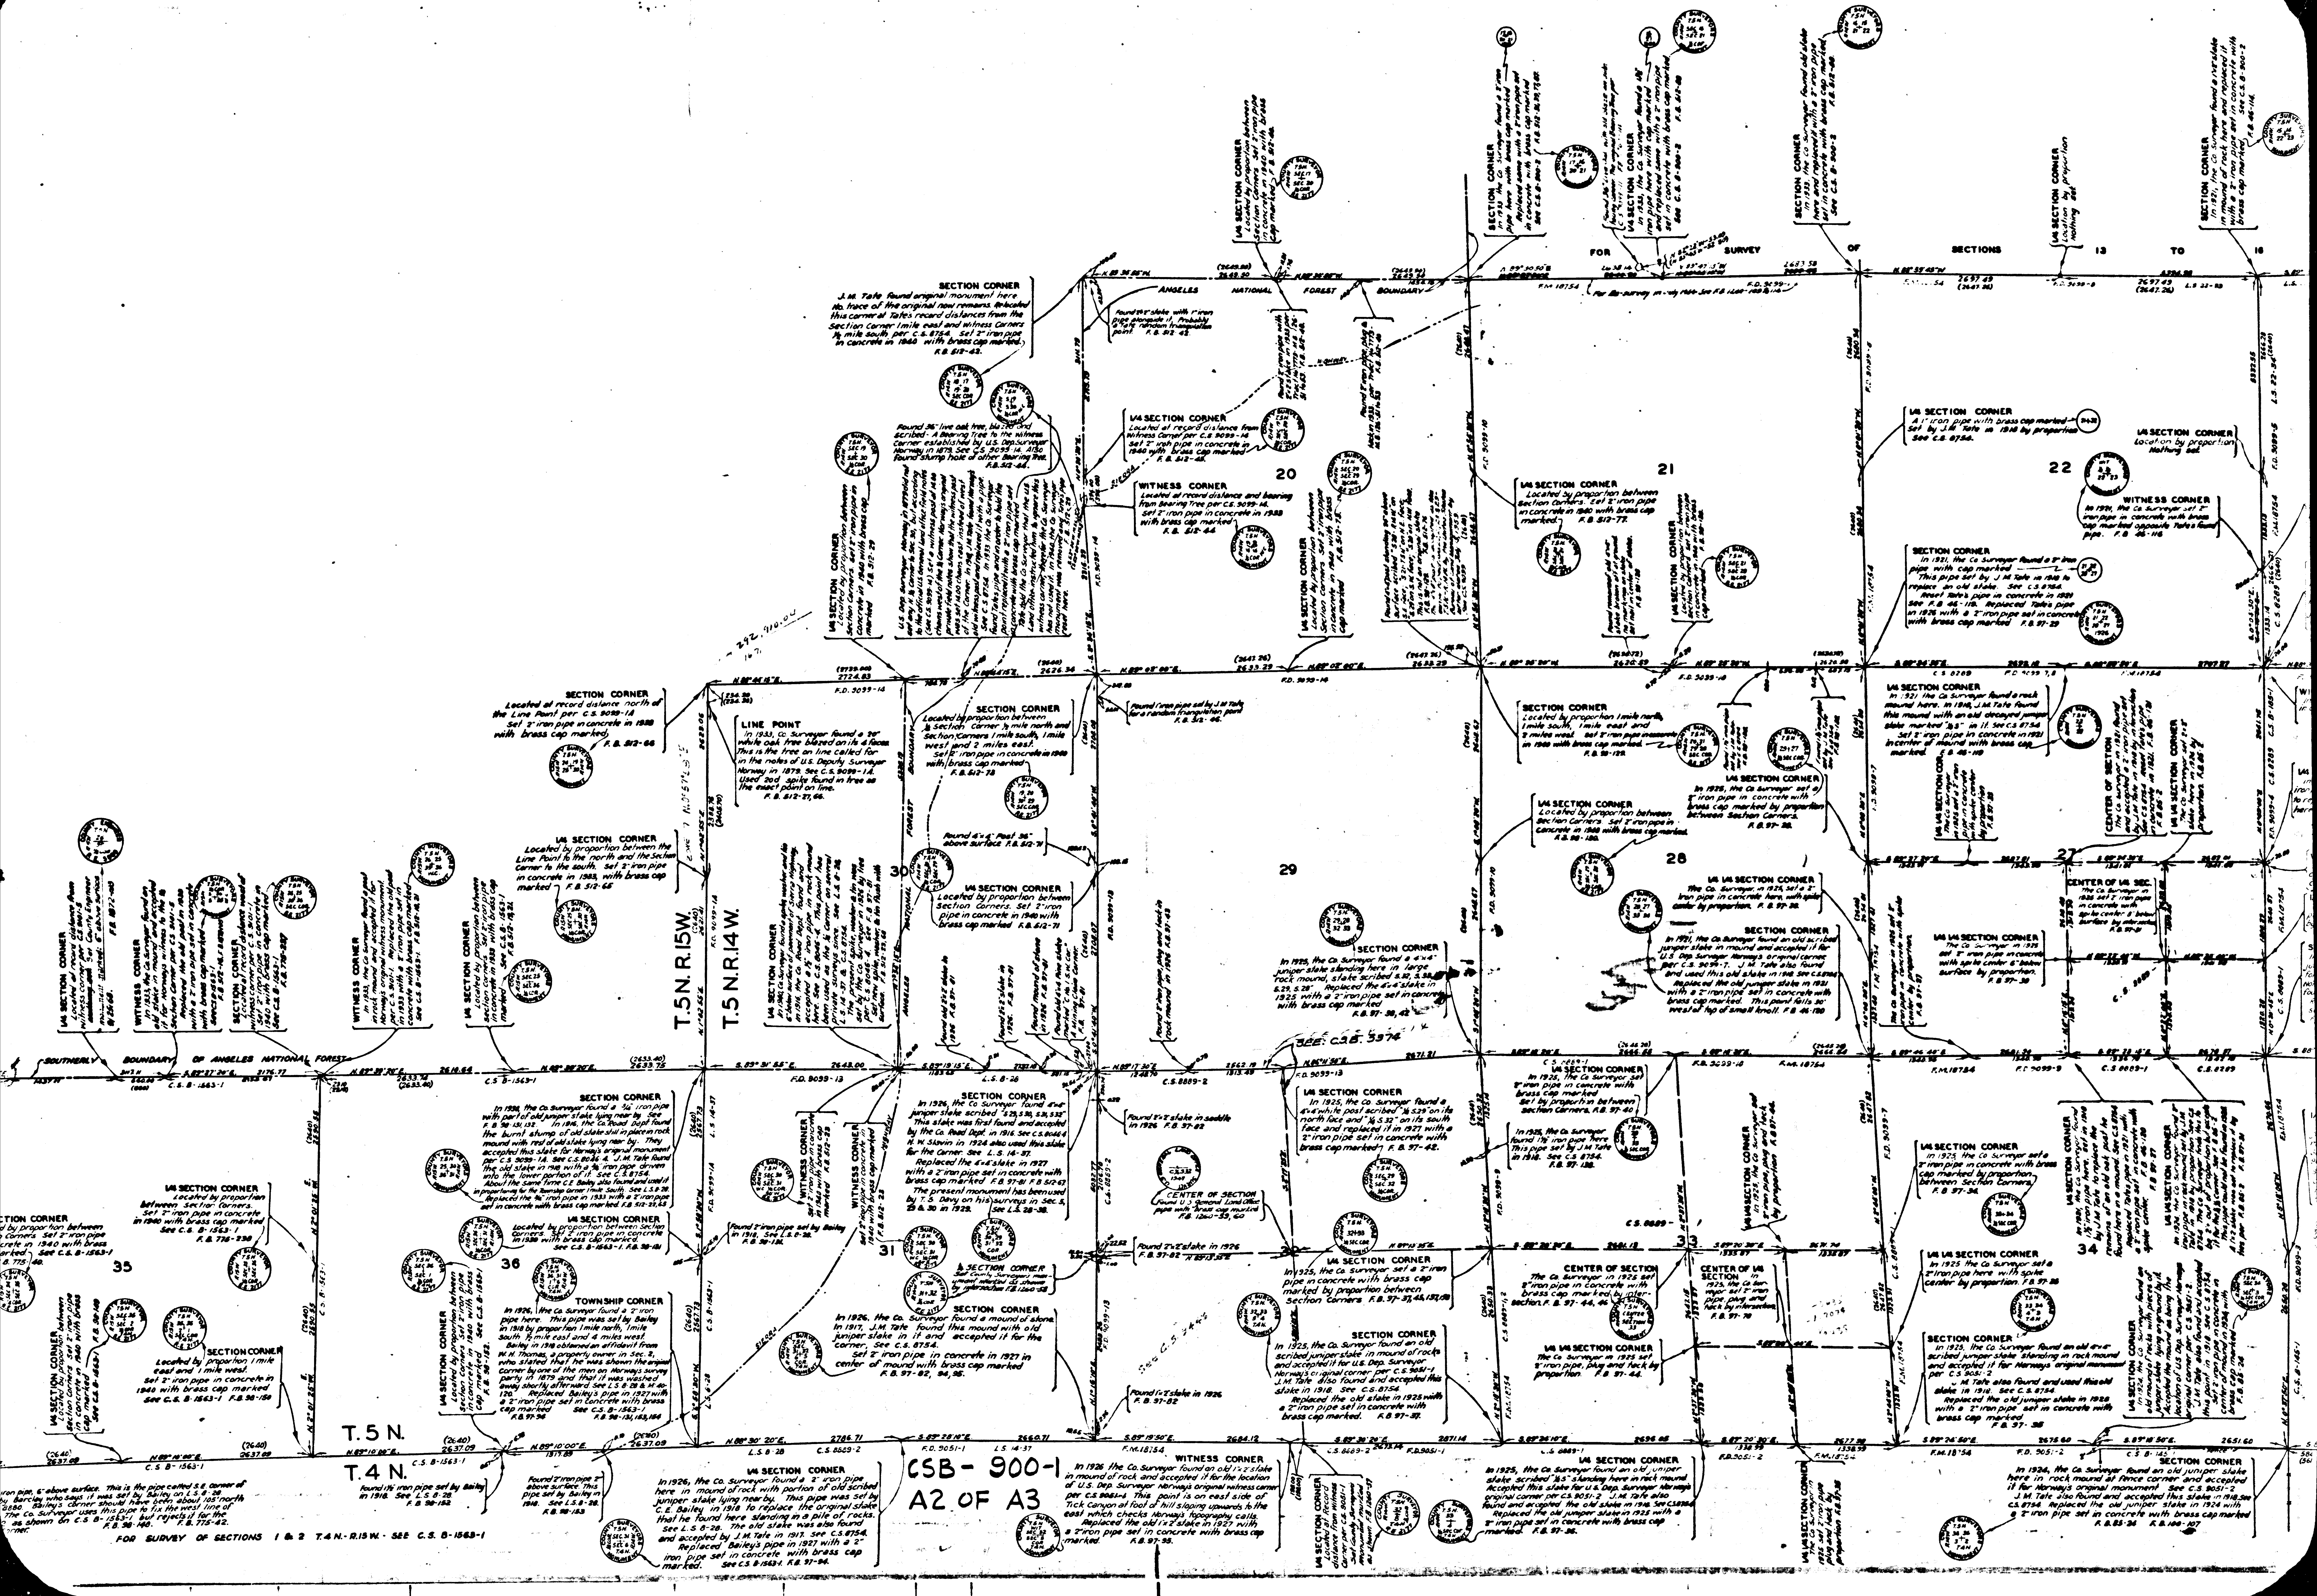

CSB- 900-1
A2 OF A3
T.5N. R.15W.
T.5N. R.14W.
T.5 N.
T.4 N.
ANGELES NATIONAL FOREST BOUNDARY
SOUTHERLY BOUNDARY OF ANGELES NATIONAL FOREST
FOR SURVEY OF SECTIONS 13 TO 16
For Re-survey in July 1964 See F.B. 1260-169 & 114
FOR SURVEY OF SECTIONS 1 & 2 T.4N.-R.15W. - SEE C.S. B-1563-1
20
21
22
27
28
29
30
31
33
34
35
36
SEE: CSB 3974
SECTION CORNER
J.M. Tate found original monument here. No trace of the original now remains. Relocated this corner at Tate's record distances from the Section Corner 1 mile east and Witness Corners ½ mile south per C.S. 8754. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 512-43.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-46.
SECTION CORNER
In 1933, the Co. Surveyor found a 2" iron pipe here with brass cap marked. Replaced same with a 2" iron pipe set in concrete with brass cap marked. See C.S. B-900-2. F.B. 512-31, 77, 85.
1/4 SECTION CORNER
In 1933, the Co. Surveyor found a 1½" iron pipe here with cap marked and replaced same with a 2" iron pipe set in concrete with brass cap marked. See C.S. B-900-2. F.B. 512-28.
SECTION CORNER
In 1933, the Co. Surveyor found old stake here and replaced it with a 2" iron pipe set in concrete with brass cap marked. See C.S. B-900-2. F.B. 512-28.
1/4 SECTION CORNER
Location by proportion. Nothing set.
SECTION CORNER
In 1921, the Co. Surveyor found a 1x2 stake in mound of rock here and replaced it with a 2" iron pipe set in concrete with brass cap marked. See C.S. B-900-2. F.B. 46-114.
Found 2x2" stake with 1" iron pipe alongside it. Probably a Tate random triangulation point. F.B. 512-42.
1/4 SECTION CORNER
Located at record distance from Witness Corner per C.S. 9099-14. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 512-45.
WITNESS CORNER
Located at record distance and bearing from Bearing Tree per C.S. 9099-14. Set 2" iron pipe in concrete in 1938 with brass cap marked. F.B. 512-44.
Found 36" live oak tree, blazed and scribed - A Bearing Tree to the Witness Corner established by U.S. Dep. Surveyor Norway in 1879. See C.S. 9099-14. Also found stump hole of other Bearing Tree. F.B. 512-44.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-29
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-75.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 512-77.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-81.
1/4 SECTION CORNER
A 1" iron pipe with brass cap marked Set by J.M. Tate in 1918 by proportion See C.S. 8754.
1/4 SECTION CORNER
Location by proportion Nothing set.
WITNESS CORNER
In 1921, the Co. Surveyor set 2" iron pipe in concrete with brass cap marked opposite Tate's found pipe. F.B. 46-116
SECTION CORNER
In 1921, the Co. Surveyor found a 2" iron pipe with cap marked. This pipe set by J.M. Tate in 1918 to replace an old stake. See C.S. 8754. Reset Tate's pipe in concrete in 1921 See F.B. 46-119. Replaced Tate's pipe in 1926 with a 2" iron pipe set in concrete with brass cap marked F.B. 97-29
SECTION CORNER
Located at record distance north of the Line Point per C.S. 9099-1A. Set 2" iron pipe in concrete in 1938 with brass cap marked. F.B. 512-66
LINE POINT
In 1933, Co. Surveyor found a 20" white oak tree blazed on its 4 faces. This is the tree on line called for in the notes of U.S. Deputy Surveyor Norway in 1879. See C.S. 9099-1A. Used 20d spike found in tree as the exact point on line. F.B. 512-27, 66.
SECTION CORNER
Located by proportion between ¼ Section Corner ½ mile north and Section Corners 1 mile south, 1 mile west and 2 miles east. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-78
Found 1" iron pipe set by J.M. Tate for a random triangulation point F.B. 512-46.
SECTION CORNER
Located by proportion 1 mile north, 1 mile south, 1 mile east and 2 miles west. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 98-129.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 98-130.
1/4 SECTION CORNER
In 1921 the Co. Surveyor found a rock mound here. In 1918, J.M. Tate found this mound with an old decayed juniper stake marked "¼S" in it. See C.S. 8754. Set 2" iron pipe in concrete in 1921 in center of mound with brass cap marked. F.B. 46-119
1/4 SECTION CORNER
In 1925, the Co. Surveyor set a 2" iron pipe in concrete with brass cap marked by proportion between Section Corners. F.B. 97-28.
1/4 1/4 SECTION CORNER
The Co. Surveyor, in 1925, set a 2" iron pipe in concrete here, with spike center by proportion. F.B. 97-28.
SECTION CORNER
In 1921, the Co. Surveyor found an old scribed juniper stake in mound and accepted it for U.S. Dep. Surveyor Norway's original corner per C.S. 9099-7. J.M. Tate also found and used this old stake in 1918. See C.S. 8754. Replaced the old juniper stake in 1921 with a 2" iron pipe set in concrete with brass cap marked. This point falls 30' west of top of small knoll. F.B. 46-120
CENTER OF SECTION
The Co. Surveyor in 1921 found and accepted a 2" iron pipe set by J.M. Tate in 1918 by intersection. See C.S. 8754. Reset Tate's pipe in concrete in 1921. F.B. 85-2
1/4 1/4 SECTION CORNER
The Co. Surveyor set 2" iron pipe here in 1924 by proportion. F.B. 85-2
CENTER OF 1/4 SEC.
The Co. Surveyor in 1925 set 2" iron pipe in concrete with spike center 6" below surface by intersection. F.B. 97-31
1/4 1/4 SECTION CORNER
The Co. Surveyor in 1925 set 2" iron pipe in concrete with spike center 6" below surface by proportion. F.B. 97-30
1/4 SECTION CORNER
Located at record distance from witness corner per C.S. 9101-S. Set County Engineer F.B. 1872-103
WITNESS CORNER
In 1933, the Co. Surveyor found an old stake in mound and accepted it for Norway's witness to the ½ Section Corner per C.S. 9101-S. Replaced the old post in 1938 with a 2" iron pipe set in concrete with brass cap marked. See C.S. B-1563-1. F.B. 512-18, F.B. 776-239
SECTION CORNER
Located at record distance west of witness corner per C.S. 9101-1. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1. F.B. 776-237
WITNESS CORNER
In 1933, the Co. Surveyor found a post in rock mound and accepted it for Norway's original witness monument per C.S. 9101-1. Replaced the old post in 1933 with a 2" iron pipe set in concrete with brass cap marked See C.S. B-1563-1. F.B. 512-18, 21
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1933 with brass cap marked See C.S. B-1563-1 F.B. 512-18, 21
1/4 SECTION CORNER
Located by proportion between the Line Point to the north and the Section Corner to the south. Set 2" iron pipe in concrete in 1933, with brass cap marked F.B. 512-65
1/4 SECTION CORNER
In 1940, Co. Surveyor found a spike, washer and tin 6" below surface of pavement of Sierra Highway. In 1916, the Co. Road Dept. found and accepted a 1½" iron pipe in rock mound here. See C.S. 8046-4. This point has been used as the ¼ Corner on several private surveys since. See L.S. 14-37 & C.S. 8754. The present spike, washer & tin was set by the Co. Surveyor in 1926 by ties per C.S. 8046-4. See F.B. 97-81. Set new spike, washer & tin flush with surface. F.B. 512-23, 64
Found 4"x4" Post 36" above surface F.B. 512-71
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-71
SECTION CORNER
In 1925, the Co. Surveyor found a 4"x4" juniper stake standing here in large rock mound, stake scribed S.32, S.33, S.29, S.28. Replaced the 4x4 stake in 1925 with a 2" iron pipe set in concrete with brass cap marked F.B. 97-38, 42
SECTION CORNER
In 1938, the Co. Surveyor found a 3/4" iron pipe with part of old juniper stake lying near by. See F.B. 98-131, 132. In 1916, the Co. Road Dept. found the burnt stump of old stake still in place in rock mound with rest of old stake lying near by. They accepted this stake for Norway's original monument per C.S. 9099-1A. See C.S. 8046-4. J.M. Tate found the old stake in 1918 with a 3/4" iron pipe driven into the lower portion of it. See C.S. 8754. About the same time C.E. Bailey also found and used it in proportioning for the Township Corner 1 mile South. See L.S. 8-28. Replaced the 3/4" iron pipe in 1933 with a 2" iron pipe set in concrete with brass cap marked. F.B. 512-22, 65
WITNESS CORNER
Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-23
WITNESS CORNER
Set 2" iron pipe in concrete in 1940 with brass cap marked F.B. 512-23
Found 2" iron pipe set by Bailey in 1918. See L.S. 8-28. F.B. 98-131.
SECTION CORNER
In 1926, the Co. Surveyor found 4"x4" juniper stake scribed "S29, S30, S31, S32". This stake was first found and accepted by the Co. Road Dept. in 1916. See C.S. 8046-4. H.W. Slavin in 1924 also used this stake for the Corner. See L.S. 14-37. Replaced the 4x4 stake in 1927 with a 2" iron pipe set in concrete with brass cap marked F.B. 97-81 F.B. 512-67. The present monument has been used by T.S. Davy on his surveys in Sec. 5, 29 & 30 in 1929. See L.S. 28-38.
Found 2"x2" stake in saddle in 1926 F.B. 97-82
CENTER OF SECTION
Found U.S. General Land Office pipe with brass cap marked F.B. 1260-59, 60
Found 2"x2" stake in 1926 F.B. 97-82
1/4 SECTION CORNER
Set County Surveyor's monument marked as shown by intersection F.B. 1260-58
SECTION CORNER
In 1926, the Co. Surveyor found a mound of stone. In 1917, J.M. Tate found this mound with old juniper stake in it and accepted it for the corner. See C.S. 8754. Set 2" iron pipe in concrete in 1927 in center of mound with brass cap marked F.B. 97-82, 94, 95.
Found 1"x2" stake in 1926 F.B. 97-82
1/4 SECTION CORNER
In 1925, the Co. Surveyor found a 4"x4" white post scribed "¼ S.29" on its north face and "¼ S.32" on its south face and replaced it in 1927 with a 2" iron pipe set in concrete with brass cap marked F.B. 97-42.
1/4 SECTION CORNER
In 1925, the Co. Surveyor set a 2" iron pipe in concrete with brass cap marked by proportion between Section Corners F.B. 97-37, 45, 157, 158
SECTION CORNER
In 1925, the Co. Surveyor found an old scribed juniper stake in mound of rocks and accepted it for U.S. Dep. Surveyor Norway's original corner per C.S. 9051-1. J.M. Tate also found and accepted this stake in 1918. See C.S. 8754. Replaced the old stake in 1925 with a 2" iron pipe set in concrete with brass cap marked. F.B. 97-37.
1/4 SECTION CORNER
In 1925, the Co. Surveyor set a 2" iron pipe in concrete with brass cap marked by proportion between Section Corners. F.B. 97-40
In 1925, the Co. Surveyor found 1½" iron pipe here. This pipe set by J.M. Tate in 1918. See C.S. 8754. F.B. 97-138.
1/4 1/4 SECTION CORNER
In 1925, the Co. Surveyor set 2" iron pipe, plug and tack by proportion. F.B. 97-44.
CENTER OF SECTION
The Co. Surveyor in 1925 set 2" iron pipe in concrete with brass cap marked by intersection. F.B. 97-44, 46
CENTER OF 1/4 SECTION
In 1925, the Co. Surveyor set 2" iron pipe, plug and tack by intersection. F.B. 97-70
1/4 1/4 SECTION CORNER
The Co. Surveyor in 1925 set 2" iron pipe, plug and tack by proportion. F.B. 97-44.
1/4 SECTION CORNER
In 1925 the Co. Surveyor set a 2" iron pipe in concrete with brass cap marked by proportion between Section Corners. F.B. 97-34.
1/4 1/4 SECTION CORNER
In 1925 the Co. Surveyor set a 2" iron pipe here with spike center by proportion. F.B. 97-36
SECTION CORNER
In 1925, the Co. Surveyor found an old 4"x6" scribed juniper stake standing in rock mound and accepted it for Norway's original monument per C.S. 9051-2. J.M. Tate also found and used this old stake in 1918. See C.S. 8754. Replaced the old juniper stake in 1928 with a 2" iron pipe set in concrete with brass cap marked F.B. 97-36
1/4 SECTION CORNER
In 1924, the Co. Surveyor found an old mound of rocks with pieces of juniper stake lying on ground by it. Accepted the mound as being the location of U.S. Dep. Surveyor Norway's original corner per C.S. 9051-2. J.M. Tate also found and accepted this point in 1918. See C.S. 8754. Set 2" iron pipe in concrete in center of mound in 1924 with brass cap marked F.B. 85-24
1/4 SECTION CORNER
In 1921, the Co. Surveyor found 1½" iron pipe here, set in 1918 by J.M. Tate to replace the remains of an old oak post he found here in a mound. See C.S. 8754. Replaced Tate's pipe in 1921 with a 2" iron pipe set in concrete with spike center. F.B. 46-120 F.B. 97-27
1/4 SECTION CORNER
In 1925, the Co. Surveyor found an old juniper stake scribed "¼S" standing here in rock mound. Accepted this stake for U.S. Dep. Surveyor Norway's original corner per C.S. 9051-2. J.M. Tate also found and accepted the old stake in 1918. See C.S. 8754. Replaced the old juniper stake in 1925 with a 2" iron pipe set in concrete with brass cap marked. F.B. 97-36.
1/4 1/4 SECTION CORNER
The Co. Surveyor in 1925 set 2" iron pipe plug and tack by proportion F.B. 97-35
SECTION CORNER
In 1924, the Co. Surveyor found an old juniper stake here in rock mound at fence corner and accepted it for Norway's original monument. See C.S. 9051-2. J.M. Tate also found and accepted this stake in 1918. See C.S. 8754. Replaced the old juniper stake in 1924 with a 2" iron pipe set in concrete with brass cap marked F.B. 85-24 F.B. 100-107
WITNESS CORNER
In 1926 the Co. Surveyor found an old 1"x2" stake in mound of rock and accepted it for the location of U.S. Dep. Surveyor Norway's original witness corner per C.S. 9051-1. This point is on east side of Tick Canyon at foot of hill sloping upwards to the east which checks Norway's topography calls. Replaced the old 1x2 stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 97-35.
1/4 SECTION CORNER
Located at Record distance from Witness Corner per C.S. 9051-1. Set County Surveyor's monument marked as shown. F.B. 1260-57
1/4 SECTION CORNER
In 1926, the Co. Surveyor found a 2" iron pipe here in mound of rock with portion of old scribed juniper stake lying near by. This pipe was set by C.E. Bailey in 1918 to replace the original stake that he found here standing in a pile of rocks. See L.S. 8-28. The old stake was also found and accepted by J.M. Tate in 1917. See C.S. 8754. Replaced Bailey's pipe in 1927 with a 2" iron pipe set in concrete with brass cap marked. See C.S. B-1563-1. F.B. 97-94.
TOWNSHIP CORNER
In 1926, the Co. Surveyor found a 2" iron pipe here. This pipe was set by Bailey in 1918 by proportion 1 mile north, 1 mile south, ½ mile east and 4 miles west. Bailey in 1918 obtained an affidavit from W.H. Thomas, a property owner in Sec. 2, who stated that he was shown the original corner by one of the men on Norway's survey party in 1879 and that it was washed away shortly afterward. See L.S. 8-28 & M. 40-120. Replaced Bailey's pipe in 1927 with a 2" iron pipe set in concrete with brass cap marked See C.S. B-1563-1 F.B. 97-94 F.B. 98-131, 153, 154
Found 1½" iron pipe set by Bailey in 1918. See L.S. 8-28. F.B. 98-152
Found 2" iron pipe 2" above surface. This pipe set by Bailey in 1918. See L.S. 8-28. F.B. 98-153
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1. F.B. 98-181
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. See C.S. B-1563-1. F.B. 776-238
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. See C.S. B-1563-1. F.B. 775-40.
SECTION CORNER
Located by proportion 1 mile east and 1 mile west. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1 F.B. 98-150
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1 F.B. 98-149
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. See C.S. B-1563-1. F.B. 98-152.
iron pipe, 6" above surface. This is the pipe called S.E. corner of by Barclay who says it was set by Bailey on L.S. 8-28. 8880. Bailey's corner should have been about 105' north. The Co. Surveyor uses this pipe to fix the west line of as shown on C.S. B-1563-1 but rejects it for the corner. F.B. 98-148. F.B. 775-42.

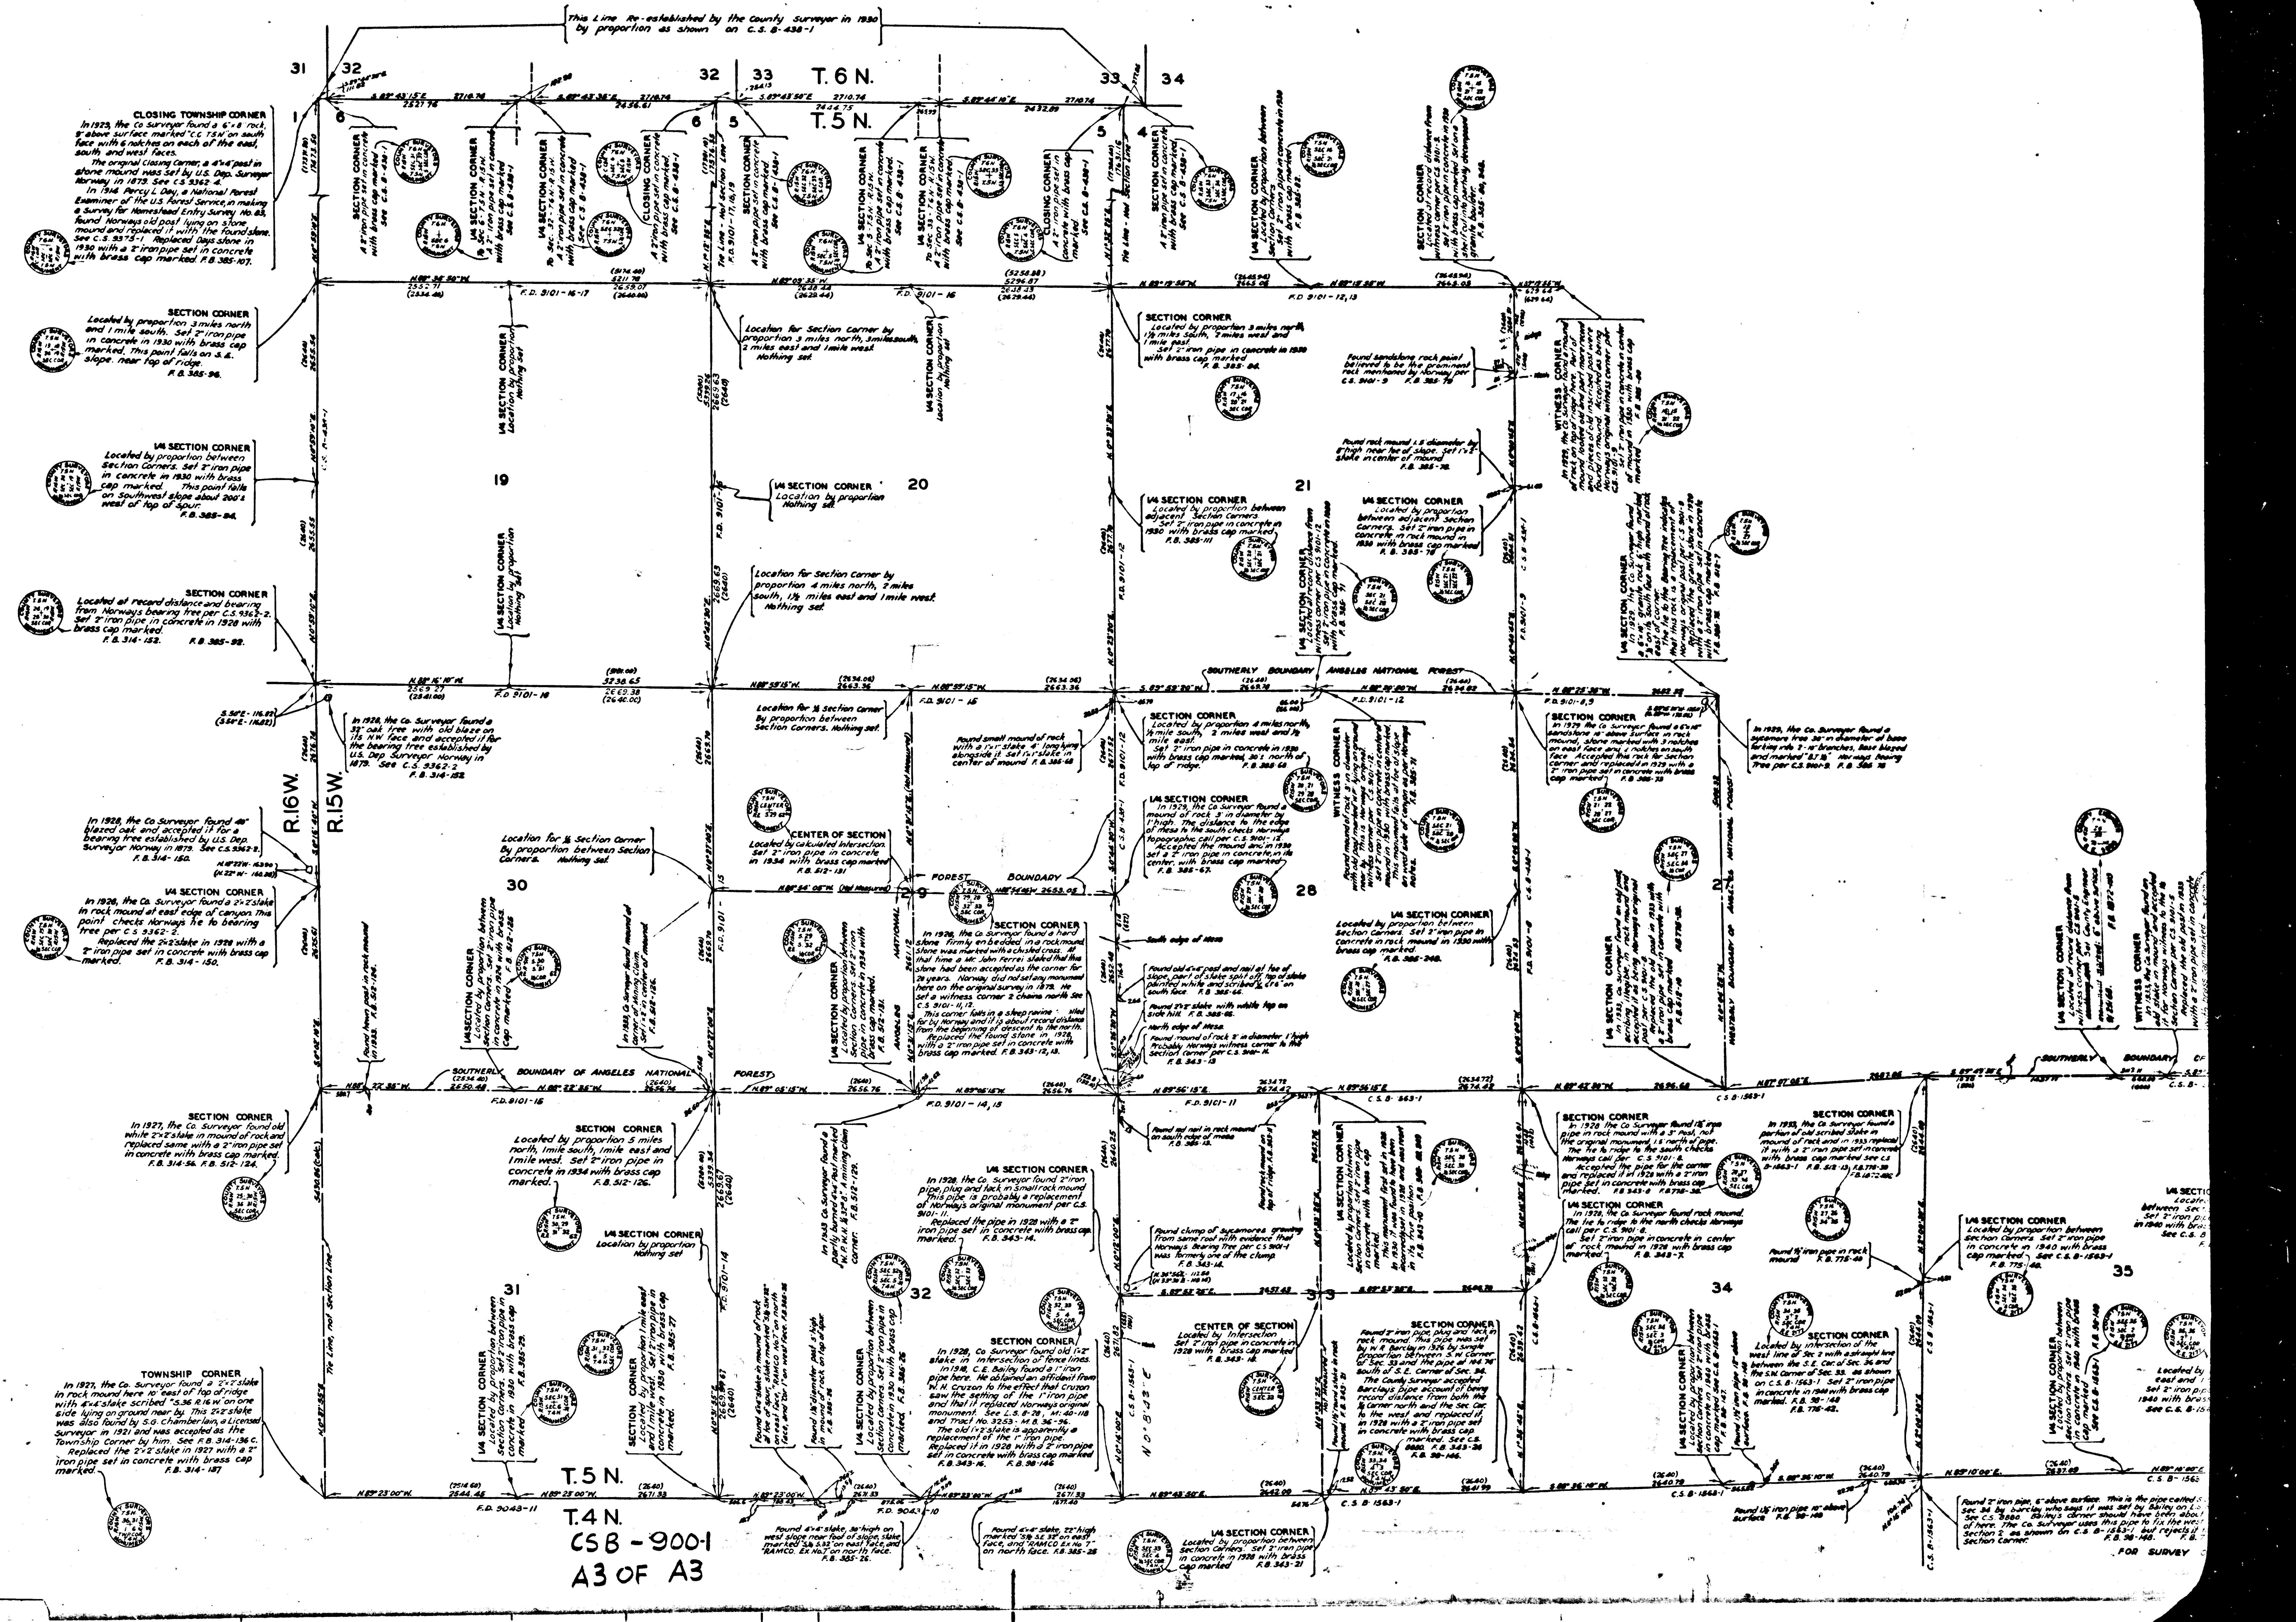

This Line Re-established by the County Surveyor in 1930 by proportion as shown on C.S. B-438-1
T. 6 N.
T. 5 N.
T. 4 N.
R.16W.
R.15W.
CLOSING TOWNSHIP CORNER
In 1923, the Co Surveyor found a 6"x8" rock, 9" above surface marked "C.C T5N" on south face with 6 notches on each of the east, south and west faces.
The original Closing Corner, a 4"x4" post in stone mound was set by U.S. Dep. Surveyor Norway in 1879. See C.S. 9362-4.
In 1914 Percy L. Day, a National Forest Examiner of the U.S. Forest Service, in making a Survey for Homestead Entry Survey No. 83, found Norways old post lying on stone mound and replaced it with the found stone. See C.S. 9375-1. Replaced Days stone in 1930 with a 2" iron pipe set in concrete with brass cap marked. F.B. 385-107.
SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1
1/4 SECTION CORNER
To Sec. 6-T5N-R15W. A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1
1/4 SECTION CORNER
To Sec. 32-T6N-R15W. A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1
CLOSING CORNER
A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1
Tie Line - Not Section Line F.B. 9101-17,18,19
SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1
1/4 SECTION CORNER
To Sec 5-T5N-R15W. A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1
1/4 SECTION CORNER
To Sec 33-T6N-R15W. A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1
CLOSING CORNER
A 2" iron pipe set in concrete with brass cap marked. See C.S. B-438-1
Tie Line - Not Section Line
SECTION CORNER
A 2" iron pipe set in concrete with brass cap marked See C.S. B-438-1
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-82.
SECTION CORNER
Located at record distance from witness corner per C.S. 9101-3. Set 2" iron pipe in concrete in 1930 with brass cap marked. Set on a shelf cut into partially decomposed granite boulder. F.B. 385-80, 348.
SECTION CORNER
Located by proportion 3 miles north and 1 mile south. Set 2" iron pipe in concrete in 1930 with brass cap marked. This point falls on S.E. slope, near top of ridge. F.B. 385-96.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked. This point falls on Southwest slope about 200'± west of top of spur. F.B. 385-94.
SECTION CORNER
Located at record distance and bearing from Norways bearing tree per C.S. 9362-2. Set 2" iron pipe in concrete in 1928 with brass cap marked. F.B. 314-152. F.B. 385-92.
1/4 SECTION CORNER
Location by proportion Nothing set
1/4 SECTION CORNER
Location by proportion Nothing set
Location for Section Corner by proportion 3 miles north, 3 miles south, 2 miles east and 1 mile west. Nothing set.
1/4 SECTION CORNER
Location by proportion Nothing set
1/4 SECTION CORNER
Location by proportion Nothing set.
Location for Section Corner by proportion 4 miles north, 2 miles south, 1½ miles east and 1 mile west. Nothing set.
SECTION CORNER
Located by proportion 3 miles north, 1½ miles south, 2 miles west and 1 mile east. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-84.
Found sandstone rock point believed to be the prominent rock mentioned by Norway per C.S. 9101-9 F.B. 385-79
WITNESS CORNER
In 1929, the Co Surveyor found a mound of rock on top of ridge here. Part of mound looked old and part more recent and pieces of old inscribed post were found in mound. Accepted as being Norways original witness corner per C.S. 9101-9. Set 2" iron pipe in concrete in center of mound in 1930 with brass cap marked F.B. 385-80
Found rock mound 1.5' diameter by 8" high near toe of slope. Set 1"x2" stake in center of mound F.B. 385-78.
1/4 SECTION CORNER
Located by proportion between adjacent Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-111
1/4 SECTION CORNER
Located at record distance from witness corner per C.S. 9101-12. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-71
1/4 SECTION CORNER
Located by proportion between adjacent Section Corners. Set 2" iron pipe in concrete in rock mound in 1930 with brass cap marked F.B. 385-76
1/4 SECTION CORNER
In 1929, the Co Surveyor found a 6"x10" granite rock 6" high marked "¼" on its South face with mound of rock east of corner. The tie to the Bearing Tree indicates that this rock is a replacement of Norways original post per C.S. 9101-9. Replaced the granite stone in 1930 with a 2" iron pipe set in concrete with brass cap marked F.B. 385-78 F.B. 518-7
SOUTHERLY BOUNDARY ANGELES NATIONAL FOREST
In 1928, the Co. Surveyor found a 32" oak tree with old blaze on its N.W face and accepted it for the bearing tree established by U.S. Dep Surveyor Norway in 1879. See C.S. 9362-2 F.B. 314-152
Location for ¼ Section Corner By proportion between Section Corners. Nothing set.
Found small mound of rock with a 1"x1" stake 4' long lying alongside it. Set 1"x1" stake in center of mound F.B. 385-68
SECTION CORNER
Located by proportion 4 miles north, ½ mile south, 2 miles west and ½ mile east. Set 2" iron pipe in concrete in 1930 with brass cap marked, 30'± north of top of ridge. F.B. 385-68.
WITNESS CORNER
Found mound of rock 3' in diameter with old post marked "W" lying on ground near by. This is Norways original Witness corner per C.S. 9101-12. Set 2" iron pipe in concrete in center of mound in 1930 with brass cap marked. This monument falls at toe of slope on west side of canyon as per Norways notes. F.B. 385-71
SECTION CORNER
In 1929 the Co Surveyor found a 6"x16" sandstone 10" above surface in rock mound, stone marked with 3 notches on east face and 2 notches on south face. Accepted this rock for Section corner and replaced it in 1929 with a 2" iron pipe set in concrete with brass cap marked F.B. 385-73
In 1929, the Co. Surveyor found a sycamore tree 30" in diameter at base forking into 2-15" branches, Base blazed and marked "BT ¼" Norways Bearing Tree per C.S. 9101-9. F.B. 385-78
In 1928, the Co Surveyor found 40" blazed oak and accepted it for a bearing tree established by U.S. Dep. Surveyor Norway in 1879. See C.S. 9362-2. F.B. 314-150.
1/4 SECTION CORNER
In 1928, the Co. Surveyor found a 2"x2" stake in rock mound at east edge of canyon. This point checks Norways tie to bearing tree per C.S. 9362-2. Replaced the 2"x2" stake in 1928 with a 2" iron pipe set in concrete with brass cap marked. F.B. 314-150.
Location for ¼ Section Corner By proportion between Section Corners. Nothing set.
CENTER OF SECTION
Located by calculated Intersection. Set 2" iron pipe in concrete in 1934 with brass cap marked F.B. 512-131
1/4 SECTION CORNER
In 1929, the Co Surveyor found a mound of rock 3' in diameter by 1' high. The distance to the edge of mesa to the south checks Norways topographic call per C.S. 9101-12. Accepted the mound and in 1930 set a 2" iron pipe in concrete, in its center, with brass cap marked F.B. 385-67.
FOREST BOUNDARY
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-248.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1934 with brass cap marked F.B. 512-125
In 1933, Co Surveyor found mound of corner of Mining Claim. Set 1"x2" in center of mound F.B. 518-126.
Found hewn post in rock mound in 1933. F.B. 512-124.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1934 with brass cap marked. F.B. 512-131.
SECTION CORNER
In 1928, the Co. Surveyor found a hard stone firmly embedded in a rock mound. Stone was marked with a chisled cross. At that time a Mr. John Ferrei staked that this stone had been accepted as the corner for 20 years. Norway did not set any monument here on the original survey in 1879. He set a witness corner 2 chains north See C.S 9101-11, 12. This corner falls in a steep ravine called for by Norway and it is about record distance from the beginning of descent to the north. Replaced the found stone in 1928 with a 2" iron pipe set in concrete with brass cap marked. F.B 343-12, 13.
South edge of Mesa
Found old 4"x4" post and nail at toe of slope, part of stake split off, top of stake painted white and scribed "¼ C16" on south face. F.B 385-66.
Found 2"x2" stake with white top on side hill. F.B. 385-66.
North edge of Mesa.
Found mound of rock 2' in diameter 1' high Probably Norways witness corner to the Section Corner per C.S. 9101-11. F.B. 343-13
1/4 SECTION CORNER
In 1933, Co Surveyor found an old post scribing illegible, in rock mound and accepted it as being Norways original post per C.S 9101-8. Replaced the old post in 1933 with a 2" iron pipe set in concrete with brass cap marked F.B. 518-10
WESTERLY BOUNDARY OF ANGELES NATIONAL FOREST
1/4 SECTION CORNER
Located at record distance from witness corner per C.S. 9101-8 Set County Engineer Monument 6" above surface F.B. 1872-180
WITNESS CORNER
In 1933, the Co Surveyor found an old stake in mound and accepted it for Norways witness to the ¼ Section Corner per C.S. 9101-5 Replaced the old post in 1933 with a 2" iron pipe set in concrete with brass cap marked
SOUTHERLY BOUNDARY OF
SECTION CORNER
In 1927, the Co. Surveyor found old white 2"x2" stake in mound of rock and replaced same with a 2" iron pipe set in concrete with brass cap marked. F.B. 314-56. F.B. 512-124.
SECTION CORNER
Located by proportion 5 miles north, 1 mile south, 1 mile east and 1 mile west. Set 2" iron pipe in concrete in 1934 with brass cap marked. F.B. 512-126.
1/4 SECTION CORNER
Location by proportion Nothing set
SOUTHERLY BOUNDARY OF ANGELES NATIONAL FOREST
In 1933 Co. Surveyor found a partly burned 4"x4" Post marked "W.P. W.H. ¼ 32 S". A mining claim corner. F.B. 512-129.
1/4 SECTION CORNER
In 1928, the Co. Surveyor found 2" iron pipe, plug and tack in small rock mound. This pipe is probably a replacement of Norway's original monument per C.S. 9101-11. Replaced the pipe in 1928 with a 2" iron pipe set in concrete with brass cap marked. F.B. 343-14.
Found red nail in rock mound on south edge of mesa F.B. 385-13.
Found rock mound on top of ridge. F.B. 343-11
Found clump of sycamores growing from same root with evidence that Norways Bearing Tree per C.S 9101-1 was formerly one of the clump. F.B. 343-14.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete with brass cap marked. This monument first set in 1928 in 1930 it was found to have been incorrectly set in 1928 and was reset in its true position F.B. 343-10
SECTION CORNER
In 1928 the Co Surveyor found 1½" iron pipe in rock mound with a 3" Post, not the original monument, 1.5' north of pipe. The tie to ridge to the south checks Norways call per C.S. 9101-8. Accepted the pipe for the corner and replaced it in 1928 with a 2" iron pipe set in concrete with brass cap marked. F.B. 343-8 F.B. 775-38.
SECTION CORNER
In 1933, the Co. Surveyor found a portion of old scribed stake in mound of rock and in 1933 replaced it with a 2" iron pipe set in concrete with brass cap marked see C.S. B-1563-1 F.B. 512-13, F.B. 775-39 F.B. 1872-180
1/4 SECTION CORNER
In 1928, the Co Surveyor found rock mound. The tie to ridge to the north checks Norways call per C.S. 9101-8. Set 2" iron pipe in concrete in center of rock mound in 1928 with brass cap marked. F.B. 343-7.
Found ½" iron pipe in rock mound F.B. 775-40
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked. See C.S. B-1563-1 F.B. 775-40.
TOWNSHIP CORNER
In 1927, the Co. Surveyor found a 2"x2" stake in rock mound here 10' east of top of ridge with 4"x4" stake scribed "S.36 R.16 W." on one side lying on ground near by. This 2"x2" stake was also found by S.G. Chamberlain, a Licensed Surveyor in 1921 and was accepted as the Township Corner by him. See F.B. 314-136 C. Replaced the 2"x2" stake in 1927 with a 2" iron pipe set in concrete with brass cap marked. F.B. 314-137
Tie Line, not Section Line
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-29.
SECTION CORNER
Located by proportion 1 mile east and 1 mile west. Set 2" iron pipe in concrete in 1930 with brass cap marked. F.B. 385-27
Found 4"x4" stake in mound of rock at toe of spur, stake marked "S⅙ S.W 32" on east face, "RAMCO No.7" on north face, and "Cor 1" on west face. F.B. 385-26
Found 1½" diameter post 5' high in mound of rock on top of spur. F.B. 385-26
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1930 with brass cap marked F.B. 385-26
SECTION CORNER
In 1928, Co Surveyor found old 1"x2" stake in intersection of fence lines. In 1918, C.E. Bailey found a 1" iron pipe here. He obtained an affidavit from W. H. Cruzon to the effect that Cruzon saw the setting of the 1" iron pipe and that it replaced Norways original monument. See L.S. 8-28, M: 40-118 and Tract No. 3253 - M.B. 36-96. The old 1"x2" stake is apparently a replacement of the 1" iron pipe. Replaced it in 1928 with a 2" iron pipe set in concrete with brass cap marked F.B. 343-16. F.B. 98-146
CENTER OF SECTION
Located by Intersection Set 2" iron pipe in concrete in 1928 with brass cap marked F.B. 343-18.
N 0°8'43" E
Found 1½" round stake in rock mound F.B. 343-21
SECTION CORNER
Found 2" iron pipe, plug and tack in rock mound. This pipe was set by W R Barclay in 1926 by single proportion between S.W. Corner of Sec. 33 and the pipe at 104.76' south of S.E. Corner of Sec. 34. The County Surveyor accepted Barclays pipe account of being record distance from both the ¼ Corner north and the Sec. Cor. to the west and replaced it in 1928 with a 2" iron pipe set in concrete with brass cap marked. See C.S. 8880. F.B. 343-26 F.B. 98-146.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1 F.B. 98-147.
Found 1½" iron pipe 18" above surface. F.B. 98-148
SECTION CORNER
Located by intersection of the west line of Sec 2 with a straight line between the S.E. Cor. of Sec. 34 and the S.W. Corner of Sec. 33. as shown on C.S. B-1563-1 Set 2" iron pipe in concrete in 1940 with brass cap marked. F.B. 98-148 F.B. 775-42.
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1940 with brass cap marked See C.S. B-1563-1 F.B. 98-148
Found 4"x4" stake, 30" high on west slope near foot of slope, stake marked "S⅙ S.32" on east face, and "RAMCO. Ex No.7" on north face. F.B. 385-26.
Found 4"x4" stake, 22" high marked "S⅙ S.E 32" on east face, and "RAMCO Ex No 7" on north face. F.B. 385-25
1/4 SECTION CORNER
Located by proportion between Section Corners. Set 2" iron pipe in concrete in 1928 with brass cap marked F.B. 343-21
Found 1½" iron pipe 10" above surface F.B. 98-148
Found 2" iron pipe, 6" above surface. This is the pipe called S.E. Sec 34 by Barclay who says it was set by Bailey on L.S. See C.S. 8880. Bailey's corner should have been about of here. The Co. Surveyor uses this pipe to fix the west Section 2 as shown on C.S. B-1563-1 but rejects it Section Corner. F.B. 98-148. F.B. 7
FOR SURVEY
19
20
21
28
29
30
31
32
33
34
35
CSB-900-1
A3 OF A3