ASPLUNDH CONSTRUCTION CORP.

SOUTHERN CALIFORNIA EDISON
An EDISON INTERNATIONAL Company

DETERIORATED POLE REPLACEMENT

CIRCUIT (S):
ZAPPA 12KV o/o QUARTZ HILL SUB

STA'S 5-6

ADDRESS:
LOCATION: 30' E/O 45TH ST W N/S L-8
CITY: QUARTZ HILL
* NOTES:

5 RM 2015163E
40' Class C5
RM: 1- POLE 40' CLASS 5 WOOD FULL TREAT
RM: 1- XA SNGL FB 10' STEEL PINS
RM: 2- XA DBLE FB 10' STEEL PINS
RM: 5- INS POLY W/PIN 12KV CLMP #4-653 ACSR
RM: 14- INS POLY DE 12KV HOT SHOE #4 & 1/0
RM: 1- AG DOWN GUY 9/32" - 50' LESS THAN 22.5KV

SET 1' EAST
POLE 2015163E 6
45' Class C2
IN: 1- POLE 45' CLASS 2 WOOD FULL TREAT
IN: 3- XA DBLE FB 10' STEEL PINS
IN: 5- INS POLY W/PIN 12KV CLMP #4-653 ACSR
IN: 14- INS POLY DE 12KV HOT SHOE #4 & 1/0
IN: 1- AG DOWN GUY 9/32" - 50' LESS THAN 22.5KV

TRANSFER (S):
4/C 1/0A-12KV (N/W)
4/C 1/0A-12KV (E/W)
2/C 4A-12KV
1-7/32" WIZZAR

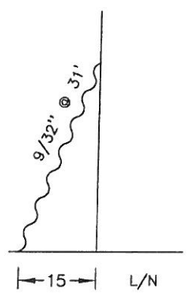

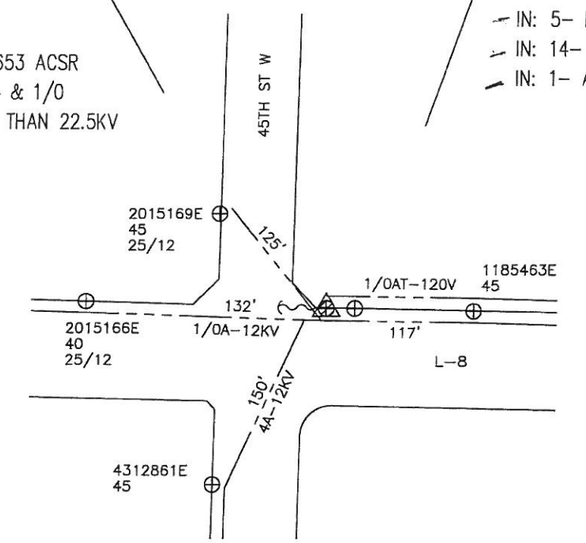

NOT TO SCALE

PERMIT REQ'D.	
CALTRANS:	
ENCROACHMENT:	
RAILROAD:	
HELICOPTER:	
OTHER:	

SPEED LIMIT 35

PEDESTRIAN TRAFFIC CONTROL REQUIRED
[X] YES [ ] NO

GPS: LAT: N 34° 39.1' 86"
LONG: W 118° 12.6' 04"

TLM DATA: SIZE KVA CUST. % LOAD
EXIST
PROP.
VOLTAGE DROP ____ %
PRI. CIRC. ____

NOTES

JOINT POLE:	X
RENTER:	
MITC FUME:	
JOINT MEET:	
TRUCK ACCESS:	X
HAND SET:	
CONTACT CATV:	
ENVIRONMENTAL:	
REAL PROP. REVIEW:	
PAVEMENT REPAIR:	
[ ] CONCRETE [ ] ASPHALT	X

DISTRICT 36 - ANTELOPE VALLEY	PROJ. MGR. RODRIGUEZ, JOHN T. PHONE 909-469-0219		PLANNER CHENIER, WARREN PHONE 714-893-2405		
FOREMAN	TRUCK NO.	P/E	INVENTORY MAP NO. 136-74A	THOMAS GUIDE LA 4104-J5	GRID NO.
DESIGN NO. 573546_0.01					
CSD 140 Y ___ N ___	BY-PASS CODE	EXISTING ___ CHANGE TO ___	TLM CHECKED ___ %LOAD	J.P.A. NO. 406223842	ASSOCIATED DESIGN NO.
PRODUCT/SAP NO. 821529-INFRA REP - DET POLE RELACE		PRODUCT/SAP NO.		PRODUCT/SAP NO.	

TYPE	APPROVED BY	DATE	CHECKED BY	DRAWN BY	PAX #
				LW	

Southern California Edison Company

PROPOSED CONSTRUCTION (LOCATION)
DET POLE REPLACEMENT
VARLOC VARIOUS ANTELOPE VALLEY CA 93534
ANTELOPE VALLEY

SHEET ___ OF ___
JOB NO. 573546_0.01