PERMIT NEEDED

Pole located at address 334 garhart ave

East Los Angeles/LA County

HILLVIEW 4kV O/O AMALIA SUB

NOTES:

OPEN UP AND KEEP EXISTING OPEN SECONDARIES.

(11) RM 498952E
40' Class C5
RM: 1- POLE 40' CLASS 5 WOOD FULL TREAT
RM: 1- XA SNGL FB 10' STEEL PINS N/BOND
RM: 1- XA SNGL FB 10' STEEL PINS SECONDARY
RM: 1- INS GLASS & PIN 4KV
RM: 1- INS NEUT GLASS & PIN 4KV
RM: 2- SEC ROLLER (166-CLEVIS & SPOOL)
RM: 6- SEC STEEL PIN & INS - PHASE
RM: 3- SEC STEEL PIN & INS - NEUTRAL
RM: 35- CD ALL SIZES AL/CU 3/C
RM: 1- GR OH #6 SOL WP SECONDARY W/ROD
RM: 1- FE CO OPEN 100A 4KV 1-EA
RM: 1- TR OH 25KVA 2.4KV 120/240 1P
SN:_____

(P) JS 5.10

(12) POLE 498952E
45' Class C2
IN: 1- POLE 45' CLASS 2 WOOD FULL TREAT
IN: 1- XA SNGL FB 10' STEEL PINS N/BOND
IN: 1- XA SNGL FB 10' STEEL PINS SECONDARY
IN: 2- INS POLY W/PIN 12KV CLMP #6-4/0 CU
IN: 2- SEC ROLLER (166-CLEVIS & SPOOL)
IN: 1- SEC 2" PVC FOR UNDER ARM W/#2 TW
IN: 2- SEC STEEL PIN & INS - PHASE
IN: 1- SEC STEEL PIN & INS - NEUTRAL
IN: 35- CD 1/0 STR AL TRIPLEX W/ACSR NEUTRAL
IN: 1- GR OH #6 SOL WP SECONDARY W/ROD
IN: 1- FE CO OPEN 100A 4KV 1-EA
IN: 1- FE FUSE ELF 8KV 50A
IN: 1- TR OH 50KVA 2.4KV 120/240 1P
SN:_____

Alley concrete

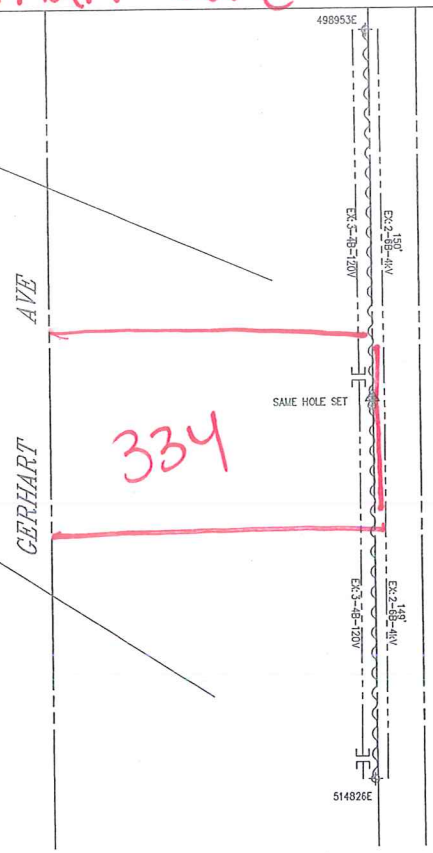

TRANSFERS:
2- 6B 4kV (N&S)
3- 4B 120V (N&S)
3- 4AT SVC
2- 7/32" S/G
1- 6' MAST ARM ST/LT

*SAME HOLE SET DUE TO FENCE & COM SPLICE BOX

SET IN SAME HOLE T OR SET ____ HARD SET N

ENVIRO REVIEW	N	HAND SET	N	SPECIAL EQUIP NEEDED	N
JOINT MEET	N	PERMIT NEEDED	N	IF YES WHAT IS NEEDED?	
TRUCK ACCESS	Y	NETCOMM SHEET	N		
PAVEMENT REPAIR	Y	RIGHTS CHECK	N	EST. TIME TO REPLACE	
ASPHALT	Y	PED TRAFFIC CONTROL	N	48 MH	
CONCRETE		OUTAGE	Y	CONTACT CATV	N
REPAIR SIZE	2x2	CSD-140	Y	MITC POLE	N

GPS 34°-01'-46.1" 118°-08'-33.3"

TLM DATA:	498952E			
	SIZE	kVA	CUST	%LOAD
EXIST:	25	37.3	20	149.2
PROP:	50	47.4	21	94.8
VD= N/A		FLICKER= N/A		

NOT TO SCALE

DISTRICT 22 - MONTEBELLO	PROJ. MGR. RODRIGUEZ, JOHN T PHONE 909-469-0219	PLANNER CARRILLO, CHRIS PHONE 909-517-2211	
FOREMAN	TRUCK NO. / P/E	INVENTORY MAP NO. 122-4242-1 / THOMAS GUIDE 635 J7 / GRID NO.	DESIGN NO. 535753_0.01
CSD 140 Y___ N___	BY-PASS CODE / EXISTING CHANGE TO	TLM CHECKED 94.80 %LOAD	J.P.A. NO. E 6022 000405857497 / ASSOCIATED DESIGN NO.
PRODUCT/SAP NO. 762540- DETERIORATED POLE	PRODUCT/SAP NO.		PRODUCT/SAP NO.

TYPE	APPROVED BY	DATE	CHECKED BY	DRAWN BY	PAX #

PROPOSED CONSTRUCTION (LOCATION)
GERHART AVE A/E
310' S/O DEWAR AVE
EAST LOS ANGELES

SHEET ___ OF ___ JOB NO. 535753_0.01

Southern California Edison Company

PAGE NO. 4 J.P. AUTH. NO. E6022-000405857497

POLE NO.	Pole Length / Anchor Size	Year Set	Pole Trt / Class / Anchor Direct.	Record 4KV E	Record HLA	Record	Record	Proposed 4KV E	Proposed HLA	Proposed	Proposed	Proposed	Item No.	LOCATION AND NATURE OF WORK If not in accordance with Joint Pole agreement and routine-state reasons.	
														E TO REPLACE PER SEC. 7.11, 7.4, 19.6, 14.3	1
498952E	40	1936	FT 5	.50	23'			C-10	LTD					GERHART AV A/E 310' S/O DEWAR AV, MONTEBELLO	2
								1/2(1)					5C	TOP POLE	3
								1/2(1)					10B	ASPHALT REPAIR	4
															5
498952E	45		FT 2					39-10	23-5					GERHART AV A/E 310' S/O DEWAR AV, EAST LOS ANGELES	6
									TN 23						7
								1/2(1)					15B	VIS STRIPS	8
								1/2(1)					19A		9
															10
															11
															12
															13
															14
															15
															16
															17
															18
															19

POLE LEGEND:
P = PULL (Item 5A)
PB = PULL BUTT
T = TRANSPORT (Item 5B)
S = SALVAGE
D = DISPOSE (Item 5D)
TN = TENANT

L = LOWER TOP(Item 5E)
C(XX) = FOOTAGE CUT
SCZ = SAFETY CLEARANCE ZONE

ANCHOR/ARM LEGEND:
AR = ANCHOR/ARM REMOVED
AT = ANCHOR/ARM TRANSFERRED

Show Quantity of Items to be billed in the Column of Party to be Paid.

GEOGRAPHICAL LOCATION

EAST LA
COMMUNITY

Rev. Jul 2013