PERMIT NEEDED

Pole located at address 342 ~~BVBM~~ Gerhart ave

East Los Angeles / CA County

HILLVIEW 4kV O/O AMALIA SUB

NOTES:

SECONDARIES NOT SHOWN OPEN ON FIM. LEAVE SECONDARIES OPEN IN FIELD

Alley Concrete

P JS

10 POLE 514826E
45' Class C4
IN: 1– POLE 45' CLASS 4 WOOD FULL TREAT
IN: 1– XA SNGL FB 10' STEEL PINS N/BOND
IN: 1– XA SNGL FB 10' STEEL PINS SECONDARY
IN: 2– INS POLY W/PIN 12KV CLMP #6–4/0 CU
IN: 2– SEC ROLLER (166–CLEVIS & SPOOL)
IN: 1– SEC 2" PVC FOR UNDER ARM W/#2 TW
IN: 2– SEC STEEL PIN & INS – PHASE
IN: 1– SEC STEEL PIN & INS – NEUTRAL

9 RM 514826E
40' Class C5
RM: 1– POLE 40' CLASS 5 WOOD FULL TREAT
RM: 1– XA SNGL FB 10' STEEL PINS SECONDARY
RM: 1– XA DBLE FB 10' STEEL PINS N/BOND
RM: 2– INS GLASS & PIN 4KV
RM: 1– SEC ROLLER (166–CLEVIS & SPOOL)
RM: 7– SEC STEEL PIN & INS – PHASE
RM: 4– SEC STEEL PIN & INS – NEUTRAL
RM: 1– GR OH #6 SOL WP SECONDARY W/ROD

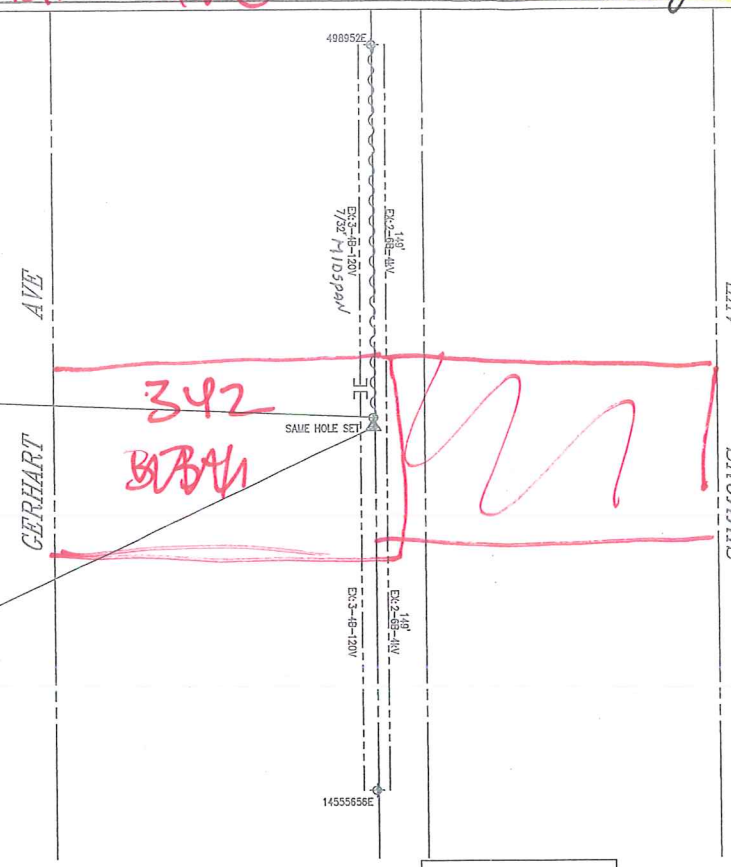


TRANSFERS:
2– 6B 4kV (N&S)
3– 4B 120V (N&S)
1– 7/32" S/G (N)
5– 4AT SVC
1– 6' MAST ARM ST/LT

GPS
34°–01'–45.1"
118°–08'–33.1"

NOT TO SCALE

SOUTHERN CALIFORNIA EDISON
An EDISON INTERNATIONAL Company

SAME HOLE SET DUE TO GATE & COM BOX

SET IN SAME HOLE Y OR SET ___' ___ HARD SET N

| | | | | | |
|---|---|---|---|---|---|
| ENVIRO REVIEW | N | HAND SET | N | SPECIAL EQUIP NEEDED | N |
| JOINT MEET | N | PERMIT NEEDED | N | IF YES WHAT IS NEEDED? | |
| TRUCK ACCESS | Y | NETCOMM SHEET | N | | |
| PAVEMENT REPAIR | N | RIGHTS CHECK | N | EST. TIME TO REPLACE 40 MH | |
| ASPHALT | | PED TRAFFIC CONTROL | N | | |
| CONCRETE | | OUTAGE | Y | CONTACT CATV | N |
| REPAIR SIZE | | CSD–140 | N | MITC POLE | N |

| | | | | | |
|---|---|---|---|---|---|
| DISTRICT 22 – MONTEBELLO | PROJ. MGR. RODRIGUEZ, JOHN T PHONE 909–469–0219 | | PLANNER CARRILLO, CHRIS PHONE 909–517–2211 | | |
| FOREMAN | TRUCK NO. | P/E | INVENTORY MAP NO. 122–4242–1 | THOMAS GUIDE 635 J7 | GRID NO. |
| DESIGN NO. 535753_0.01 | | | | | |
| CSD 140 Y___ N___ | BY–PASS CODE | EXISTING ___ CHANGE TO ___ | TLM CHECKED ___ %LOAD | J.P.A. NO. E 6022 000405857497 | ASSOCIATED DESIGN NO. |
| PRODUCT/SAP NO. 762540- DETERIORATED POLE | | PRODUCT/SAP NO. | | PRODUCT/SAP NO. | |

| TYPE | APPROVED BY | DATE | CHECKED BY | DRAWN BY | PAX # |
|---|---|---|---|---|---|
| | | | | | |

PROPOSED CONSTRUCTION (LOCATION)
GERHART AVE A/E
460' S/O DEWAR
EAST LOS ANGELES

SHEET ___ OF ___

JOB NO. 535753_0.01

Southern California Edison Company

PAGE NO. 3 J.P. AUTH. NO. E6022-000405857497

| POLE NO. | Pole Length / Anchor Size | Year Set | Pole Trt / Class / Anchor Direct. | Record 4KV E | Record HLA | Record | Record | Proposed 4KV E | Proposed HLA | Proposed | Proposed | Proposed | Item No. | LOCATION AND NATURE OF WORK<br>If not in accordance with Joint Pole agreement and routine-state reasons. | |
|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|---|
| | | | | | | | | | | | | | | E TO REPLACE PER SEC. 7.11, 19.6, 14.3 | 1 |
| 567174E | 40 | 1941 | FT 5 | 34-11 | 23-5 | | | C-5 | PTD | | | | | VIA SAN DELARRO A/N N/S P/L/E SIMMONS ST, MONTEBELLO | 2 |
| | | | | | | | | 1/2(1) | | | | | 5C | TOP POLE | 3 |
| | | | | | | | | 1/2(1) | | | | 2X2 | 10B | ASPHALT REPAIR | 4 |
| | | | | | | | | | | | | | | | 5 |
| 567174E | 40 | | FT H4 | | | | | 34-5 | 23-5 | | | | | VIA SAN DELARRO A/N N/S P/L/E SIMMONS ST, MONTEBELLO | 6 |
| | | | | | | | | | TN 23 | | | | | HARD SET WEST | 7 |
| | | | | | | | | 1/2(1) | | | | | 15B | VIS STRIPS | 8 |
| | | | | | | | | | | | | | | | 9 |
| | | | | | | | | | | | | | | E TO REPLACE PER SEC. 7.11, 7.4, 14.3, 19.6 | 10 |
| 514826E | 40 | 1937 | FT 5 | 33-10 | 23-5 | | | C-5 PB | LTD | | | | | GERHART AV A/E 460' S/O DEWAR AV, MONTEBELLO | 11 |
| | | | | | | | | 1/2(1) | | | | | 5C | TOP POLE | 12 |
| | | | | | | | | 1/2(1) | | | | 2X2 | 10B | ASPHALT REPAIR | 13 |
| | | | | | | | | | | | | | | | 14 |
| 514826E | 45 | | FT 4 | | | | | 39-10 | 23-5 | | | | | GERHART AV A/E 460' S/O DEWAR AV, EAST LOS ANGELES | 15 |
| | | | | | | | | | TN 23 | | | | | | 16 |
| | | | | | | | | 1/2(1) | | | | | 15B | VIS STRIPS | 17 |
| | | | | | | | | 1/2(1) | | | | | 19A | | 18 |
| | | | | | | | | | | | | | | | 19 |

**POLE LEGEND:**
P = PULL (Item 5A)
PB = PULL BUTT
T = TRANSPORT (Item 5B)
S = SALVAGE
D = DISPOSE (Item 5D)
TN = TENANT
L = LOWER TOP(Item 5E)
C(XX) = FOOTAGE CUT
SCZ = SAFETY CLEARANCE ZONE

**ANCHOR/ARM LEGEND:**
AR = ANCHOR/ARM REMOVED
AT = ANCHOR/ARM TRANSFERRED

Show Quantity of Items to be billed in the Column of Party to be Paid.

**GEOGRAPHICAL LOCATION**

EAST LA
**COMMUNITY**

Rev. Jul 2013