PERMIT NEEDED

POLE C/S 4446 TOWNE AVE CLAREMONT

WINTHROP 12kV O/O LIVE OAK SUB

NOTES:
BULLETIN NO.322 AREA
EAGLE ZONE
LINE CLEARING REQ
INSTALL 1" ANCHOR DUE TO
RENTER ATTACHED

3 RM 549283E
35' Class C5
RM: 1- POLE 35' CLASS 5 WOOD FULL TREAT
RM: 2- SEC ROLLER (166-CLEVIS & SPOOL)
RM: 1- AG DOWN GUY 9/32" - 50' LESS THAN 22.5KV

4 POLE 549283E
40' Class C5
IN: 1- POLE 40' CLASS 5 WOOD FULL TREAT
IN: 2- SEC ROLLER (166-CLEVIS & SPOOL)
IN: 1- AG DOWN GUY 3/8" - 50' LESS THAN 22.5KV
IN: 1- AG ANCHOR ROD 1 " X 10' 3-EYE W/PLATE

C/S DIRT

P 4.25.17 JS

JDS

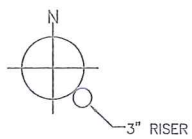

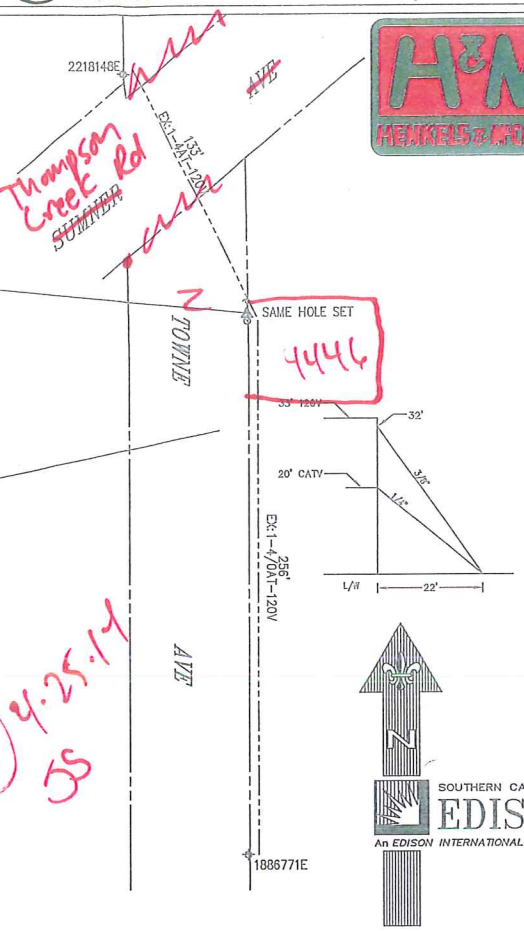

TRANSFERS:
1- 4/0AT 120V (S)
1- 4AT 120V (N)
2- 4AT SVC

*SAME HOLE SET DUE TO SECONDARY RISER

SET IN SAME HOLE Y OR SET ___' ___ HARD SET N

ENVIRO REVIEW	N	HAND SET	N	SPECIAL EQUIP NEEDED	N
JOINT MEET	N	PERMIT NEEDED	Y	IF YES WHAT IS NEEDED?	
TRUCK ACCESS	Y	NETCOMM SHEET	N		
PAVEMENT REPAIR	N	RIGHTS CHECK	N	EST. TIME TO REPLACE	
ASPHALT		PED TRAFFIC CONTROL	N	32 MH	
CONCRETE		OUTAGE	Y	CONTACT CATV	Y
REPAIR SIZE		CSD-140	N	MITC POLE	N

GPS
34°-07'-22.9"
117°-33'-33.3"

DISTRICT 26 - COVINA	PROJ. MGR. RODRIGUEZ, JOHN T PHONE 909-469-0219		PLANNER CARRILLO, CHRIS PHONE 909-517-2211		
FOREMAN	TRUCK NO.	P/E	INVENTORY MAP NO. 156-4365-1	THOMAS GUIDE 571 A7	GRID NO.	DESIGN NO. 538198_0.01
CSD 140 Y___ N___	BY-PASS CODE	EXISTING ___ CHANGE TO ___	TLM CHECKED ___ %LOAD	J.P.A. NO. N/A		ASSOCIATED DESIGN NO.
PRODUCT/SAP NO. 766423- DETERIORATED POLE		PRODUCT/SAP NO.			PRODUCT/SAP NO.	

PROPOSED CONSTRUCTION (LOCATION)
4446 TOWNE AVE
CLAREMONT

TYPE	APPROVED BY	DATE	CHECKED BY	DRAWN BY	PAX #

SHEET ___ OF ___ JOB NO. 538198_0.01

Southern California Edison Company