PERMIT NEEDED

Pole located at address 301 S. GERHART AVE

MONTEBELLO | LACO

HILLVIEW 4kV O/O AMALIA SUB

HENKELS & McCOY

STA'S 5/6

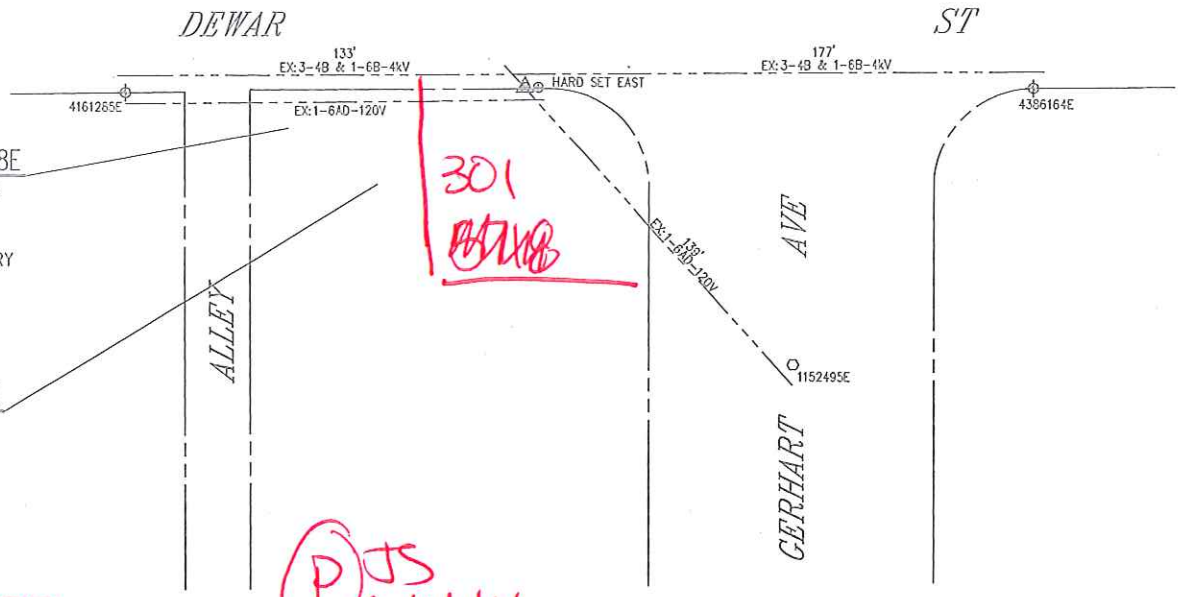

(5) RM 498958E
40' Class C5
RM: 1- POLE 40' CLASS 5 WOOD FULL TREAT
RM: 1- XA SNGL FB 10' STEEL PINS N/BOND
RM: 1- XA SNGL FB 10' STEEL PINS SECONDARY
RM: 3- INS GLASS & PIN 4KV
RM: 1- INS NEUT GLASS & PIN 4KV
RM: 1- SEC ROLLER (166-CLEVIS & SPOOL)

(6) POLE 498958E
45' Class C3
IN: 1- POLE 45' CLASS 3 WOOD FULL TREAT
IN: 1- XA SNGL FB 10' STEEL PINS N/BOND
IN: 4- INS POLY W/PIN 12KV CLMP #6-4/0 CU
IN: 1- SEC ROLLER (166-CLEVIS & SPOOL)

(P) JS 6.14.14

c/s grass

TRANSFERS:
3- 4BC 4KV (W/E)
1- 6BC 4KV (W/E)
1- 6AD 120V (W/SE)
1- WIZZAR SERVICE

RECEIVED
JUN 13 2014
HENKELS & McCOY

GPS
34°-01'-49.3"
118°-08'-39.9"

N

SOUTHERN CALIFORNIA EDISON
An EDISON INTERNATIONAL Company

NOT TO SCALE

SET IN SAME HOLE N OR SET ___' E HARD SET Y

ENVIRO REVIEW	N	HAND SET	N	SPECIAL EQUIP NEEDED	N
JOINT MEET	N	PERMIT NEEDED	Y	IF YES WHAT IS NEEDED?	
TRUCK ACCESS	Y	NETCOMM SHEET	N		
PAVEMENT REPAIR	N	RIGHTS CHECK	N	EST. TIME TO REPLACE	
ASPHALT		PED TRAFFIC CONTROL	Y	32 M/H	
CONCRETE		OUTAGE	N	CONTACT CATV	N
REPAIR SIZE		CSD-140	N	MITC POLE	N

DISTRICT 22 - MONTEBELLO	PROJ. MGR. RODRIGUEZ, JOHN T PHONE 909-469-0219	PLANNER ALBERT HINTON PHONE 909-247-8135	
FOREMAN	TRUCK NO. / P/E / INVENTORY MAP NO. 122-4242-1	THOMAS GUIDE 635 - J6 / GRID NO.	DESIGN NO. 540422_0.01
CSD 140 Y___ N___ / BY-PASS CODE / EXISTING CHANGE TO	TLM CHECKED ___ %LOAD	J.P.A. NO. E6022-000405937677	ASSOCIATED DESIGN NO.
PRODUCT/SAP NO. 769573- DETERIORATED POLES	PRODUCT/SAP NO.		PRODUCT/SAP NO.

PROPOSED CONSTRUCTION (LOCATION)
N/S 301 GERHART AVE
EAST LOS ANGELES

TYPE	APPROVED BY	DATE	CHECKED BY	DRAWN BY	PAX #

Southern California Edison Company

SHEET ___ OF ___ JOB NO. 540422_0.01

PAGE NO. 4 J.P. AUTH. NO. E6022-000405937677

POLE NO.	Pole Length / Anchor Size	Year Set	Pole Tnt / Class / Anchor Direct.	Record 4KV E	Record HLA	Record	Record	Proposed 4KV E	Proposed	Proposed HLA	Proposed	Proposed	Item No.	LOCATION AND NATURE OF WORK If not in accordance with Joint Pole agreement and routine-state reasons.	
														E TO REPLACE PER 7.11, 13.3	1
498958E	40	1936	FT 5	34-5	23-5			C-10		PTD				DEWAR AV S/S 10' W GERHART ST, BELVEDERE	2
								1/2(1)					5C	TOP POLE	3
															4
															5
498958E	45		FT 3					39-10	23-5					DEWAR AV S/S 9' W GERHART ST, EAST LA	6
									TN 23					HARDSET EAST .	7
															8
														E TO REPLACE PER 7.11, 7.4, 19.6, 13.3	9
505954E	40	1936	FT	34-11	23-5			C-11 PB		LTD				GERHART ST A/W W/S 420' N/O DEWAR AV, MONTEBELLO	10
								1/2(1)					5C	TOP POLE	11
															12
															13
505954E	45		FT 2					39-10		23-5				GERHART ST A/W W/S 420' N/O DEWAR AV, EAST LA	14
										TN 23					15
								1/2(1)					10B	3X3	16
								1					19A	BENEFIT OF PHONE	17
															18
															19

POLE LEGEND:
P = PULL (Item 5A)
PB = PULL BUTT
T = TRANSPORT (Item 5B)
S = SALVAGE
D = DISPOSE (Item 5D)
TN = TENANT
L = LOWER TOP(Item 5E)
C(XX) = FOOTAGE CUT
SCZ = SAFETY CLEARANCE ZONE

ANCHOR/ARM LEGEND:
AR = ANCHOR/ARM REMOVED
AT = ANCHOR/ARM TRANSFERRED

Show Quantity of Items to be billed in the Column of Party to be Paid.

GEOGRAPHICAL LOCATION

EAST LA
COMMUNITY

Rev. Jul 2013