P 3.4.14 P

LOC AT CURB. S/WEST SIDE HOMEWARD ST
120' N/WEST OF MILLBURY AV.
ON N/EAST CORNER OF ADD. 745 MILLBURY AVE

PERMIT NEEDED

La Puente/LA County

VICINITY MAP

NOT TO SCALE

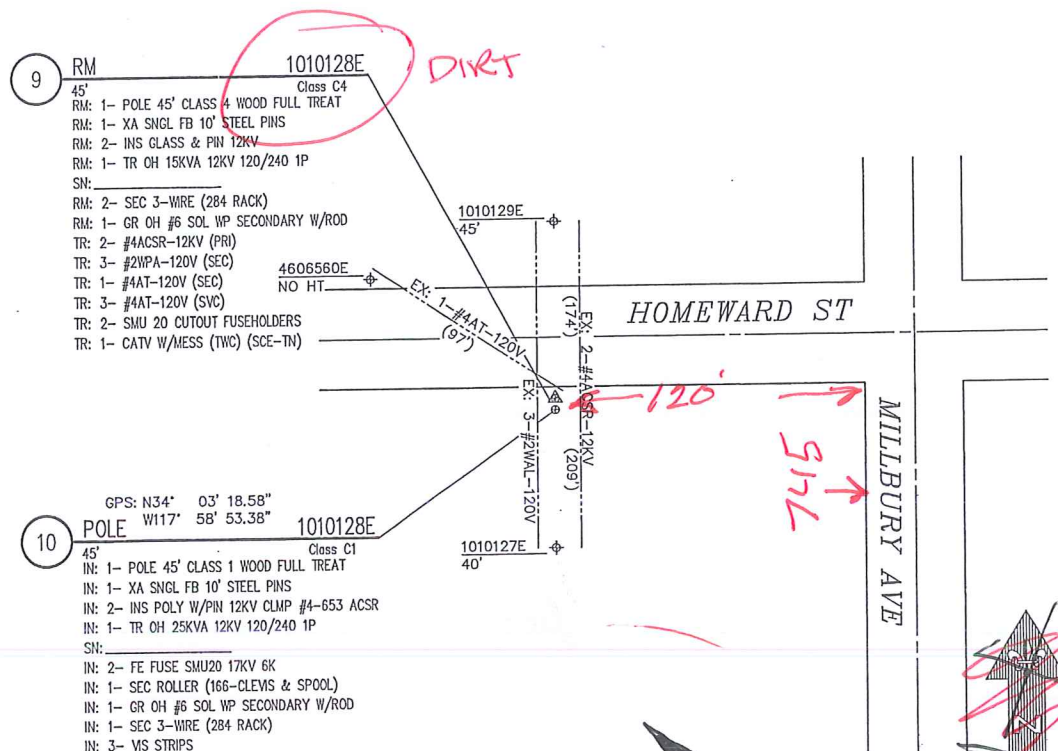

NOTE:

- HARDSET POLE SOUTH
- TRAFFIC CONTROL REQ'D
- PTC REQ'D
- E TO CUT 13'
- VZ TO PTD
- TIME WARNER OUT OF GRADE & SPACE

REQUIRED PERMITS:
- TRAFFIC CONTROL PERMIT REQ.
- EXCAVATION PERMIT REQ.

NOTES:

HAND SET: NO
JOINT MEET: NO
TRUCK ACCESS: YES
CONTACT CATV: NO
PAVEMENT REPAIR: NO
JOINT ANCHOR: NO
ENVIRONMENTAL/

If changes to JPA are req'd i.e., Cut vs. PTD, or location change *contact Joint Utility prior to construction

UTILITY: VERIZON
ENGINEER: ALICIA SMITH
PHONE: 818-898-2352
DATE:
INSPECTED BY:
DATE INSPECTED:

SOUTHERN CALIFORNIA EDISON
An EDISON INTERNATIONAL Company

LEVEL 12KV % INDUSTRY SUB

NOT TO SCALE

DISTRICT 26 - COVINA	PROJ. MGR. JOHN RODRIGUEZ PHONE 909-469-0219		PLANNER ISMAEL CORTEZ PHONE 909-982-9450	BUDGET ITEM 480	YEAR 2013
FOREMAN	TRUCK NO. -	P/E	INVENTORY MAP NO. 132-4293-1 / THOMAS GUIDE 638-A7	GRID NO. 000	DESIGN NO. 454683_0.01
CSD 140 Y X N ___	BY-PASS CODE	EXISTING 15KVA CHANGE TO 25KVA	TLM CHECKED 36.08 %LOAD	J.P.A. NO. E6026-405793422	ASSOCIATED DESIGN NO.
PRODUCT/SAP NO. 641814 - DET POLE REPLACEMENT		PRODUCT/SAP NO.		PRODUCT/SAP NO.	

TYPE	APPROVED BY	DATE	CHECKED BY	DRAWN BY	PAX #
		12/12/13		PAR/NM	909-982-9450

PROPOSED CONSTRUCTION (LOCATION)
DETERIORATED POLE REPLACEMENT
HOMEWARD ST W/O MILLBURY AVE
LA PUENTE

SHEET ___ OF ___

JOB NO. 454683_0.01

Southern California Edison Company

PAGE NO. 2 - 2 J.P. AUTH. NO. E6029-405742194

POLE NO.	Pole Length / Anchor Size	Year Set	Pole Trt / Class / Anchor Direct.	Record				Proposed					Item No.	LOCATION AND NATURE OF WORK If not in accordance with Joint Pole agreement and routine-state reasons.	
				12KV E	VZ			12KV E	VZ						
9														E TO REPLACE POLE SEC. 7.11, 1.2	1
1010128E	45	54	FT	38-15	23-5			C-13'	PTD					HOMEWARD ST S/S 105' W/O MILLBURY AV, BALDWIN PARK	2
								1/2(1)					13C	TRAFFIC CONTROL REQ'D - COST TO FOLLOW	3
								1/2(1)					5C	TOPPING	4
															5
10															6
1010128E	45		FT 1					38-15	23-5					HOMEWARD ST S/S 105' W/O MILLBURY AV, BALDWIN PARK	7
														HARD SET SOUTH	8
															9
															10
															11
															12
11														E TO RELINQUISH POLE SEC. 5.1-A, 12.9	13
1290709E	45	59	FT		22'									BALDWIN PARK BL PP 73' E 200' S/O TEMPLE AV, INDUSTRY	14
	3/4"		E	50	50			AT							15
															16
															17
															18
															19

POLE LEGEND:
P = PULL
PB = PULL BUTT
T = TRANSPORT
S = SALVAGE
D = DISPOSE
TN = TENANT

L = LOWER CUT
C(XX)= FOOTAGE CUT
SCZ = SAFETY CLEARANCE ZONE

ANCHOR LEGEND:
AR = ANCHOR/ARM REMOVED
AT = ANCHOR/ARM TRANSFERRED

Show Quantity of Items to be billed in the Column of Party to be Paid.

GEOGRAPHICAL LOCATION

BALDWIN PARK
COMMUNITY

Rev. Jan 2010