FIELD NOTES OF A

DEPENDENT RESURVEY OF

SECTION 26 T4N R15W

Copied from photostatic copies furnished by the U.S. Bureau of Land Management-San Francisco.

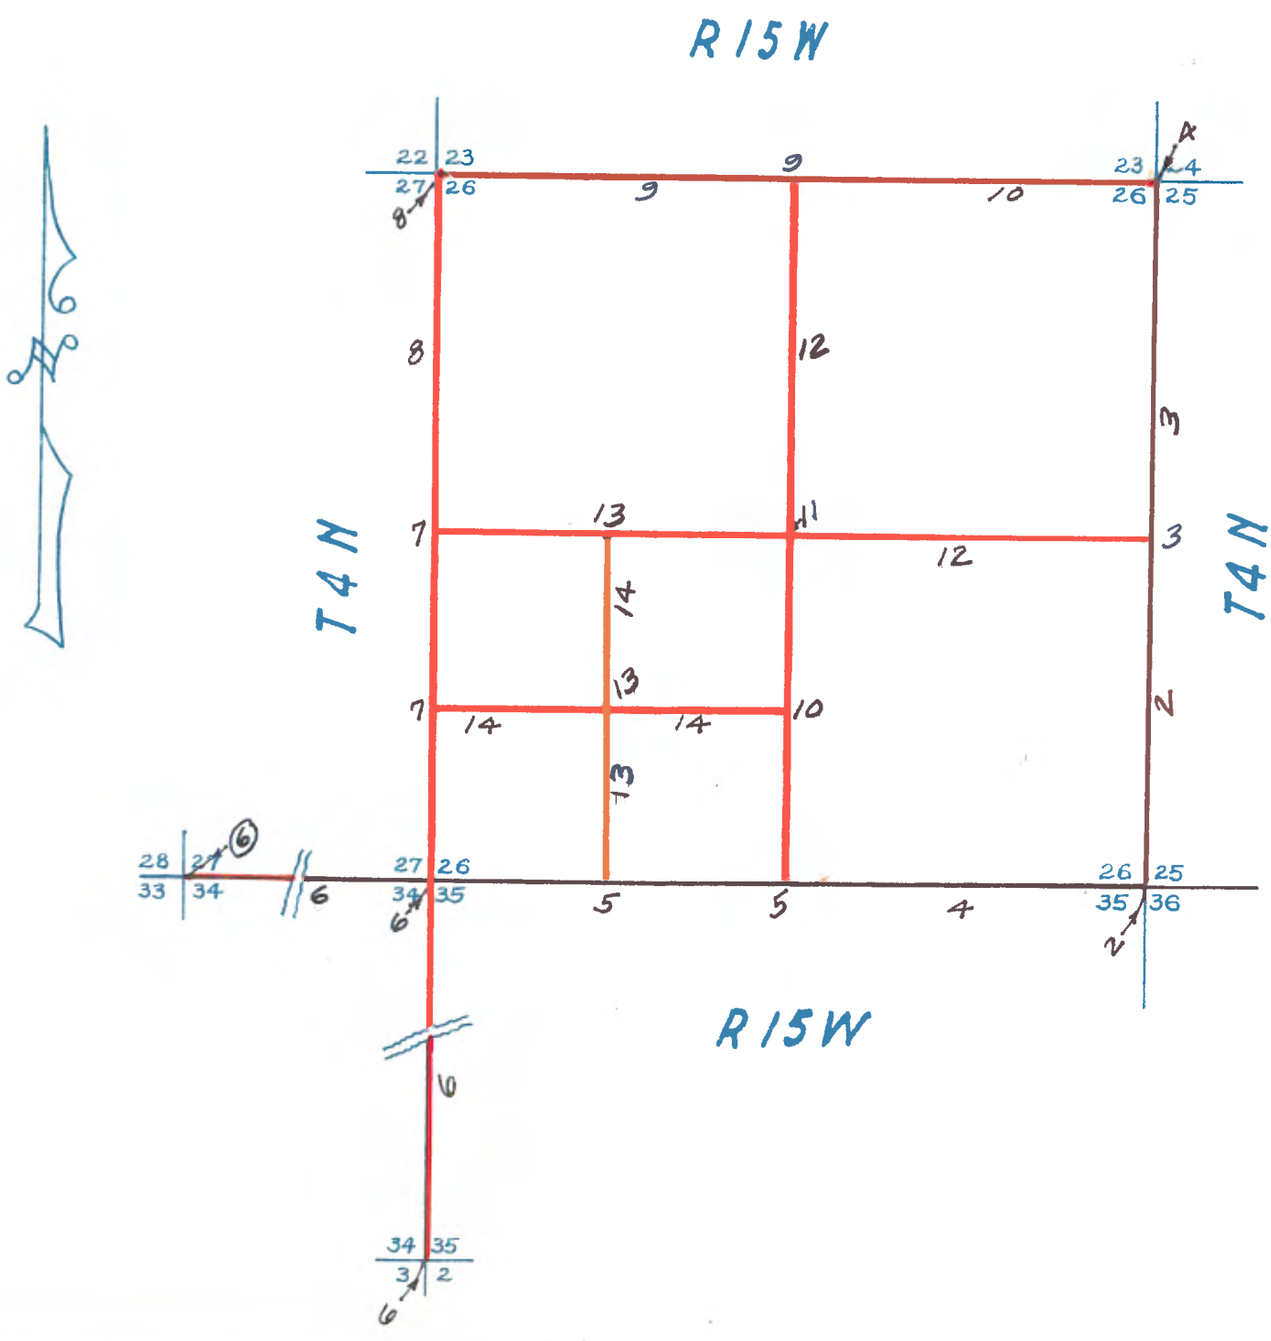

T.4 N., R.15 W.

In 1855 H. Hancock surveyed an offset line through T.4 N., R.15 W., establishing a portion of the 2nd. latitudinal section line. The subdivision of the township was completed by W. H. Norway in 1876.

Resurveys executed by Los Angeles County in 1925 effected a remonumentation of original corners, then extant, with brass capped iron posts, 2 ins. diam., firmly embeded in a concrete base. With only slight modification of the markings, and the addition of suitable references, these monuments are adopted as properly defining the original survey.

The dependent resurvey of the boundaries of section 26, and a limited subdivision of the section, was executed to provide a basis for small tract disposals in the NW¼ SW¼ of said sec. 26, under Act of June 1, 1938 (52 Stat. 609; 43 U.S.C. 682a).

The survey was executed with Buff & Buff solar transit, Serial No. 24849, constructed in accordance with the standard instrumental specifications of the Bureau of Land Management. The instrument was in satisfactory adjustment prior to beginning the survey, having been tested and found free from appreciable error.

The direction of all lines were determined by altitude observations upon the sun for azimuth, supplemented by solar unit observations. Measurements were made with a Lallie steel tape, 5 chs. in length, graduated every link for the first 100 links, and the balance at intervals of 10 links. The tape was first tested by comparison with a Lufkin standard and found correct. The measurements were made on the slope; the vertical angle of each interval was ascertained by forward and rear clinometer readings. The horizontal equivalents only are entered in the field note record.

Preliminary to resurvey the lines of the governing survey are retraced, and the data thoroughly verified. The true line results are given herein.

The geographic position of the SE. corner of section 26 is given as follows:

Latitude, 34°23'20"N., Longitude, 118°25'W.

Dec. 11, 1947, at the corner of secs. 25,26,35 and 36, at 2h. 26m. p.m., standard time, make a series of four altitude observations upon the sun, each with the telescope in direct and reversed positions, observing opposite limbs of the sun, and reading the horizontal angle from the line of sight to a flag target 100 chains west:

True Vertical Angle	22°27'50"
Declination of the sun	22°59'40"
Azimuth of sun at mean period	S.37°19'20"W.
Horizontal angle, sun to target	52°28'30"
True bearing to reference mark	S.89°47'50"W.

The bearings of all lines of the survey were checked by sustained angulation from this reference line.

Dependent resurvey of Part of the Subdivision, T.4N., R.15 W.

Chains

The cor. of secs. 25, 26, 35 and 36, is marked by an iron post, 2 ins. diam., firmly set in concrete base, 6 in. diam., 5 ins. below surfaced highway. Additionally mark brass cap to read

COUNTY SURVEYORS
T4N
S 26 | S 25
R15W
S 35 | S 36
US BLM 1947
MONUMENT

An iron post, 3 ft. long, 1 in. diam., set 36 ins. in the ground, for a reference monument, bears S.45°E., 64.3 lks. dist., with brass cap mkd. T4N R15W S 36 1947 and an arrow pointing to the corner.

An iron post, 3 ft. long, 1 in. diam., set 36 ins. in the ground, for a reference monument, bears N.45°W., 64.3 lks. dist., with brass cap mkd. T4N R15W S 26 1947 and an arrow pointing to the corner.

From the corner;

The north bole of twin like oak, 12 in. diam., bears N.74½°E., 71 lks. dist.; old scar of blaze on this tree presents probable evidence of site of original bearing tree (record: N.73°E., 75 lks. dist.)

Corner of three strand barbed wire fencing, extending N., S. and E., bears S.88½°E., 32 lks. dist.

A drilled well, and windmill, bears N.56°E., 56½ lks. dist.,

Pole No. 107-48, of telephone line paralleling highway, bears S.26°E., 89½ lks. dist.

Pole, of three wire, electric power line, extending N and S., bears S.86°W., 29 lks. dist.,

Center line of oil surfaced highway, bears N., and S.6½°E., N.0°19'W., bet. secs. 25 and 26.

Along surfaced roadway, over bottom land, in Sand Canyon.

9.60 Road, curves to NW.,

10.20 Telephone line, parallels road. Leave bottom land; asc. 25 ft. over SW. Slope.

11.70 Top of ascent; shoulder of low spur, extending from SE. Desc. 30 ft. over N. slope, through moderately dense undergrowth.

17.60 Drain, course W. Asc. 10 ft. over S. slope.

22.60 Flat spur, extends NW. Desc. 30 ft. over N. slope.

26.60 Leave undergrowth; enter cleared land, bearing E. and W.

27.50 Drain, course NW.

31.85 Wire fencing, bears E. and SW.

Chains	
32.00	Ranch road, bears E. and SW. Asc. 45 ft. over gradually increasing SW. slope.
32.30	Wire fence, bears E. and W., enclosing vinyard.
39.10	Leave vinyard; fencing bears irregularly to NW., and to E., about 1 chain, thence to South. Enter scattered undergrowth, in low foothills.
39.98	The ¼ sec. cor., marked by an iron post, 2 ins. diam., 4 ins. above ground, firmly sets in concrete base, 6 ins. diam. Additionally mark brass cap to read COUNTY SURVEYOR T4N ¼ S 26 | S 25 R15W ¼ SEC COR US BLM 1947 MONUMENT Raise a mound of stone, 3 ft. base, 1½ ft. high, W. of corner. Barbed wire fencing, now in dilapidated condition, bears E. and W. from corner.
	N.0°11'W., beginning new measurement.
	Asc. 25 ft. over SW slope.
0.14	Telephone line, bears E. and W.
4.00	Top of ascent, spur, extends to the West. Desc. 65 ft. over N. Slope, through dense undergrowth.
8.00	Gully, course NE. Old wire fencing, here dilapidated and fallen, extends to the north. Asc. 70 ft. over SE slope.
10.40	Top of ascent, on E. slope; three strand, barbed wire fencing, here in good condition, bears N. and S.
	Desc. 40 ft. over NE. slope.
14.80	Small spur, extends to NE. Desc. NW. slope 90 ft.
23.50	Foot of slope, bearing NE. and SW.; leave undergrowth, enter scattered oak timber.
28.50	End of fencing, from the S.
28.70	Road, bears NW. and SE.
29.00	Three strand wire fencing, bears NW. and SE.
32.15	Roadway, bears E. and W.
32.25	Wire fencing, bears E., N. and W.
36.20	Drain, 10 lks. wide, 1 ft. deep, course NW. Asc. 20 ft. over S. slope.
38.50	Small spur, extends W., Desc. 25 ft. over N. Slope.
39.80	The cor. of secs. 23, 24, 25 and 26, marked by an iron post, 2 ins. diam., 6 ins. above ground, firmly set in concrete base, 6 ins. diam., Additionally mark brass cap to read

Dependent Resurvey of Part of the Subdivision, T.4 N., R.15 W.

Chains

COUNTY SURVEYORS
T4N
S 23 | S 24
R15W
S 26 | S 25
US BLM 1947
MONUMENT

Bury a granite stone, 7 x 6 x 5 ins., marked + alongside iron post.

Three strand, barbed wire fencing extends S. E. and N. from corner.

Corner is situated on S. side of roadway leading E. to Box Circle Ranch.

Land, valley bottom, and low foothills.
Soil, sandy gravel, 2nd. rate.
Scattered oak trees in valley land; creosote brush and chaparral on hillsides.

From the cor. of secs. 25, 26, 35 and 36.

S.89°45'W., bet. secs. 26 and 35.

Over bottom land, through scattered oak timber; across surfaced highway, bearing N. and S.6½°E.

0.20 Leave highway; enter open field.

2.23 Three strand barbed wire fencing, bears N.46°W. and S.46°E.

3.00 Wash, 50 lks. wide, 4 ft. deep, course N.60°W.

6.00 Drain, 10 lks. wide, 1 ft. deep, course N.

12.79 Five strand wire fencing, bears N. and S.; leave field.

15.87 Woven mesh, flood control fencing, on E. side of wash channel, bearing N.3°E.

16.30 West bank of wash, 3 ft. high.

19.95 Five strand wire fencing, from south, extends N. 30 lks. distant to corner, thence to E. and to N.

22.80 Wash, 10 lks. wide, 3 ft. deep, course N.10°W. Leave bottom land; asc. 7 ft.

24.20 N. slope of low spur, from S.; desc. 7 ft. over slight NW slope.

25.50 Shallow cove, drains N.; asc. 10 ft.

27.00 Point of spur, sloping N.; desc. 15 ft.

28.83 Wire fencing, extending N. and W., bears N. about 50 lks. dist. Leave oak timber; across open field asc. 30 ft. over slight NE slope.

40.05 Three strand wire fencing, in dilapidated condition, bears N. and S. Leave field.

Dependent Resurvey of Part of the Subdivision, T.4N., R.15 W.

Chains

40.10 The ¼ sec. cor., marked by a wooden hub, 2 ins. square, driven firmly in the ground in center of a small and dilapidated mound of stone.

At the corner point

Set an iron post, 3 ft. long, 1 in. diam., 34 ins. in the ground, with brass cap mkd.

$$\frac{1/4 \; S \; 26}{S \; 35}$$

1947

Bury a granite stone, 6 x 6 x 5 ins., marked + along-side iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, N. of cor.

From the corner

E. end of a dilapidated wire fence, from the W., bears N.13°E., 15 lks. dist.

Corner of three strand barbed wire fencing, extending to E. and S., bears N.2°E., 58 lks. dist.

S.89°51'W., beginning new measurement.

Asc. 60 ft. over E. slope, through increasingly heavy undergrowth; along dilapidated wire fencing, extending W.

4.00 Shoulder of flat spur, from S., breaks to NE. and to NW. End of fallen wire fencing, from E.

Desc. 15 ft. over a decreasing W. slope.

10.60 Stub roadway, leads irregularly to the S.

12.00 Wash, 10 lks. wide, 2 ft. deep, course N. Asc. 70 ft. over E. slope.

15.85 Shoulder of spur, from S., Desc. 70 ft. over SW. slope.

18.00 Foot of slope; wash, drains N. Over flat, washed land.

19.87 Point for W. 1/16 sec. cor.,

Set an iron post, 3 ft. long, 1 in. diam., 34 ins. in the ground, with brass cap mkd.

$$W \; \frac{1/16 \; S \; 26}{S \; 35}$$

1947

Bury a granite stone, 8 x 8 x 6 ins. marked + along-side iron post.

Raise a mound of stone, 3 ft. base, 1½ ft. high, N. of cor.

Asc. gradual, flat NE. slope, through dense chaparral.

27.87 Unimproved roadway, bears N. 60°E. and S=60°W.

30.37 Gully, 1 ch. wide, 15 ft. deep, course N.20°E.

36.50 Gully, 50 lks. wide, 10 ft. deep, course N.70°E., at foot of hills.

Chains

Azc. 50 ft. over changing, SE. to S. slope.

39.74 The cor. of secs. 26, 27, 34 and 35, marked by an iron capped pipe, 2 ins. diam., firmly set, 14 ins. above ground, in center of a dilapidated mound of stone.

At the corner point

Set an iron post, 3 ft. long, 2 ins. diam., 33 ins. in the ground, with iron pipe deposited alongside, with brass cap mkd.

T4N R15W
S 27 | S 26
S 34 | S 35
1947

Bury a granite stone, 7 x 6 x 6 ins., marked + alongside iron post.

Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.

Corner is situates on steep S. slope, E of, and closely adjacent to, short ravine, draining SE.

From the corner

The cor. of secs. 27,28,33 and 34, marked by an iron capped pipe, 2 ins.diam., firmly set, 8 ins. above ground, and in a small mound of stone, bears S.89°27'W. 78.98 chs. dist.; iron cap is marked

SEC 28 | SEC 27
T4N | R15W
SBM
SEC 33 | SEC 34

From the same corner

The cor. of secs. 2,3,34 and 35, on the S. bdy of the Tp., bears S.5°53'E., 76.82 chs. dist., marked by a County Survey monument; a brass capped iron post, 2 ins. diam., firmly embedded in concrete base, 6 ins. diam., flush with surface of ground. South of, and adjacent to this monument is an iron capped pipe, unmarked, 2 ins. diam., firmly set, 8 ins. above ground.

Raise a mound of stone, 2 ft. base, 1½ ft. high, W. of cor.

This monument is situated on a rolling shelf, or bench at base of steep SW. slope; was slightly covered by a light detrital overlay.

Land, valley bottom in E. portion, slightly broken in W.
Soil, sandy to rocky clay, 2nd. and 3rd. rate.
Scattered oak trees in valley; creosote and chaprral in W. half.

Chains	
	N.0°07'E., bet. secs. 26 and 27.
	Asc. 80 ft. over S. slope, through dense undergrowth.
2.40	Sharp spur, slopes E. Desc. 70 ft. over decreasing NE. slope.
5.70	Wash, 15 lks. wide, in shallow draw, course E.
7.40	Wash, 20 lks. wide, course S.70°E. Asc. 70 ft. over SW. slope.
11.70	Spur, slopes S.70°E. Desc. 30 ft. over NE. slope.
14.00	swale, draining E; leave dense undergrowth, enter old burn now covered with light growth of sage and buckwheat.
	Along rolling E. slope.
19.78	Point for S. 1/16 sec. cor.
	Set an iron post, 3 ft. long, 1 in. diam., 34 ins. in the ground, with brass cap mkd.
	S 1/16
	S 27 S 26
	1947
	Bury a granite stone, 6 x 4 x 4 ins., marked + alongside iron post.
	Raise a mound of stone, 2 ft. base, 1½ ft. high, W. of cor.
20.20	Drain, 5 lks. wide, 2 ft. deep, course SE. Asc. 120 ft. over S. slope.
24.40	Narrow ridge bears NE. and SW. Desc. 90 ft. over an increasing NW. slope.
30.50	Change of slope to N.; desc. 155 ft.
34.50	Head of wide draw, course NW. Asc. 50 ft. over SW. slope.
37.00	Sharp, narrow spur, slopes NW. Desc. 95 ft. over a decreasing N. to NW. slope.
39.56	The ¼ sec. cor., marked by a redwood post, 4 ins. square, 12 ins. above ground, firmly set in small mound of stone, mkd. ¼ on W. face. Alongside is an iron pipe, 16 ins. long, driven in the ground to a depth of 12 ins.
	This monument has been locally recognized as the ¼ sec. cor. and so utilized in the delineation of private properties in Sand Canyon Valley.
	At the corner point
	Set an iron post, 3 ft. long, 1 in. diam., 34 ins. in the gound, with brass cap mkd.
	¼
	S 27 S 26
	1947

Dependent Resurvey of Part of the Subdivision, T.4 N., R.15 W.

Chains	
	Bury a granite stone, 6 x 5 x 4 marked +, and the post, and iron pipe, alongside iron post.
	Raise a mound of stone, 3 ft. base, 2 ft. high, W. of cor.
	N.0°03'E., beginning new measurement.
	Desc. 40 ft. over NW. slope, through light undergrowth.
1.10	Head of ravine, course NW. Asc. 85 ft. over S. slope.
3.40	Spur, slopes W. Enter dense undergrowth, bearing E. and W.
	Desc. 85 ft. over NW. slope.
8.10	Ravine, course N.85°W. Asc. 90 ft. over S. and SW. slope.
15.25	Sharp spur, bears N. 70°W.; a granite stone, 12 x 10 x 10 ins., supported in a mound of stone, marked + on top, L on W. face, bears W., 1 lk. dist.
	Desc. 130 ft. over a decreasing N. slope.
21.50	Small ravine, course NW.; desc. slightly, over W. slope.
22.50	Point of spur, from SE.; desc. 15 ft.
25.00	Ravine, course N.70°W.; Over W. slope.
28.00	Small spur, slopes W. Desc. 80 ft. over N. slope.
36.20	Shallow draw, course W. Asc. 27 ft. over S. slope, through scattered undergrowth.
39.98	The cor. of secs. 22, 23, 26 and 27, marked by an iron post, 2 ins. diam., firmly set in concrete base, 6 ins. diam., 6 ins. above ground, and in a flat mound of stone to top. Additionally mark brass cap to read

COUNTY SURVEYORS
T4N
S 22 | S 23
R15W
S 27 | S 26
US BLM 1947
MONUMENT

Raise a mound of stone, 3 ft. base, 2 ft. high, W of cor.

Land, broken hills.
Soil, rocky, 3rd rate.
Scattered sage, buckwheat, creosote brush; dense patches of chaparral.

N.89°37'E., bet. secs. 23 and 26.

Along S. slope of small spur, bearing W., through moderate undergrowth.

3.00	Change of slope to SW.; asc. 140 ft.
6.50	Local stub road, bears NE. and curving to S., in sharp grade. Change of slope to W., continue ascent.

Chains

9.00 Change of slope to SW.; continue gradual ascent, near top of spur, from E.

12.50 Swale, in low ridge bearing N. and S. Desc. 80 ft. over SE. slope.

19.80 Corner of three strand barbed wire fencing, in dilapidated condition, bearing irregularly to E. and S., bears Soutn, 1 lk. dist.

19.98 An iron pipe, 2 ins. diam., 2 ft. above ground, firmly set, and in a scattered mound of stone, bears North, 1 lk. dist.

Continue along S. slope, through scattered undergrowth.

23.50 Change of slope to SE.; desc. 70 ft.

27.00 Enter cultivated field, bearing NE. and SW. Desc. very slightly, over plowed land.

39.44 North end post of barbed wire fencing, from the south, bears South, 1 lk. dist. Enter lane, from E., leading to S.

39.62 The ¼ sec. cor., marked by an iron post, 2 ins. diam., firmly set in concrete base, 6 ins., diam., 9 ins. below surface of roadway. Additionally mark brass cap to read

County Surveyors
T4N
S 23
R15 W ¼
S 26
¼ SEC COR
US BLM 1947
MONUMENT

from which

A live oak, 30 ins. diam., bears N. 36½W., 61 lks. dist., marked BT

A live oak, 32 ins. diam., bears S.47°W., 87 lks. dist., marked BT

Wooden pole, No. 461934E, of three wire electric power line, extending from the East, bears N.88-3/4°E., 110 lks. dist.

West end post of barbed wire fencing, extending from the East, bears S. 86½°E., 51 lks. dist.

Corner of barbed wire fencing, extending to E. and N., bears N.4°E., 37 lks. dist.

N.89°38'E., beginning new measurement.

Over valley land, along S. side of roadway, known as Stanley Lane.

5.60 Flat wash, 1 ch. wide, course N.

15.90 Power line, three wires on wood poles, bears N. and S.

16.25 Sand Canyon highway, oil surfaced, bears N. and S., End of Stanley Lane, an unpaved roadway, extending to the West

Dependent Resurvey of Part of the Subdivision, T.4 N., R.15 W.

Chains

Leave bottom land; asc. 55 ft. over SW. slope, through scattered undergrowth.

19.00 Top of ascent; across S. slope of low, flat hill.

21.70 Connecting spur, from shallow swale to SE., bears NW. desc. 50 ft. over NE. slope.

27.50 Leave undergrowth; enter scattered oak timber; continue slight descent.

31.25 Oil surfaced road, bears S.30°E. and N.50°W. Continue along S. side of stub roadway, leading East, to Box Circle Ranch; across narrow valley.

37.50 Wash, 15 lks. wide, 4 ft. deep, course N.15°W. Asc. 10 ft. along N. slope at foot of low spur, from E., and along S. side of roadway, in margin of undergrowth.

37.60 Electric power line, three wires on wood poles, bears N. & S.

39.66 The cor. of secs. 23, 24, 25 and 26.

Land broken hills W., valley land in E.
Soil, sandy gravel, 2nd. rate; rocky in hilly portions.
Chaparral and creosote brush in hills; scattered oak trees in the valley.

Subdivision of Section 26, T.4N., R.15W.

From the ¼ sec. cor. of secs. 26 and 35.

North, on the N. and S. center line of Sec. 26.

Over slightly rolling, open valley land. Asc. 20 ft. over SE slope.

2.00 Flat gravel spur, extends NE. Desc. 15 ft. over NW. slope.

5.00 Change of slope to NE.; desc. 50 ft.

12.80 Drain, 5 lks. wide, 2 ft. deep, course NE.

19.77 Three strand barbed wire fencing, from N., extends to SW.

19.85 Enter wash, 20 lks. wide, 2 ft. deep, course NE.

19.91 Point for center S. 1/16 sec. cor.

Set an iron post, 3 ft. long, 1 in. diam., 3¼ ins. in the ground, with brass cap mkd.

C
S 1/16 | S 26
C
1947

Bury a granite stone, 6 x 6 x 5 ins., marked + alongside iron post.

Chains — Raise a mound of stone 3 ft. base, 1 ft. high, W. of cor.

From the corner

A live oak, 18 ins. diam., bears N.1-3/4°E., 147 lks. dist., mkd. C S 1/16 S26 BT

A live oak, 20 ins. diam., bears S.79°W., 51 lks. dist., mkd. BT

20.10 — Leave wash; desc. 10 ft., over nearly level land, alongside of wire fencing, extending North;and in east margin of roadway, bearing slightly to W. of North.

24.60 — Drain, 6 lks. wide, 2 ft. deep, course S.75°E.

30.00 — Leave bottom land; asc. 25 ft. over S. slope.

35.50 — Low knoll, bearing E. and W.; the terminus of small spur from SW. Desc. 45 ft. over NW. slope, through small cluster of live oak trees.

39.82 — Point for center ¼ sec. cor., at intersection with the E. and W. center line. This point has been marked, under local survey, by an iron pipe, 1 in. diam., 16 ins., long, driven flush with the surface of the ground. Another survey point, marked by an iron pipe, 2 ins. diam., driven flush with the ground surface, bears East, 4 lks. distant.

At the corner point

Set an iron post, 3 ft. long, 1 in. diam., 48 ins. in the ground, with a granite stone 5 x 4 x 4 ins., marked +, and the iron pipe, buried alongside, with brass cap mkd.

C ¼ S 26
1947

from which

An iron post, 3 ft. long, 1 in. diam., set 34 ins. in the ground, for a reference monument, bears North, 45 lks. dist., with brass cap mkd. C ¼ S26 RM 1947, and an arrow pointing to the cor.

An iron post, 3 ft. long, 1 in. diam., set 34 ins. in the ground, for a reference monument, bears South, 45 lks. dist., with brass cap mkd. C ¼ S26 RM 1947, and an arrow pointing to the cor.

Corner is situated in center of lane, or fenced roadway, from the East, here turning to SW., and in line of wire fencing extending to N. and S.; a loose strand wire gate closes the roadway at this point.

North, beginning new measurement.

Over plowed land, sloping gently to NE., and alongside wire fencing; desc. 15 ft.

11.54 — Wire fencing, extends W., from N. and S. fencing, East, 6 lks. dist. leave plowed land;asc. 10 ft.

Chains

12.70 Low knoll, bears E. and W. across swale, draining E.

18.00 Low spur, extends to NE. Desc. 30 ft. over N. slope.

19.35 Corner of wire fencing bears East, 6 lks. dist.; fencing extends to N. S. and W. Enter pasture land.

19.945 Point for center N. 1/16 sec. cor.

A residence bears S.60°E., about 2 chs. distant.

A residence bears N.55°W., 9 chs. dist.

A residence bears N.11°W., 15 chs. dist.

24.85 Wire fencing, extends West.

25.25 Wire fencing extends E. and W., end of wire fence line from W. bears East, 3 lks. dist.

34.80 Wire fencing, from W., extends East, 1 ch., thence S.

35.50 Enter ranch road, from residence to the west, here turns N. Wire fencing extends north, along W. side of roadway.

39.89 The ¼ sec. cor., of secs. 23 and 26.

From the ¼ sec. cor. of secs. 25 and 26.

S.89°32'W., on the E. and W. center line of Sec. 26.

Across shallow swale of low foothills, through N. side of vinyard; along wire fencing bearing irregularly W.

4.85 Leave vinyard; wire fence extends to S.

8.60 Short spur, extends S.30°W. Desc. over NW. slope, 50 ft.

14.55 Telephone line, parallels highway.

14.85 Sand Canyon road, oil surfaced, bears irregularly N. and S.

Desc. 15 ft. over very gradual W. slope, through scattered oaks, along S. side of roadway extending to the west.

15.30 Power line, 3 wires on wood poles, bears N. and S.

17.80 Wash, 1 ch. wide, 1 ft. deep, drains N. 20°W. Asc. 10 ft. over bottom land, in margin of roadway.

19.88 Corner of barbed wire fencing bears South 10 lks, dist., fence lines extend E. S. and W.

32.50 Roadway extends S. Continue along center of readway.

39.86 The center ¼ sec. cor.

S.89°32'W., beginning new measurement.

across plowed land; asc. 30 ft. over very gradual NE slope,

2.80 Drain, 8 lks, wide, 1 ft. deep, course N.70°E.

Subdivision of Section 26, T.4 N., R.15W.

Chains

7.60 Leave plowed land, bearing NE. and SW.; asc. 62 ft. over an increasing SE. slope, through heavy undergrowth.

15.40 Point of narrow spur, sloping S. Desc. 37 ft.

17.80 Short ravine, course S. 30°E. Asc. 45 ft. over E. slope.

19.82 Point for center W. 1/16 sec. cor.

Set an iron post, 3 ft. long, 1 in. diam., 34 ins. in the ground, with brass cap mkd.

C $\frac{W\ 1/16}{S\ 26}$ C

1947

Bury a granite stone 6 x 6 x 4 ins., marked + alongside iron post.

Raise a half mound of stone, 3 ft. base, around post.

Continue ascent 15 ft., over a decreasing E. slope.

20.40 Spur, slopes S.30°E. Continue ascent 35 ft., over SE. slope, across swale, draining SE.

24.50 Short spur, slopes S. Along S. slope, desc. 45 ft.

32.30 Head of ravine, course SE. Asc. 90 ft. over E. slope.

36.20 Low swale, in sharp divide, bearing N. and S. Leave dense undergrowth; Desc. 110 ft. over faulted, decreasing W. slope.

39.64 The ¼ sec. cor. of secs. 26 and 27.

From the W. 1/16 sec. cor., of secs. 26 and 35.

N.0°03'E., on the N. and S. center line of the SW¼ of sec. 26.

Desc. slightly, over flat slope, draining NE.; through dense undergrowth.

4.55 Road, bears N.60°E. and S.60°W.

11.50 Wash, 30 lks. wide, 2 ft. deep, course N.70°E. Asc. 20 ft. over gradual S. slope.

14.15 Drain, 5 lks, wide, course SE.

19.00 Point of small spur, slopes E.

19.83 Point for SW. 1/16 sec. cor., at intersection with the E. and W center line of SW.¼

Set an iron post, 3 ft. long, 1 in. diam., 34 ins. in the ground, with brass cap mkd.

S 26
SW 1/16
1947

Subdivision of Section 26, T.4 N., R.15 W.

Chains	
	Bury a granite stone 6 x 5 x 4 ins., marked + alongside iron post.
	Raise a mound of stone, 2 ft. base, 1½ ft. high, W.of cor.
	A local survey corner, marked by an iron pipe, 2 ins. diam., 3 ft. above ground, firmly set, bears S.85°W., 6 lks. dist.
	Asc. 5 ft. over S. slope.
21.10	Long, narrow spur, extends E. Desc. 25 ft.
24.90	Drain, course E., in wide swale, Asc. 50 ft. over an increasing SE. to S. slope.
30.30	Sharp spur, extends E. Desc. 125 ft. over N. slope.
35.30	Ravine, course N.80°E. Asc. 110 ft. over S. slope.
38.60	Shoulder of spur, from NW., breaks sharply S. Desc. 20 ft.
39.67	The center W. 1/16 sec. cor.

	From the S. 1/16 sec. cor., of secs. 26 and 27.
	N.89°41'E., on the E. and W. center line of SW. ¼ sec. 26.
	Desc. 10 ft. over E. slope, thru light undergrowth.
0.25	Gully, course SE. Over slightly rolling S. slope.
4.10	Short ravine, 40 ft. deep, course S.
7.20	Small spur, slopes S.20°W.
10.10	Sharp spur, slopes S. Desc. 90 ft. over broken SE. slope.
11.90	Short Gully, course S.10°E. Asc. 25 ft.
13.30	Small spur, slopes S. Desc. 65 ft.
15.40	Ravine, course SE. Asc. 20 Ft.
16.80	Change of slope to E.; desc. 60 ft., through dense brush.
19.83	The SW. 1/16 sec. cor.
	Desc. 15 ft. along gradual SE. slope.
24.50	Low flat spur, extends to SE. Desc. 40 ft.
26.50	Leave dense undergrowth; enter plowed field, bearing irregularly to E. and NW. Desc. 30 ft. over flat E. slope.
39.20	Wire fencing, from N., extends to S. 10 lks., thence to W.
39.45	Road, extends N., from SW.; enter wash, draining NE.
39.67	The center S. 1/16 sec. cor.

Subdivision of Section 26, T.4 N., R.15 W.

General Description.

Section 26 lies across Sand Canyon, rising into broken hills in the western portion. The valley area is dotted with live oaks, and land here is cleared and either in pasturage or under cultivation. Small ranch holdings predominate. The west part of the section rises into a broken foothill formation, densely overgrown in chaparral. The public land herein confined to the NW ¼ SW ¼ of the section, lies at a maximum elevation of 2000 feet, some 250 feet above the valley floor. This area is rough and broken, the steep slopes, being densely overgrown in a tangle of brush, make access extremely difficult.

The highway following Sand Canyon, joins the Soledad Canyon road about two miles East of Solemint, and extends to the South, over the San Gabriel Mountains to join State Route No. 118 in Tujunga Valley, about four miles distant from San Fernando.