


9453

FIELD NOTES
OF
MINERAL SURVEY NO. 6626
OVERSIGHT NO. 2 LODE
MINING CLAIM

Surveyed by B.B. Packard, September to December 1957

Copied from photostats
 made by the U.S. Bureau
 of Land Management.
 Vol. 221-1 to 3

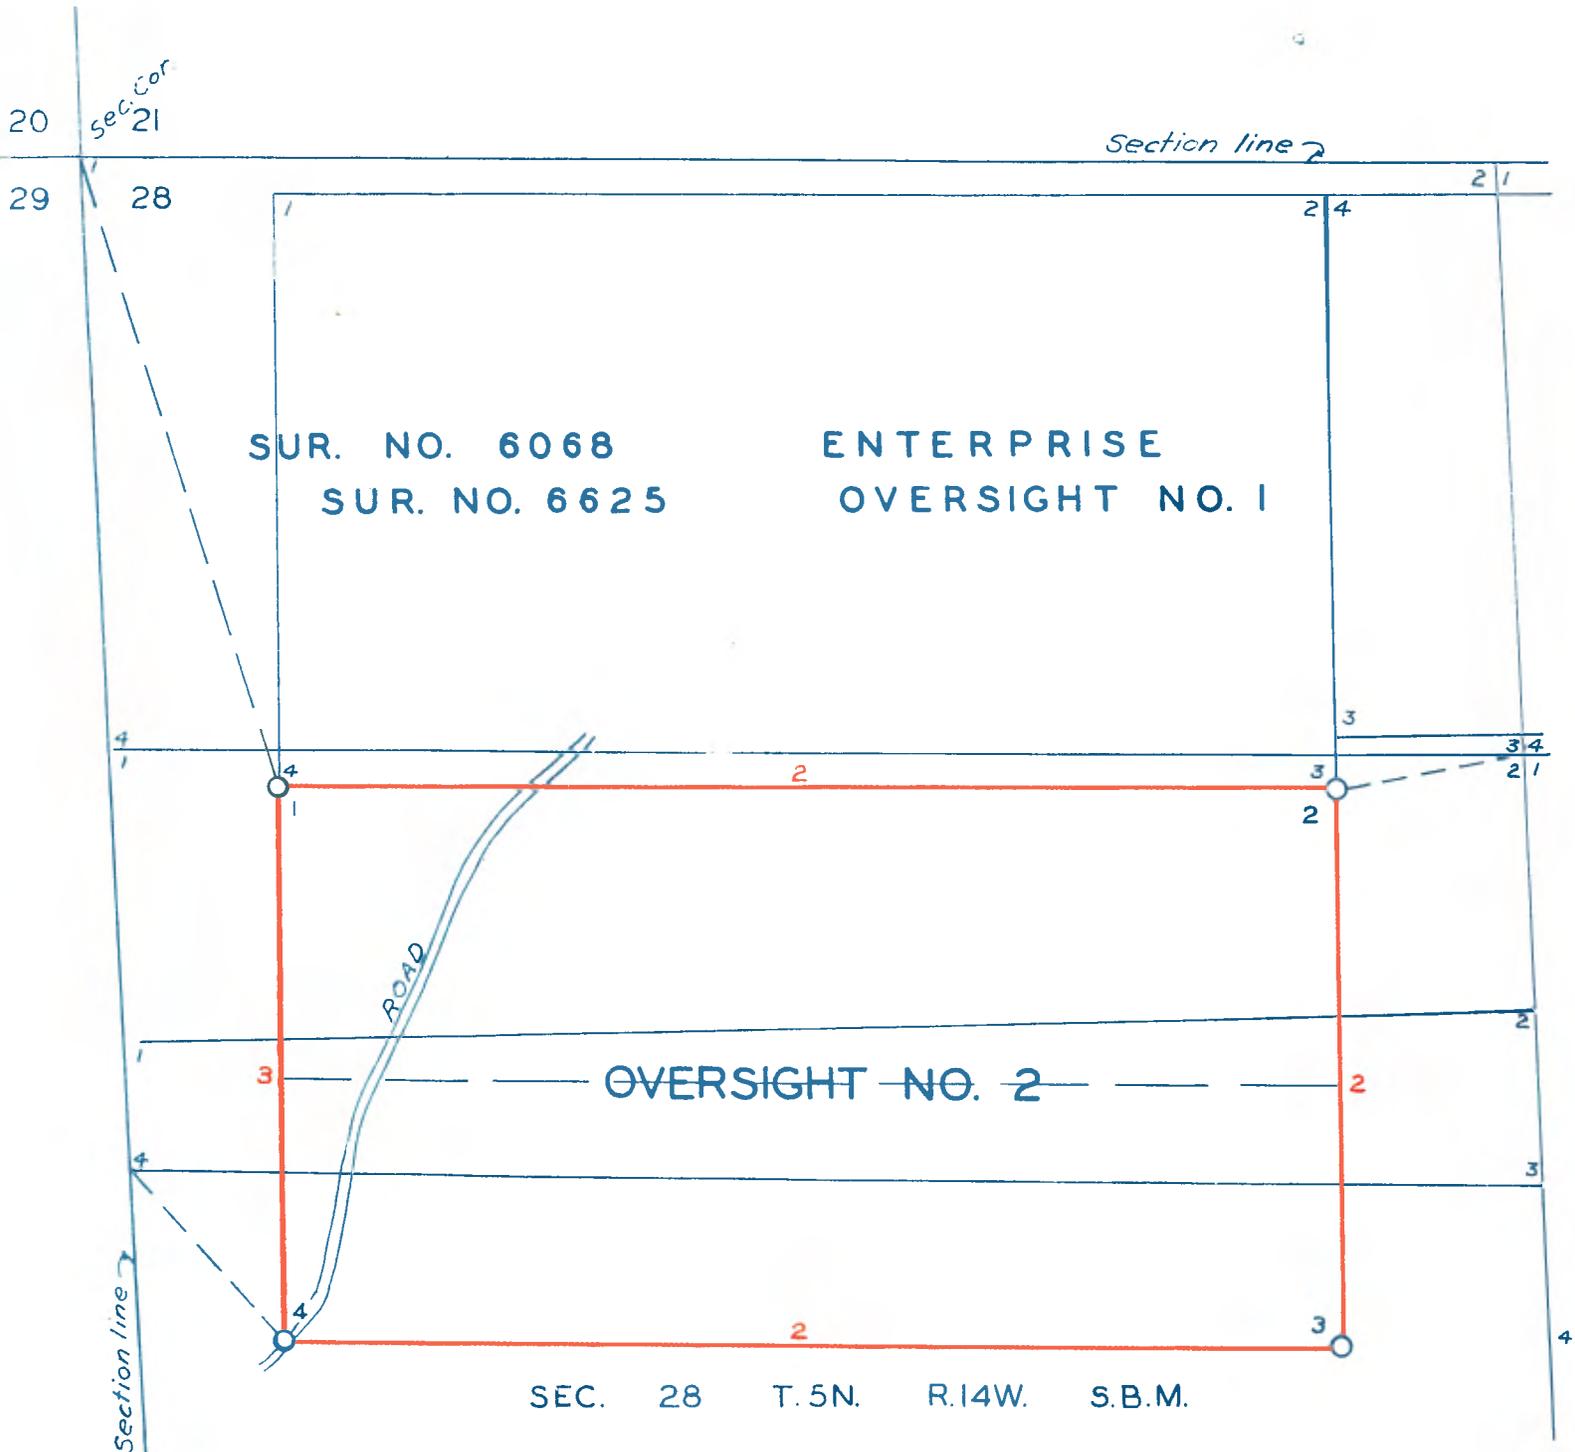

— Packard

FD 9451

SURVEY No. 6626

This survey was made with a C. L. Berger & Sons transit No. 28625, with horizontal limb 5 ins. diam., having two double opposite verniers, and full vertical circle 5 ins. diam., having one double vernier; the verniers read to one minute of arc. The instrument was in good condition at the time of the survey and all adjustments were in good order.

All azimuths in this record were determined by the method of deflection angles referred to the meridian determined by the following observation:

September 12, 1957, at a point about 900 ft. southwesterly of the NW. cor. of sec. 28, T. 5 N., R. 14 W., S.B.M., in latitude 34°29'30" N. and longitude 118°21'30" W., I make a series of six observations upon Polaris for azimuth, three each with the telescope in direct and reversed positions, observing the star at eastern elongation, and reading the horizontal angle from a point on a base line approximately 300 ft. dist., northward NW. to Polaris.

Mean time of observation, 120th meridian standard time	=	8h25m p.m.
Declination at mean time of observation	=	89°03'49.27"
Mean horizontal angle from reference point to Polaris	=	34°55'30"
True bearing to reference point	=	N. 36°03'40" E.

The lines were measured with a Lufkin steel tape 500 feet in length, graduated to hundredths throughout, and a Lufkin steel tape 100 feet in length, graduated to hundredths throughout; both tapes were known to be correct at the time of beginning the survey.

All lines and connections of this survey were run by direct methods as shown by calculation sheets herewith submitted.

The magnetic declination observed at each corner of the survey gave a uniform value of 15° E.

MS 6626
Vol 221 - 1 to 3
(2 sheets)
Los Angeles County

Feet

OVERSIGHT NO. 2 LODE

Beginning at Cor. No. 1 of the Oversight No. 2 lode, identical with Cor. No. 4 Sur. No. 6625 Oversight No. 1 lode.

An iron post, 4 ins. above ground, 2 ins. diam., surrounded by a mound of stone, and with a brass cap mkd. 01-4-6625-02-1-6626; from which

The point for the original corner of secs. 20, 21, 28, and 29, T. 5 N., R. 14 W., S.B.M., identical with Cor. No. 1 Sur. No. 6068 Enterprise lode, bears N. 15°55' W., 676.13 ft. dist.

The corner of secs. 20, 21, 28, and 29, as established by the County Surveyor of Los Angeles County, a circular brass plate, 3 ins. diam., embedded in concrete, and properly marked, identical with Cor. No. 1 Sur. No. 6625 Oversight No. 1 lode, bears N. 1°03'40" E., 600.0 ft. dist. (This position for the section corner is not recognized by the Bureau of Land Management as having been properly established.)

No other local bearing objects or bearing trees available.

SURVEY No. 6626

2

Feet	
	Thence S. 89°30' E.
	Along line 4-3 Sur. No. 6625 Oversight No. 1 lode.
130.0	Gulch, 7 ft. wide, course SE.
291.0	Road, 10 ft. wide, bears NE. and SW.
326.0	Center of wash, indefinite width, course SW.
1126.0	Cor. No. 2, identical with Cor. No. 3 Sur. No. 6625 Oversight No. 1 lode.
	An iron post, 4 ins. above ground, 2 ins. diam., surrounded by a mound of stone, with brass cap mkd. 01-3-6625-02-2-6626; from which
	Cor. No. 3 Sur. No. 6616 Oversight No. 1 Extension lode bears N. 1°03'40" E., 52.5 ft. dist.
	Cor. No. 2 Sur. No. 6068 Paymaster Fraction lode bears N. 82°22'30" E., 200.42 ft. dist.
	No other local bearing objects or bearing trees available.
	Thence S. 1°03'40" W.
223.59	Intersect line 1-2 Sur. No. 6068 Paymaster lode at a point from which the point for Cor. No. 2 bears N. 88°52' E., 207.68 ft. dist.
300.0	Lode line; discovery point bears N. 89°30' W., 1076 ft. dist.
399.92	Intersect line 3-4 Sur. No. 6068 Paymaster Fraction lode at a point from which the point for Cor. No. 3 bears S. 89°04'25" E., 214.62 ft. dist. and Cor. No. 4 bears N. 89°04'25" W., 1285.82 ft. dist.
566.0	Cor. No. 3.
	Set an iron post, 16 ins. long, 2 ins. diam., 12 ins. in the ground, surrounded by a mound of stone, with brass cap mkd. 02-3-6626.
	No local bearing objects or bearing trees available.
	Thence N. 89°30' W.
1086.	Center of wash, indefinite width, course SW.
1120.	Road, 10 ft. wide, bears NE. and SW.
1126.0	Cor. No. 4.
	This corner falls at the west edge of a road where a permanent monument cannot be established; from this point
	Witness Cor. to Cor. No. 4 bears N. 89°30' W., 2.15 ft. dist.; an iron post, 16 ins. long, 2 ins. diam., buried flush with the surface and set in concrete, with brass cap mkd. WC-02-4-6626.
	Cor. No. 4 Sur. No. 6068 Paymaster Fraction lode bears N. 41°29'05" W., 236.28 ft. dist.
	No other local bearing objects or bearing trees available.

Feet	
	Thence N. 1°03'40" E.
174.46	Intersect line 3-4 Sur. No. 6068 Paymaster Fraction lode at a point from which Cor. No. 4 bears N. 89°04'25" W., 159.77 ft. dist.
266.0	Lode line; discovery point bears S. 89°30' E., 50 ft. dist.
310.28	Intersect line 1-2 Sur. No. 6068 Paymaster lode at a point from which the point for Cor. No. 1 bears S. 88°52' W., 165.53 ft. dist., and point for Cor. No. 2 bears N. 88°52' E., 1334.10 ft. dist.
566.0	Cor. No. 1, and place of beginning.

AREAS

	Acres
Total area, Oversight No. 2 lode -----	14.625
Area in conflict with--	
Sur. No. 6068 Paymaster lode -----	8.433
Sur. No. 6068 Paymaster Fraction lode -----	10.224
Sur. No. 6068 Paymaster Fraction lode, exclusive of its conflict with--	
Sur. No. 6068 Paymaster lode -----	6.192

LOCATION

This survey is located in the NW $\frac{1}{4}$ sec. 28, T. 5 N., R. 14 W., San Bernardino Meridian.

The survey of the Oversight No. 2 lode is identical with the amended location as marked on the ground.

EXPENDITURES

The improvements and the value of the labor and improvements made upon or for the benefit of the lode location embraced in said mining claim by the claimants or their grantors are as follows:

- No. 1 The discovery point of the Oversight No. 2 lode is marked by a 4x6 ins. wooden post protruding 3 ft. above a mound of stone, 2 ft. diam., at base and 2 ft. high, on which is posted a copy of the amended location certificate, and is on the lode line 50 ft. from a point on line 4-1, 266 ft. from Cor. No. 4.
No value.
- No. 2 A tunnel, 5x6 ft. in size, the portal of which bears N. 79°26' E., 110 ft. from Cor. No. 4 Oversight No. 2 lode; running N. 84°45' E., 140 ft. to the bottom of a vertical shaft, 150 ft. to point A, and 266 ft. to breast. At the shaft, which is 6x6 ft., 67 ft. deep, a second tunnel, 5x6 ft. in size, runs N. 30°05' W., 106 ft. to portal. At point A, a crosscut, 5x6 ft. in size, runs S. 5°15' E., 20 ft. to breast. Claimants state that they expended \$360 in repairing the main tunnel, and developed the crosscut at a cost of \$250. All other development work in this improvement was performed by parties unknown.
Value, \$610.

MS 6626
 Vol 221 - 1 to 3
 (2 sheets)
 Los Angeles County