
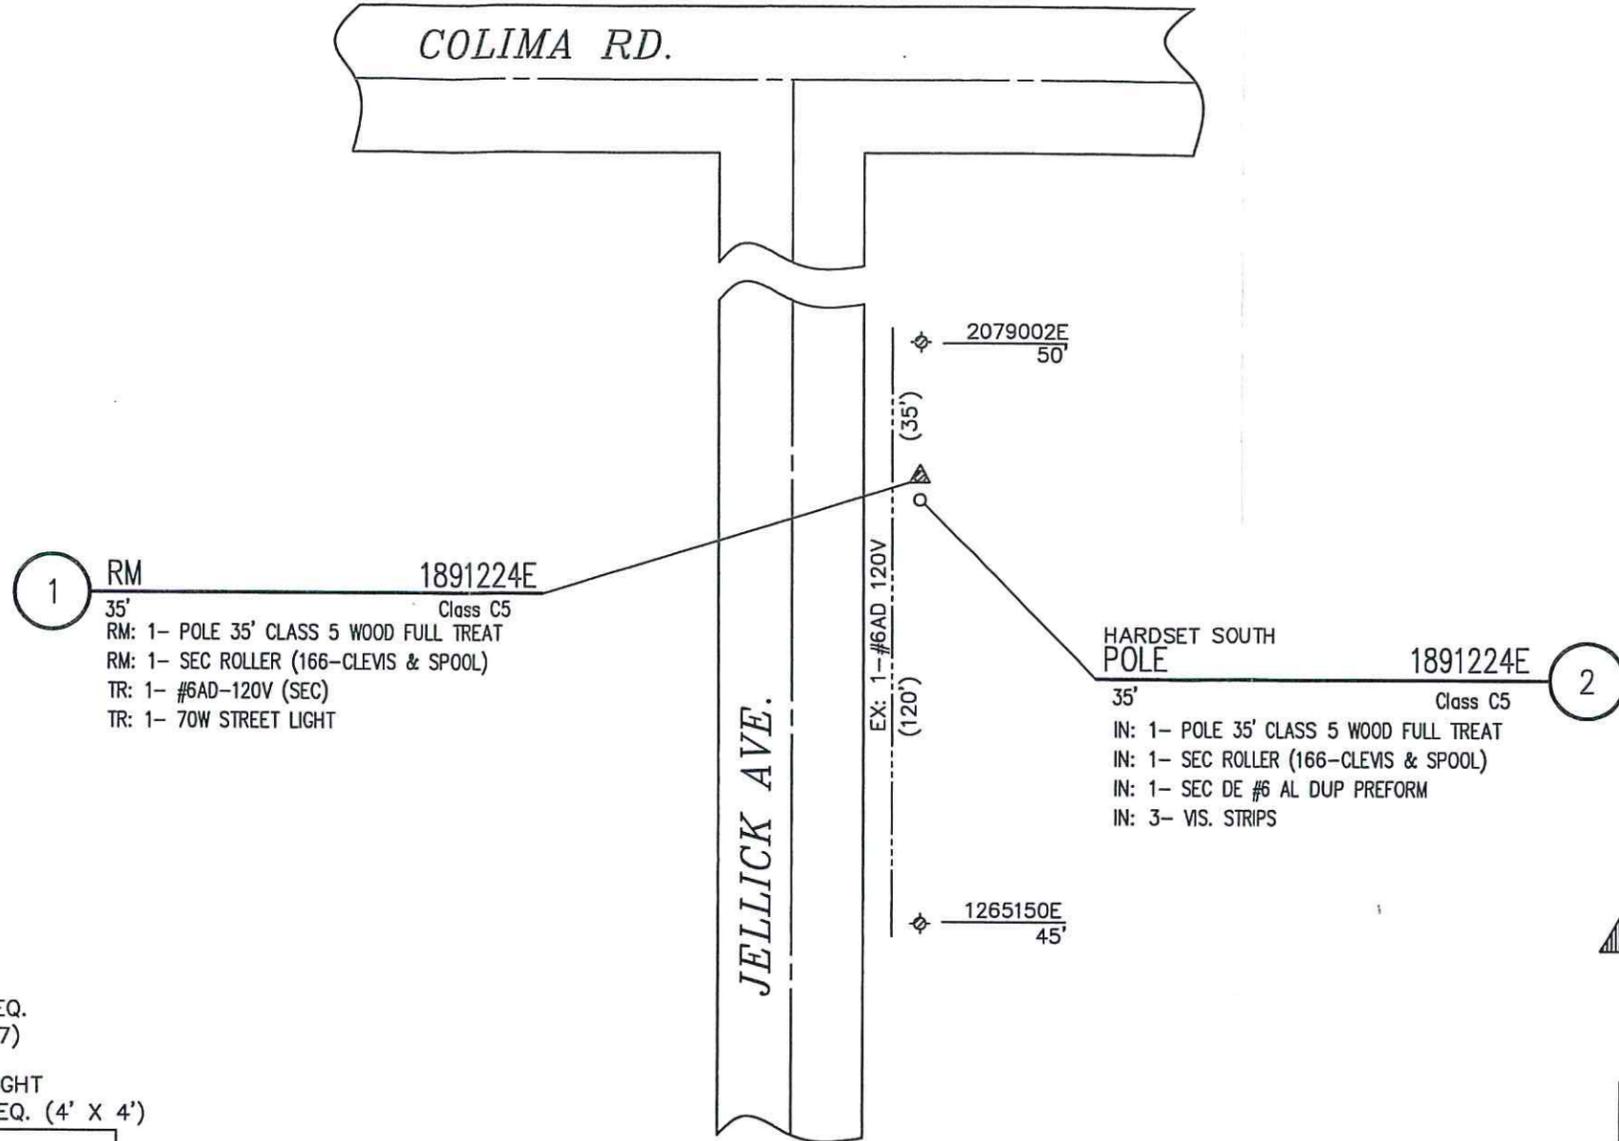


### VICINITY MAP


NOT TO SCALE  
 GPS: N33° 59' 15.74"  
 W117° 54' 04.31"

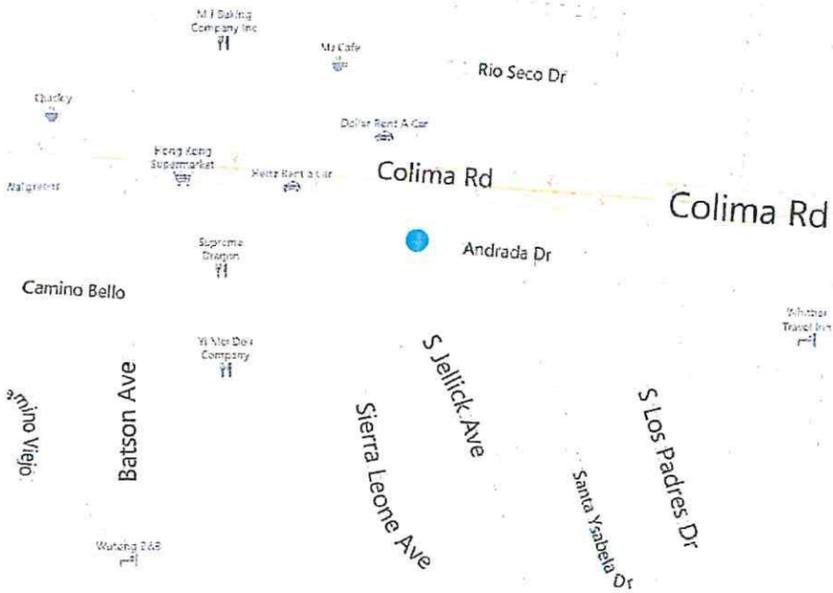

**NOTE:**

- TRAFFIC CONTROL REQ.
- P.T.C. REQ. (ROUTE 7)
- E TO ALL
- TRANSFER STREET LIGHT
- CONCRETE REPAIR REQ. (4' X 4')

**REQUIRED PERMITS:**  
 -TRAFFIC CONTROL PERMIT REQ.  
 -EXCAVATION PERMIT REQ.

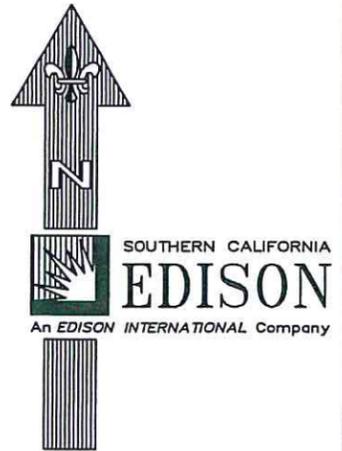

- NOTES:**
- HAND SET: NO
  - JOINT MEET: NO
  - TRUCK ACCESS: YES
  - CONTACT CATV: NO
  - PAVEMENT REPAIR: YES
  - JOINT ANCHOR: NO
  - ENVIRONMENTAL/  
REAL PROP. REVIEW: NO

If changes to JPA are req'd i.e., Cut vs. PTD, or location change \*contact Joint Utility prior to construction

UTILITY: \_\_\_\_\_

ENGINEER: \_\_\_\_\_

PHONE: \_\_\_\_\_

DATE: \_\_\_\_\_

INSPECTED BY: \_\_\_\_\_

DATE INSPECTED: \_\_\_\_\_ STA: 1 & 2

### DINER 12KV % RAILROAD SUB

NOT TO SCALE

DISTRICT 26 - COVINA		PROJ. MGR. JOHN RODRIGUEZ PHONE 909-469-0219		PLANNER KEVIN PIVOVAROFF PHONE 909-303-3493		BUDGET ITEM 480	YEAR 2014	
FOREMAN		TRUCK NO.	P/E	INVENTORY MAP NO. 108-4317-1	THOMAS GUIDE 679-A5	GRID NO. 000	DESIGN NO. <b>575760_0.01</b>	
CSD 140 Y _____ N _____	BY-PASS CODE _____	EXISTING CHANGE TO _____	TLM CHECKED _____	J.P.A. NO.		ASSOCIATED DESIGN NO.		
PRODUCT/SAP NO. <b>824702 - DET POLE REPLACEMENT</b>			PRODUCT/SAP NO.			PRODUCT/SAP NO.		
PROPOSED CONSTRUCTION (LOCATION) DETERIORATED POLE REPLACEMENT JELICK E/S 120' S/O 5TH AVE COVINA							SHEET	JOB NO. <b>575760_0.01</b>
TYPE	APPROVED BY	DATE 4/2/14	CHECKED BY	DRAWN BY IMS/SR	PAX # 909-303-3493	_____ OF _____		
Southern California Edison Company								

18505 Andrada Dr, Rowland Heights, CA 91748, USA



Pole Location


© 2014 Google


Goog

1995

Imagery Date: 4/16/2013 33°59'16.23" N 117°54'03.37" W elev 468 ft



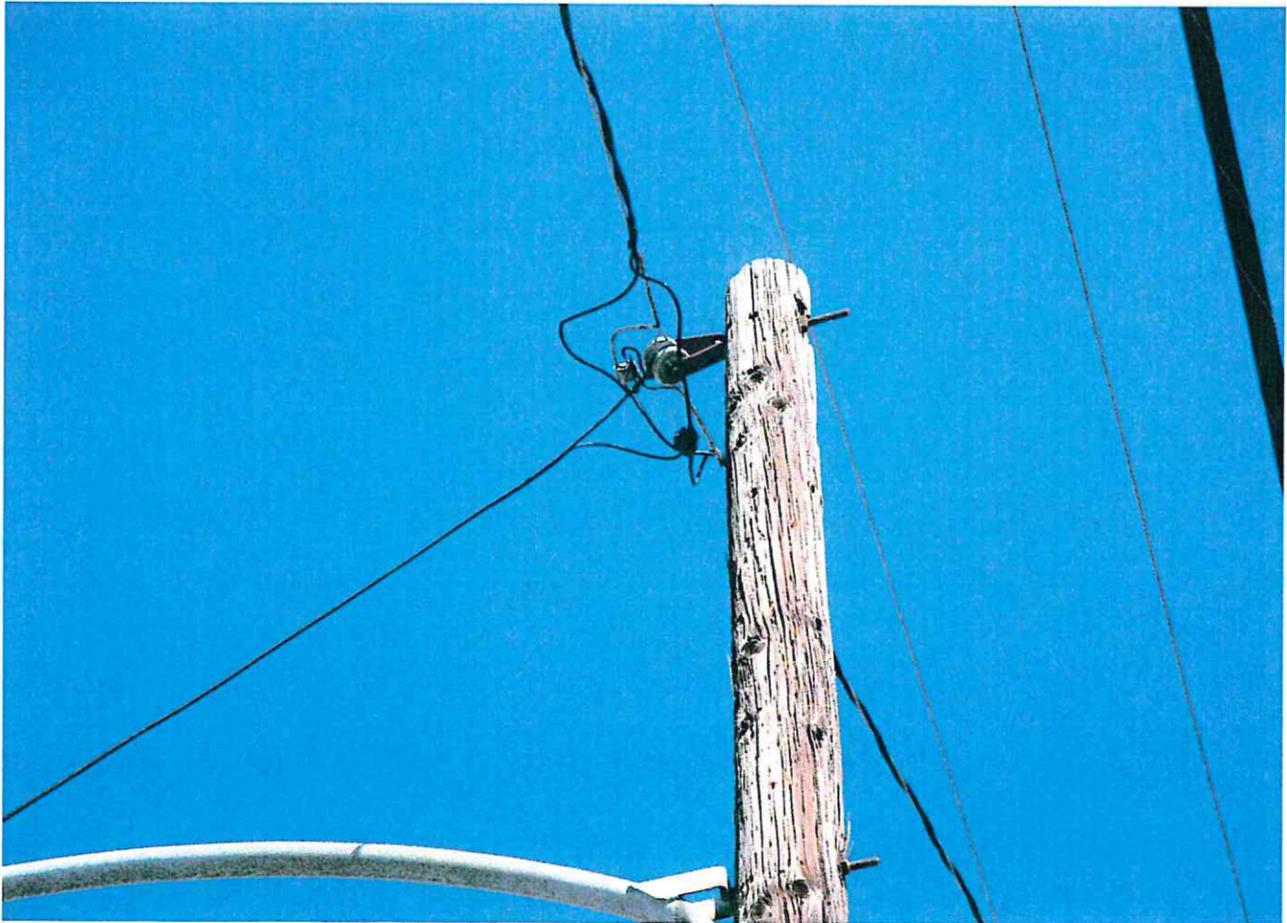

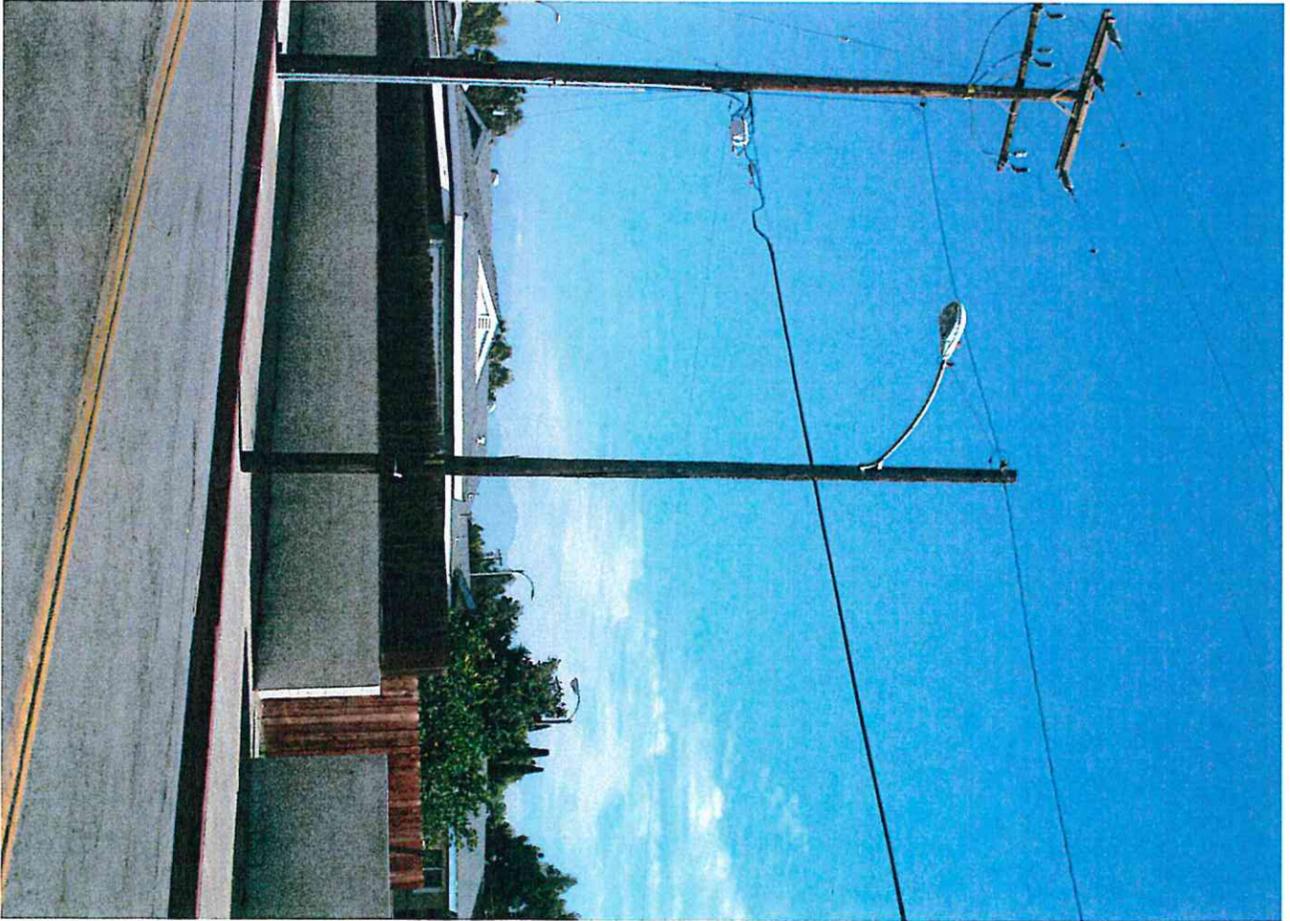

Sierra Leone Avenue

Jellick Avenue

Colima Road

40 feet wide

CURB OR E.P.

48 HRS PRIOR TO COMMENCING WORK  
(IF REQUIRED)  
INSTALL TEMP. NO PARKING SIGNS

SHIFTING TAPER L/2  
SEE TABLE "B"

A SEE TABLE "A" B SEE TABLE "A" C SEE TABLE "A"

G20-2

C12(CA)

C12(CA)

W20-1

R4-7A

R4-7A

W20-1

C12(CA)

C12(CA)

INSTALL TEMP. NO PARKING SIGNS  
48 HRS PRIOR TO COMMENCING WORK  
(IF REQUIRED)

CURB OR E.P.

G20-2

C SEE TABLE "A" B SEE TABLE "A" A SEE TABLE "A"

SHIFTING TAPER L/2  
SEE TABLE "B"

BUFFER  
50' MIN. OR  
TABLE "D"

Pole Location

Pole is located 245 feet from Sierra Leone Avenue.

Pole is located 125 feet from Colima Road.

LEGEND

- TYPE III BARRICADE W/SIGN
- TYPE II BARRICADE W/O SIGN
- CHANNELIZING DEVICE
- TRAFFIC CONE WITH CLIP ON SIGN
- SIGN
- SIGNALIZED INTERSECTION
- ARROW PANEL (FLASHING ARROW) (WHERE REQUIRED)
- HIGH LEVEL WARNING DEVICE (FLAGTREE) (OPTIONAL)
- FLAGGER
- TANS TOW AWAY NO STOPPING 8 TO 5 (SHOW HOURS)
- TANSAT TOW AWAY NO STOPPING ANY TIME
- WORK ZONE (ACTIVITY AREA) LIMITS
- DIRECTION OF TRAFFIC (NOT PAVEMENT MARKING)
- ROADWAY DESIGNATION (A THROUGH D)

END ROAD WORK

G20-2

NARROW LANE

C12(CA)

ROAD WORK AHEAD


W20-1

KEEP RIGHT

R4-7A

DATES OF TEMPORARY NO PARKING ZONE

West of 18505 Andrada Drive  
TD824702 Pole 1891224E

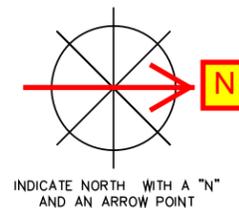

WORKSITE TRAFFIC CONTROL PLAN  
CENTER OF ROAD WORK AREA  
TWO LANE TRAFFIC CONTROL

DATE	SCALE
	NONE
	DRAWING NO. 2