


Copied from Photographic Copies
 furnished by
 U. S. General Land Office
 Washington, D. C.

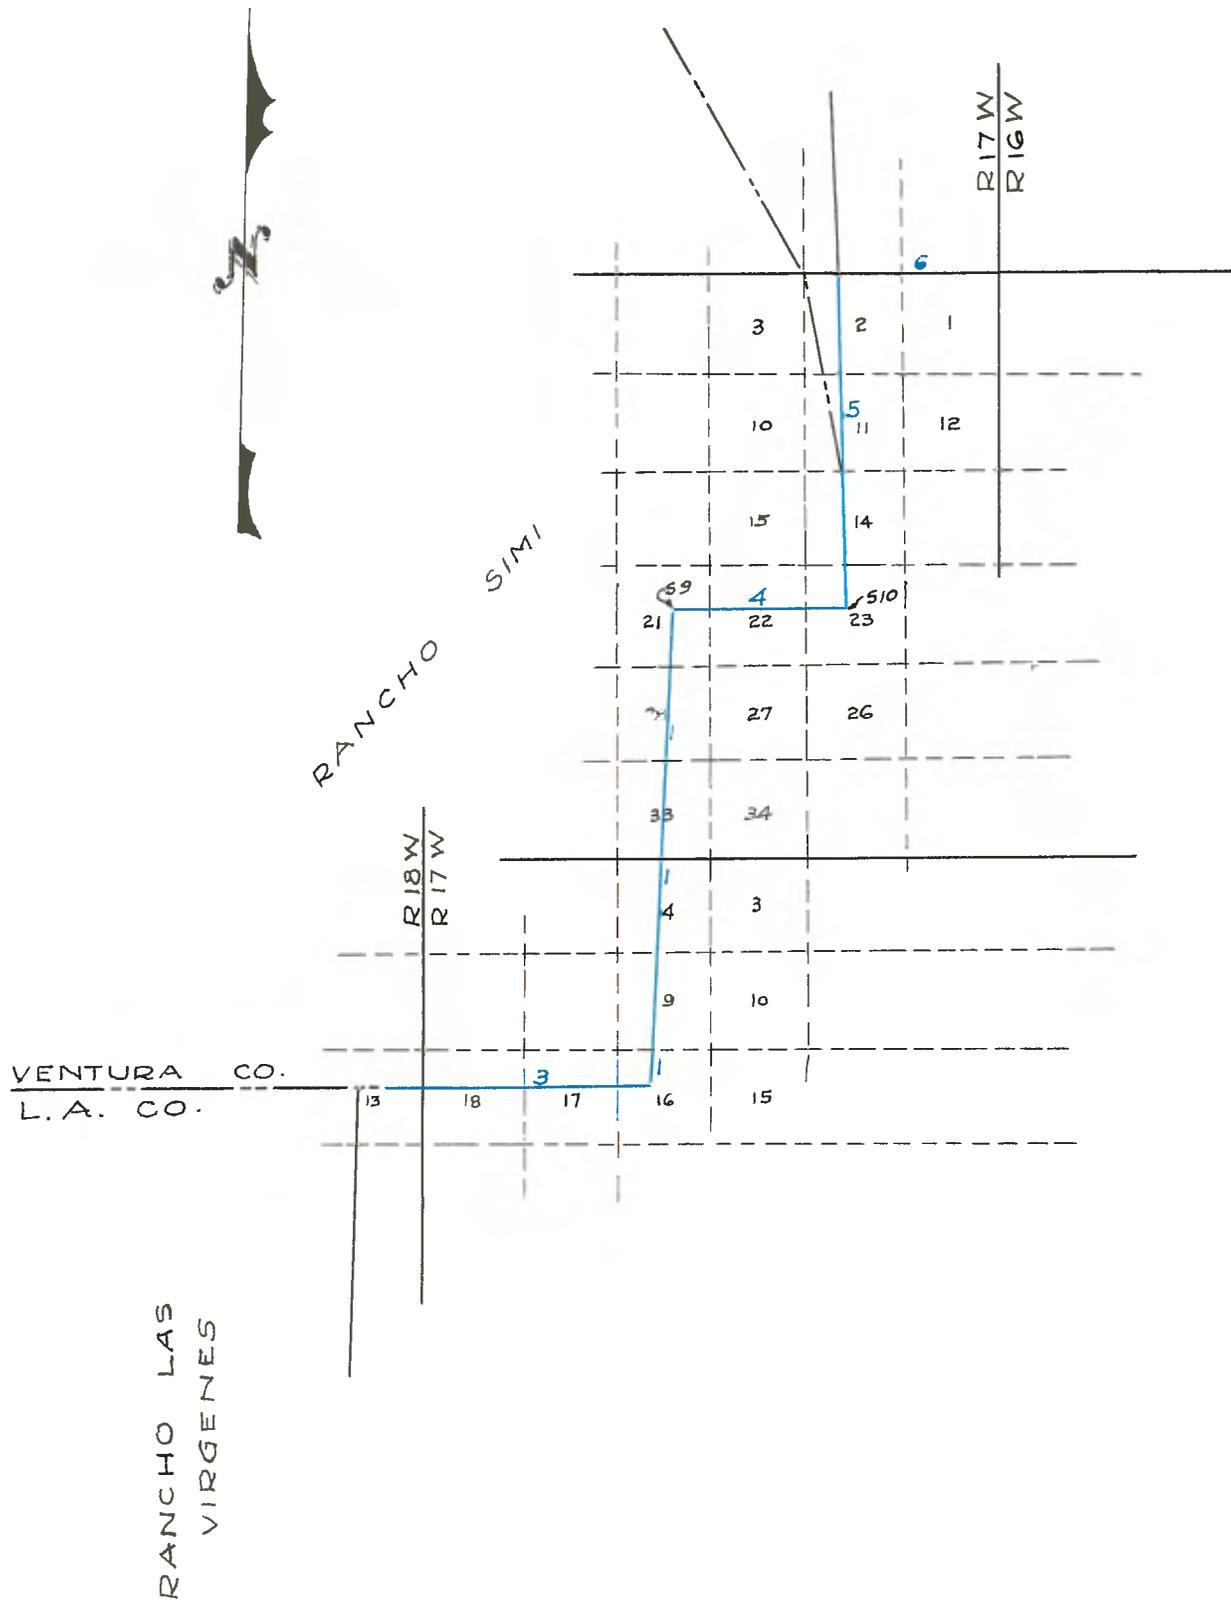

Resurvey

**Boundary Line of Rancho Simi through
T. 1 N., R. 17 W., S. B. M.**

Chains

I commence my survey at Station 8 on the boundary line of Rancho Simi, which was a broken white limestone, marked S. 8 and L. A. and V. it being on the county line between Los Angeles and Ventura Counties. To remark the station, I set a limestone, 34 x 12 x 12 ins. 25 ins. in the ground, marked S. 8 on W. face and raised a stone mound alongside on which I placed the old marked stone.
Pits impracticable.
Thence I run
North on a random line along boundary.

400.18

To a point 8 lks. E. of old station 9 which I find nearly destroyed. I obliterated all traces of old corner and in its place set a sandstone 24 x 12 x 10 ins. marked S. 9 on W. face, on top of a sandstone boulder, 10 x 8 x 6 feet and raised a stone mound alongside.
Pits impracticable.

August 23rd, 24th, 26th, 27th, 28th 1895.

Thence I run
S. 0° 1' E. on a true line along boundary.

Va. 14° 30' East

Va. 14° 30' East

Descend.

.18

Set a sandstone 24 x 15 x 6 ins. 18 ins. in the ground for corner on line marked 10/400 on S. and S. on W. faces and raised a stone mound alongside.

Pits impracticable.

18.00

Cross gulch 10 lks. wide, course E. and ascend.

28.14

Cross wood road bears N. W. and S. E.

40.18

A sandstone 15 feet high, which I mark 9/360 on S. and S. on W. faces for corner on line.

46.18

Top of ridge bears E. and W. and descend.

Boundary Line of Rancho Simi through Tps. 1 and 2 N.,

R. 17 W., S. B. M.

53.00

Cross gulch 10 lks. wide course N.E. and ascend.

54.18

Top of spur bears E. and W. and descend.

62.78

Cross spring Branch, 10 lks. wide. Course E. and ascend.

67.18

Top of spur, bears E. and W. and descend.

80.18

Set a sandstone 24 x 12 x 8 ins. 18 ins. in the ground for cor. on line marked 8/320 on S. and S. on W. faces, and raised a stone mound alongside.

Pits impracticable.

97.75

Cross gulch 8 lks. wide, course E. and ascend.

98.22

Cross wood road bears E. and W.

99.68

Top of spur bears N.E. and S. W. and descend.

101.88

Cross gulch 6 lks. wide, course N.E. and ascend.

115.18

Top of ridge bears N. E. and S. W. and descend.

120.18

Set a sandstone 20 x 10 x 8 ins. 15 ins. in the ground for corner line, marked 7/280 on S. and S. on W. faces and raised a stone mound alongside.

Resurvey

Boundary line of Rancho Simi through
Tps. 1 and 2 N., R. 17 W., S.E.M.

Chains

Pits impracticable.
Cross spring branch 15 lks. wide course E. and ascend.
Cross trail bears N. E. and S. W.
Top of low spur bears E. and W. and descend.
Enter flat bears E. and W.
Leave flat bears E. and W. and ascend.
Top of ridge bears E. and W. and descend.
Cross head of gulch, course S.E. and ascend.
Top of spur bears N. W. and S. E. and descend.
Set a cement stone 20 x 10 x 8 ins. 15 ins. in the ground
for cor. on line, marked 6/240 on S. and S. on W. faces
and raised a stone mound alongside.
Pits impracticable.
Cross ravine 6 lks. wide course E. and ascend.
Top of ridge bears E. and W. and descend.
Cross gulch 10 lks. wide course E. and ascend.
Cross road bears E. and W.
Set a sandstone 30 x 18 x 12 ins. 22 ins. in the ground
for cor. on line, marked 5/200 on S. and S. on W. faces
and raised a stone mound alongside.
Pits impracticable.
Top of ridge bears E. and W. and descend.
Cross low sag bears E. and W. and ascend.
Top of ridge bears E. and W.
The land in advance consists of precipitous cliffs,
impossible to chain. I leave a flag at this point and
proceed to a point on true line from which I run
a base E. of 3.50 chs. from the E. end of which the flag
bears N. 18° 54' W. giving by calculation, a distance of
10.23 chs. and a total distance from station 9 of
240.18 To foot of cliffs and set a sandstone 22 x 16 x 12 ins.
16 ins. in the ground for cor. on line marked 4/160 on S.
and S. on W. faces and raised a stone mound alongside.
Pits impracticable.
248.18 Cross Creek 12 lks. wide course S. E. and ascend.
266.18 Top of spur bears E. and W. and descend.

Boundary Line of Rancho Simi through

T. 1 N., R. 17 W., S. E. M.

280.18 Set a limestone 18 x 12 x 10 ins. 12 ins. in the ground
for cor. on line marked 3/120 on S. and S. on W. faces
and raised a stone mound alongside.
Pits impracticable.
283.12 Cross gulch 4 lks. wide, course E. and ascend.
299.68 Top of ridge bears E. and W. and descend.
307.14 Cross gulch 5 lks. wide course E. and ascend.
311.18 Top of ridge bears E. and W. and descend.
316.18 Cross gulch 6 lks. wide course E. and ascend.
320.18 Set a limestone 18 x 12 x 6 ins. 12 ins. in the ground
for cor. on line marked 2/80 on S. and S. on W. faces,
and raised a stone mound alongside.
Pits impracticable.
322.68 Top of ridge bears E. and W. and descend.

Resurvey.

Boundary Line of Rancho Simi through
T. 1 N., R. 17 W., S.B.M.

Chains
336.68
342.18
346.93
356.18
360.18

Cross head of gulch, course E. and ascend.
Top of ridge bears E. and W. and descend.
Cross gulch 10 lks. wide, course S.E. and ascend.
Top of ridge bears N.W. and S.E. and descend.
Set a limestone 20 x 8 x 6 ins. 15 ins. in the ground
for cor. on line marked 1/40 on S. and S. on W. faces and
raised a stone mound alongside.

Pits impracticable.

366.70
376.68
388.78
391.18
394.33
396.93
400.18

Cross gulch 6 lks. wide, course S. 45° E. and ascend.
Top of ridge bears E. and W. and descend.
Cross gulch 4 lks. wide, course S.E. and ascend.
Top of ridge bears E. and W. and descend.
Cross fence bears E. and W.
Cross gulch 4 lks. wide, course E. and ascend.

To station No. 8

Land mountainous.

Soil 3rd rate.

Scattering Oak timber and dense undergrowth of Chaparral.
August 29th, 30th and 31st.

From Station No. 8, I run
West in a random line, along boundary.

Va. 14° 30' East.

244.35

To a point 3.66 chs. S. of post set for corner of Rancho
Las Virgenes on Rancho Simi boundary marked L. V. on S. and
S. on N. faces with a stone mound which I rebuild around
same.

Sept. 2nd and 3rd 1895.

Thence:

S. 89° 09' E. on a true line along boundary.

Va. 14° 30' East

Ascend.

30.70
52.21
59.85
82.35
84.35

Top of low broken ridge bears N. and S. and descend.
Cross canon, 15 lks. wide, course S. and ascend.
Top of ridge bears N. and S. and descend.
Cross road bears N. and S.
Set a post 4 feet long 4 ins. square with marked stone,
12 ins. in the ground for cor. on line marked 4/160 on E.
and S. on N. faces and raised a stone mound around same.
Pits impracticable.

85.35

Cross wash 20 lks. wide course S. and ascend.

111.35
122.60
124.35

Top of spur bears N. and S. and descend.
Cross canon, 10 lks. wide, course S. and ascend.
Set a sandstone 26 x 10 x 8 ins. 19 ins. in the ground for
cor. on line marked 3/120 on E. and S. on N. faces and
raised a stone mound alongside.
Pits impracticable.

135.85
148.61
156.85
164.35

Top of ridge bears N. and S. and descend.
Cross gulch 25 lks. wide, course S. and ascend.
Top of ridge bears N. and S. and descend.
Set a limestone 15 x 12 x 6 ins. 12 ins. in the ground for
cor. on line marked 2/80 on E. and S. on N. faces and

Resurvey

Boundary Line of Simi Rancho through
T. 1 N., R. 17 W., S. B. M.

Chains

raised a stone mound alongside.
 Pits impracticable.
 170.87 Cross gulch 10 lks. wide course S. W. and ascend.
 180.85 Top of low spur bears N. E. and S. W. and descend.
 188.25 Cross gulch 4 lks. wide course S. and ascend.
 191.35 Top of ridge bears N. and S. and descend.
 194.60 Cross gulch 5 lks. wide course S.E. and ascend.
 197.65 Top of low spur bears N. and S. and descend.
 198.31 Cross ravine 6 lks. wide course S. and ascend.
 204.35 Set a sandstone 20 x 8 x 6 ins. 15 ins. in the ground for
 cor. on line marked 1/40 on E. and S. on N. faces and
 raised a stone mound alongside.
 Pits impracticable.
 210.83 Cross road bears N. and S.
 220.35 Top of spur bears N. and S. and descend.
 240.35 Cross road bears N. and S. and ascend.
 244.38 To station No. 8
 Land mountainous and broken.
 Soil 3rd rate.
 Scattering Oak timber and dense undergrowth of Chaparral.
 Sept. 4th, 1895.

From station No. 9 I run,
East on a random line along boundary.

162.94 Va. 14° 30' East.
 To station No. 10, which I find in bad condition. To
 remark same, I set a post 4 feet long 6 ins. square, 12 ins.
 in the ground, marked S. 10 on N. W. face, dug pits 18 x
 18 x 12 ins. on line N. and W. of post 5 1/2 feet dist. and
 raised an earth mound 2 feet high 4 1/2 feet base around post.
 From which bears:
 A live oak, 30 ins. dia. N. 17° E. 40 lks.
 dist. marked S. 10 B. T.
 Sept. 6th, 1895.

Thence I run,

West on a true line, along boundary.

Va. 14° 30' East.

Ascend.

16.94 Top of spur bears N. and S. and descend.
 25.84 Cross ravine 5 lks. wide course S. and ascend.
 33.94 Top of ridge, bears N. and S. and descend.
 42.94 Set a sandstone, 24 x 10 x 8 ins. 15 ins. in the ground
 for cor. on line marked 3/120 on W. and S. on N. faces
 and raised a stone mound alongside.

Pits impracticable.

RESUME

Boundary Line of Rancho Simi through
T. 2 N., R. 17 W., S.E.M.

Chains
48.84 Cross gulch 6 lks. wide, course S. and ascend.
60.94 Top of spur bears N. and S. and descend.
68.90 Cross gulch 6 lks. wide, course S. and ascend.
75.94 Top of spur, bears N.E. and S.W. and descend.
80.94 Cross wood road bears N. and S.
81.94 Cross gulch 4 lks. wide, course S. and ascend.
82.94 Set a sandstone 26 x 16 x 7 ins. 19 ins. in the ground for
cor. on line marked 2/80 on W. and S. on N. faces and
raised a stone mound alongside.
Pits impracticable.

105.04 Top of spur, bears N. and S. and descend.
108.83 Cross gulch, 4 lks. wide course S. and ascend.
121.94 Top of spur, bears N. and S. and descend.
122.94 Set a sandstone 20 x 16 x 8 ins. 15 ins. in the ground for
cor. on line marked 1/40 on W. and S. on N. faces and
raised a stone mound alongside.
Pits impracticable.

125.92 Cross gulch 4 lks. wide course S.E. and ascend.
133.94 Top of spur bears N.W. and S.E. and descend.
158.94 Cross gulch 4 lks. wide course S.E. and ascend.
162.94 To station No. 9.
Land broken and mountainous.
Soil 3rd rate.
Scattering oak timber and dense undergrowth of chapparral.
Sept. 7th, 1895.

From station No. 10 I run,
N. 1° 20' W. on a random line, along boundary.
Va. 14° 30' East.
It being impossible to chain this line on account of
precipitous cliffs. I offset N. 88° 40' E. 4.00 chs.
thence N. 1° 20' W. 40.00 chs.
Thence S. 88° 40' W. to line
Thence N. 1° 20' W.
124.90 To a live oak tree marked S. 8 on W. face
Sept. 9th, 1895.

Thence I run
S. 1° 20' E. on a true line, along boundary.
Va. 14° 30' East

Descend.

4.90 A sandstone in place 6 x 6 x 3 feet above ground, marked
S. 3/120 for cor. on line.
17.93 Cross gulch, 10 lks. wide course E. and ascend.
19.90 Top of spur bears E. and W. and descend.
31.55 Cross gulch 10 lks. wide, course E. and ascend.
44.90 Set a sandstone 24 x 18 x 12 ins. 18 ins. in the ground for
cor. on line marked S. 2/80 on S. face and raised a stone
mound alongside.
Pits impracticable.

Resurvey

Boundary Line of Rancho Simi through
T. 2 N., R. 17 W., S. B. M.

Chains

68.90
84.90

Top of spur bears E. and W. and descend.
Set a sandstone 14 x 12 x 10 ins. 9 ins. in the ground,
for cor. on line marked S. 1/40 on S. face and raised a
stone mound alongside.

Pits impracticable.

124.90

To station No. 10

Land mountainous.

Soil 3rd rate.

Scattering oak timber and dense undergrowth of Chaparral.

Sept. 10th, 1895.

Having verified the course of the last line, as being
N. 1° 20' W. I continue on this angle from the live oak
tree marked S. 8 to what I consider a proper distance for
the N. boundary of T. 2 N. R. 17 W. and at
Set temporary cor. for secs. 2 and 35 on N. boundary of Tp.

162.31

Sept. 11th and 12th

I now go to cor. to Tps. 2 and 3 N., Rs. 16 and 17 W. and
run W. See page 5 book of exteriors.

The length of boundary line of Rancho Simi, from the
live oak tree, marked S. 8 to N. boundary of T. 2 N.,
R. 17 W. is therefore 162.41 chs. where I set cor.
description of which is given on page 6 book of exteriors.

Thence I run,

S. 1° 20' E. on a true line along boundary.

Va. 14° 30' East

Ascend.

5.31
7.31

Top of ridge bears E. and W. and descend.

Set a sandstone 16 x 12 x 4 ins. 11 ins. in the ground
for cor. on line marked S. 7/280 on S. face and raised a
stone mound alongside.

18.96
47.31

Cross gulch 10 lks. wide course E. and ascend.

A sandstone in place 12 x 8 x 6 feet above ground which
I marked S. 6/240 on S. face for cor. on line.

57.46
83.71

Top of spur bears N.E. and S.W. and descend.

Cross gulch 10 lks. wide, course E. and ascend.

86.96
87.31

Cross trail bears E. and W.

Set a sandstone 24 x 18 x 12 ins. 18 ins. in the ground for
cor. on line marked S. 5/280 on S. face and raised a stone
mound alongside.

Pits impracticable.

Resurvey

Boundary Line of Rancho Simi through
T. 2 N., R.17 W., S.E.M.

Chains

98.31 Top of ridge bears E. and W. and descend.
107.35 Cross gulch 8 lks. wide course S. 30° E. and ascend.
111.81 Top of spur bears N.W. and S.E. and descend.
118.46 Cross gulch 6 lks. wide course E. and ascend.
122.76 Top of spur bears E. and W. and descend.
127.31 Set a sandstone 24 x 14 x 8 ins. 18 ins. in the ground for
cor. on line marked S. 4/160 on S. face and raised a stone
mound alongside.
Pits impracticable.
131.26 Cross gulch 6 lks. wide course E. and ascend.
131.35 Cross road from Los Angeles to Ventura bears E. and W.
144.31 Top of spur bears E. and W. and descend.
148.96 Cross low sag bears E. and W. and ascend.
162.11 Cross old road from Los Angeles to Ventura bears E. and W.
162.41 To live oak tree marked S. 8.
Land mountainous.
Soil 3rd rate.
Scattering oak timber and dense undergrowth of Chaparral.
I carefully examine the adjustments of my solar compass
today, particularly the latitude and reversing apparatus
and found them correct.

Sept. 18th, 19th and 20th.

OFFICE OF U. S. SURVEYOR GENERAL

San Francisco, Cal., May, 1896

The foregoing Field Notes of the Surveys of The Boundary Lines of Rancho Simi, through Twps. 1 and 2 North, Range 17 West, San Bernardino Meridian, in the State of California, executed by J. R. Glover, U. S. Deputy Surveyor, under his contract 382 dated November 20th, 1884, having been critically examined, and the necessary corrections and explanations made, the said Field Notes and the surveys they described are hereby approved.

W. S. Green

U. S. Surveyor General for
California

OFFICE OF U. S. SURVEYOR GENERAL

San Francisco, Cal., May, 1896

I, U. S. Surveyor General for California, do hereby certify that the foregoing Transcript has been correctly copied from the Original Field Notes, as the same remain of record and on file in this Office.

Attest my hand and Official Seal, the
day and date herein above written.

W. S. Green

U. S. Surveyor General for
California