


FD 9360

COPIED FROM GOVERNMENT FIELD NOTES
LOANED BY
U.S. GENERAL LAND OFFICE
SAN FRANCISCO.

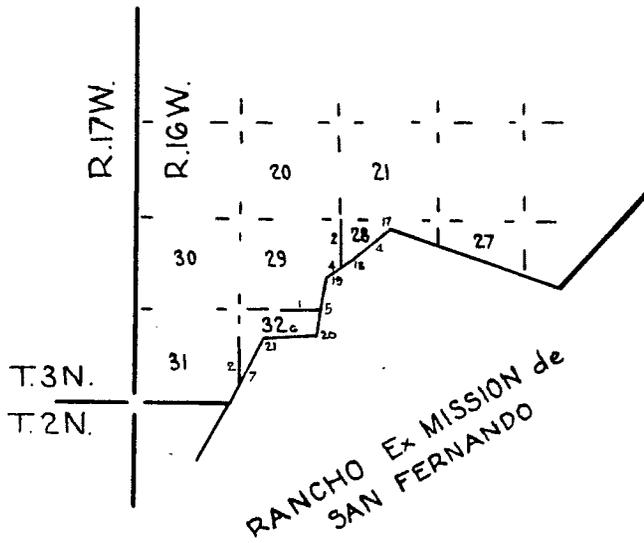

DEPARTMENT OF THE INTERIOR

GENERAL LAND OFFICE

Office of Public Survey.

San Francisco, California,


June 3, 1927.

I, OFFICE CADASTRAL ENGINEER FOR CALIFORNIA,
do hereby certify that the annexed transcript of the
field notes of survey of corners of Rancho Ex Mission
San Fernando, from Corner No.17 to South Boundary of
Township No.3 North, Range No.16 West, San Bernardino
Meridian, is a true and literal exemplification of said
field notes as they remain on file and of record in
this office.

Frank E. Barker

Office Cadastral Engineer,

for California.

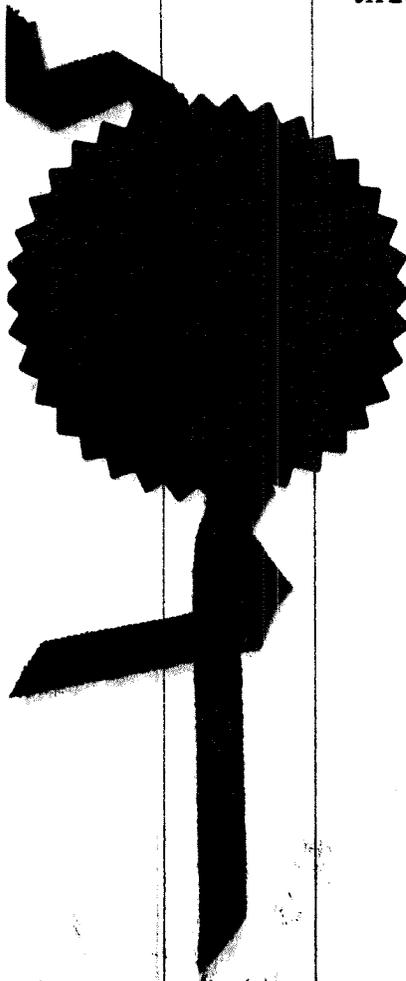

Subdivisions T 3 N., R. 16 W., S. B. M.

From the witness to quarter section corner previously described and set at 42.50 chains east from the corner to sections 29, 30, 31 and 32, I run East on a true line between sections 29 and 32.

1.00 Leave dense chamisal and ascend open hills.

11.00 Top of spur trends south + 600 feet above section corner and descend.

16.00 Cross gulch 10 links wide, course south - 100 feet and ascend.

30.07 Intersect course No. 19 of Rancho Ex Mission San Fernando North $4^{\circ}49'$ East, 21.93 chains from corner S.F. No. 20,

described by me in Resurvey of Rancho Ex Mission San Fernando in my contract No. 136, dated August 22, 1896, and

Set a walnut post 3 feet long, 4 inches square, with marked stone 24 inches in the ground for closing corner to sections 29 and 32, marked

C C T 3 N R 16 W on west;

S 29 on north and

S. 32 on south faces;

with 1 groove on south and 4 grooves on east faces, and raised a mound of stone 2 feet base, $1\frac{1}{2}$ feet high west of corner.

Pits impracticable.

Land, broken and mountainous.

Soil, second and third rate.

Timber oak and walnut.

Undergrowth same and chamisal.

From the quarter section corner, between sections 31 and 32, previously set by me, I run

South $0^{\circ}1'$ East between sections 31 and 32.

Descend.

6.00 Cross dry wash 8 links wide, course east.

Subdivisions T.3 N., R.16 W., S.B.M.

- 9.50 Ascend.
- 20.68 Intersect course No.21 of Rancho Ex Mission San Fernando S 13°34' West 7.30 chains distant from corner S.F.1/40-c. described by me in resurvey of Rancho Ex Mission San Fernando in my contract No.136, dated August 22, 1896, and Set a limestone 14 x 10 x 6 inches 10 inches in the ground for closing corner to sections 31 and 32, marked C C on north, with 1 groove on west and 5 grooves on east faces, and raised a mound of stone 2 feet base 1½ feet high north of corner.
- Pits impracticable.
- Land, broken and mountainous.
- Soil, second rate.
- Timber, oak and walnut.
- Dense undergrowth of same and chamisal.
-
- From the corner to sections 20, 21, 28 and 29, previously set, I run
- South 0°1' East between sections 28 and 29.
- Descend.
- 5.50 Cross dry wash, 20 links wide, course north 28° east.
- 6.50 Ascend.
- 16.00 Summit of Santa Susanna mountains, bears north 70° west and south 70° east + 200 feet above corner and continue ascent along on top of mountain.
- 26.50 Top of high point near west slope + 500 feet above corner and descend.
- 35.50 Intersect corner No.18 of Rancho Ex Mission San Fernando North 38° east, 5.28 chains distant from corner S.F.No.19, described by me in resurvey of Rancho Ex Mission San Fernando in my contract No.136, dated August 22, 1896, and Set a walnut post 3 feet long, 4 inches square, with marked stone 24 inches in the ground for closing corner

Subdivisions T.3 N., R.16 W., S.B.M.

to sections 28 and 29, marked

C C T 3 N R 16 W on north

S 28 on east and

S 29 on west faces;

with 1 groove on south and 5 grooves on north faces and raised a mound of stone 2 feet base, $1\frac{1}{2}$ feet high north of corner.

Pits impracticable; from which

A walnut 18 inches diameter bears south $62\frac{1}{2}$ west 145 links distant, marked

T 3 N R 16 W S 29 B T.

No other tree within limits.

Land, broken and mountainous.

Soil, second rate.

Timber, oak and walnut.

Undergrowth same and chamisal.

November 23, 1896.

----- ✓

Resurvey of Rancho Ex Mission San Fernando,
T.3 N., R.16 W., S.B.M.

Knowing from private surveys that the course given by Deputy Surveyor Hancock, South 75° West is erroneous, I place my instrument on top of hill from which both corners No.17 and 18 are visible and find the true course to be South 57°38' West.

Then, from corner S.F.No.17,
South 57°38' West, on a random line.

28.06 To corner S.F.No.18.

Station of U.S.Coast Survey.

A sandstone 6 inches square, marked "U.S.C.S.", a large mound of rock built over it, and old charred post in mound marked "S.F.No.18".

This corner stands on summit of Santa Susanna Mountain.
Thence-

North 57°38' East. on a true line.

Along summit of Santa Susanna Mountains, through timber.

10.00 Descend.

28.06 To corner S.F.No.17.

Land, mountainous.

Soil, second rate.

Timber, oak and walnut.

Undergrowth, same.

From corner S.F.No.18, I run
South 38° West, on a random line.

15.24 To point for corner No.19, where I find remains of old stone mound and old bearing tree.

A white oak 18 inches diameter bears North 25° East, 13 links distant.

And set a new walnut post 4 feet long, 4 inches square, 24 inches in the ground, marked "S.F.No.19" on east face, and rebuilt the stone mound to 2 feet base, 1½ feet high west of corner.

Resurvey of Rancho Ex Mission San Fernando,
T.3 N., R.16 W., S.B.M.

- Pits impracticable.
- Thence I run
North 38° East, on a true line.
Ascend gradually in scattering timber.
- 15.24 To corner S.F.No.18.
Land, mountainous.
Soil, second rate.
Timber, oak and walnut.
Undergrowth, same.
-
- From S.F.No.19, I run
South 4°45' West, on a random line.
- 63.00 To a point South 85°15' East, 07 links from the large mound of rocks, at angle of fences, and set an oak post 4 feet long, 4 inches square, 24 inches in the ground, marked "S.F.No.20" on east face, and rebuilt the mound of stone to 2 feet base, 1½ feet high west of corner.
Pits impracticable.
- Thence I run
North 4°49' East, on a true line.
Over mesa.
- 8.00 Cross trail from Mormon Creek to Summit of Mountain, bears northeast and southwest.
- 17.60 Cross dry wash; course southwest and ascend.
- 40.00 Set an oak post 4 feet long, 4 inches square, 24 inches in the ground, marked "S.F." on side facing ranch and "to C" on side facing last described corner, and raised a mound of stone 2 feet base, 1½ feet high west of corner.
Pits impracticable.
- 63.00 To corner S.F.No.19.
Land, mountainous.
Soil, second rate.
Timber of oak and walnut.

Resurvey of Rancho Ex Mission San Fernando,
T.3 N., R.16 W., S.B.M.

Undergrowth of same.

November 13, 1896.

November 14, at 7 h. 45 m. A.M., corrected local mean time. Latitude $34^{\circ}18'$ North. I set off Decl. $18^{\circ}26'$ South, and determined my course by solar compass.

From S.F.No.20, I run

South $77^{\circ}30'$ West, on a random line.

66.06 To a point South $12\frac{1}{2}^{\circ}$ East, 13 links from corner S.F.No. 21, which is a large stone mound with old decayed post. I set new walnut post 4 feet long, 4 inches square, with marked stone 24 inches in the ground, marked "S.F.No.21" on south face, and rebuilt mound of stone to 4 feet base and 2 feet high around corner.

Pits impracticable. From which

A walnut tree 8 inches diameter, bears North $16^{\circ}35'$ East, 75 links distant, marked corner S.F.21 B T.

Thence

North $77^{\circ}37'$ East, on a true line.

Descend.

0.50 Cross gulch 5 links wide; course southeast and ascend.

9.00 Top of hill and descend.

14.00 Cross Mormon Creek, 8 links wide; course south and ascend.

15.10 Cross road, bears north and south.

18.00 Ascend steep slope in white sage brush.

32.00 Top of mesa and leave brush, bears north and south.

40.00 Set an oak post, 4 feet long, 4 inches square, with marked stone 24 inches in the ground, marked "S.F." on side of post facing ranch, and "40" on side facing last described corner, and raised a mound of stone 2 feet base, $1\frac{1}{2}$ feet high north of corner.

Pits impracticable. From which

Resurvey of Rancho Ex Mission San Fernando,
T.3 N., R.16 W., S.B.M.

- A white oak 14 inches diameter, bears South 38° 05' West, 232 links distant, marked "S. F. $\frac{1}{4}$ C.B.T."
- 57.50 Hansons house, bears north 5 $\frac{1}{4}$ ° West 9.44 links distant. Spring noted by Hancock bears South 27 $\frac{1}{2}$ ° East, 208 links distant.
- 66.06 To corner S.F.No.20.
Land, mountainous.
Soil, second and third rate.
Timber, oak and walnut.
Undergrowth of same and white sage.
-
- From corner S.F.No.21, I run
South 13°30' West, on a random line.
- 57.31 To a point south 70°30' East, 6 links distant, from closing corner to Townships 2 and 3 North. Range 16 West, established by Deputy Glover, which is a redwood post 4 feet long, 4 inches square, set firmly in the ground, marked and witnessed as described by Surveyor-General. From this corner, Henry Mangle's house bears north 31° West, 18.30 chains distant.
Thence I run
North 13°34' East, on a true line.
Ascending.
- 19.37 Top of spur trends west + 175 feet and descend.
- 25.50 Cross Mormon Creek, 8 links wide; course south 70° west, - 50 feet.
- 25.70 Cross road bears Southwest and east and ascend.
- 40.00 Set a lime stone 15 x 14 x 10 inches, 10 inches in the ground, marked "S.F." on side facing Rancho and " $\frac{1}{4}$ C" on side facing last described corner, and raised a mound of stone, 2 feet base, 1 $\frac{1}{2}$ feet high west of corner.
Pits impracticable.
- 57.31 To corner S.F.No.21.

Resurvey of Rancho San Fernando,
T. 3 N., R. 16 W., S. B. M.

Land, mountainous.

Soil, second and third rate.

Timber of oak.

Undergrowth same and chamisal.

November 14, 1896.
